ZH9 Block Diagram (AMD Nile Platform)

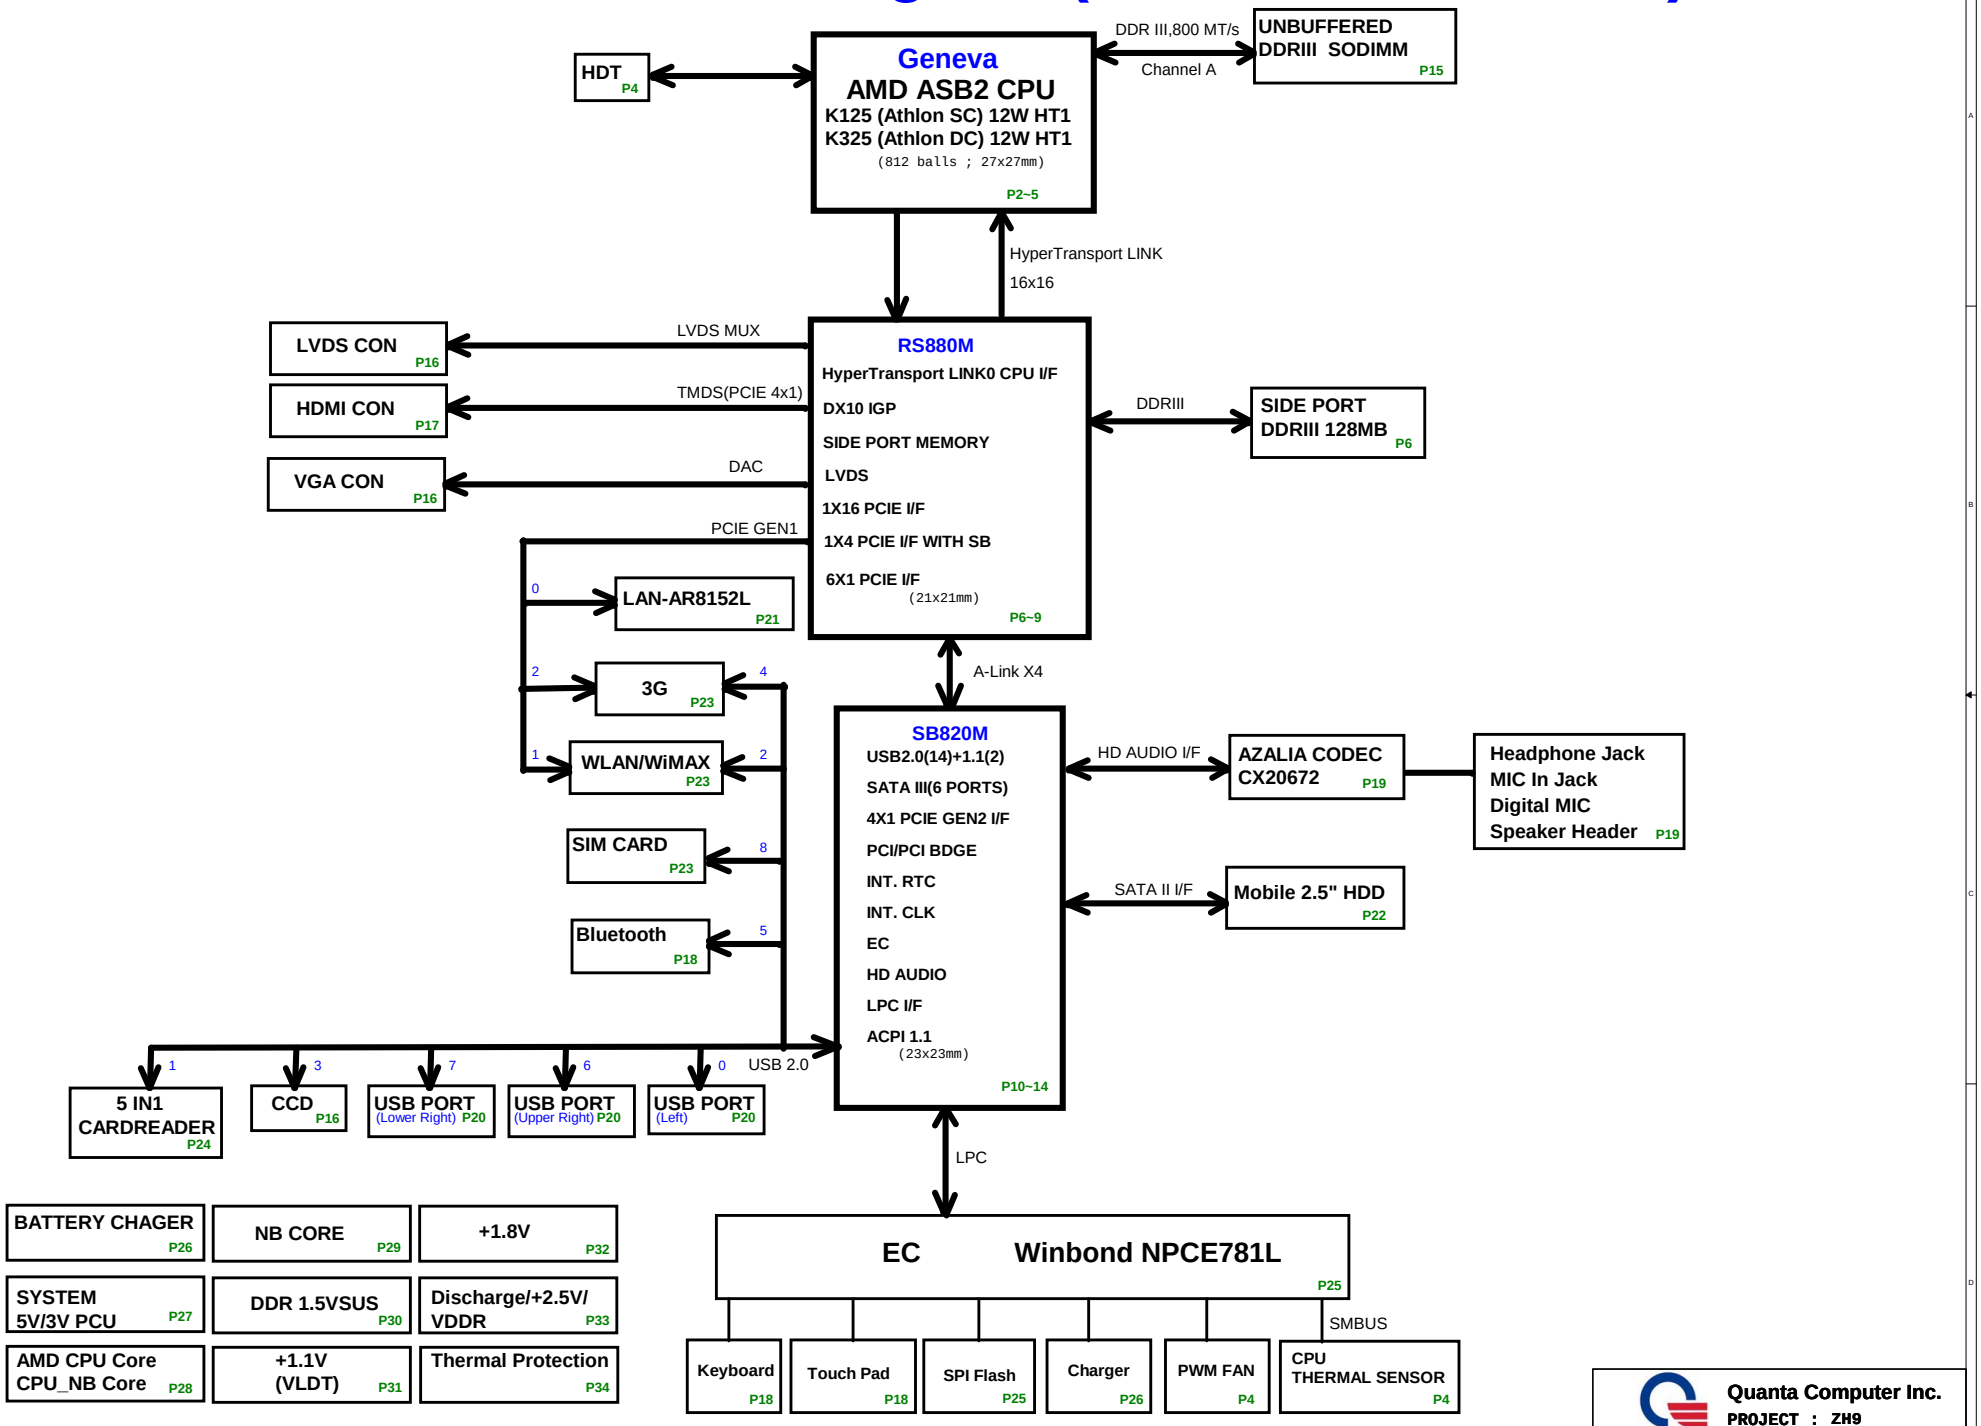

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	Block Diagram	4A

Date: Sunday, March 28, 2010 Sheet 1 of 40

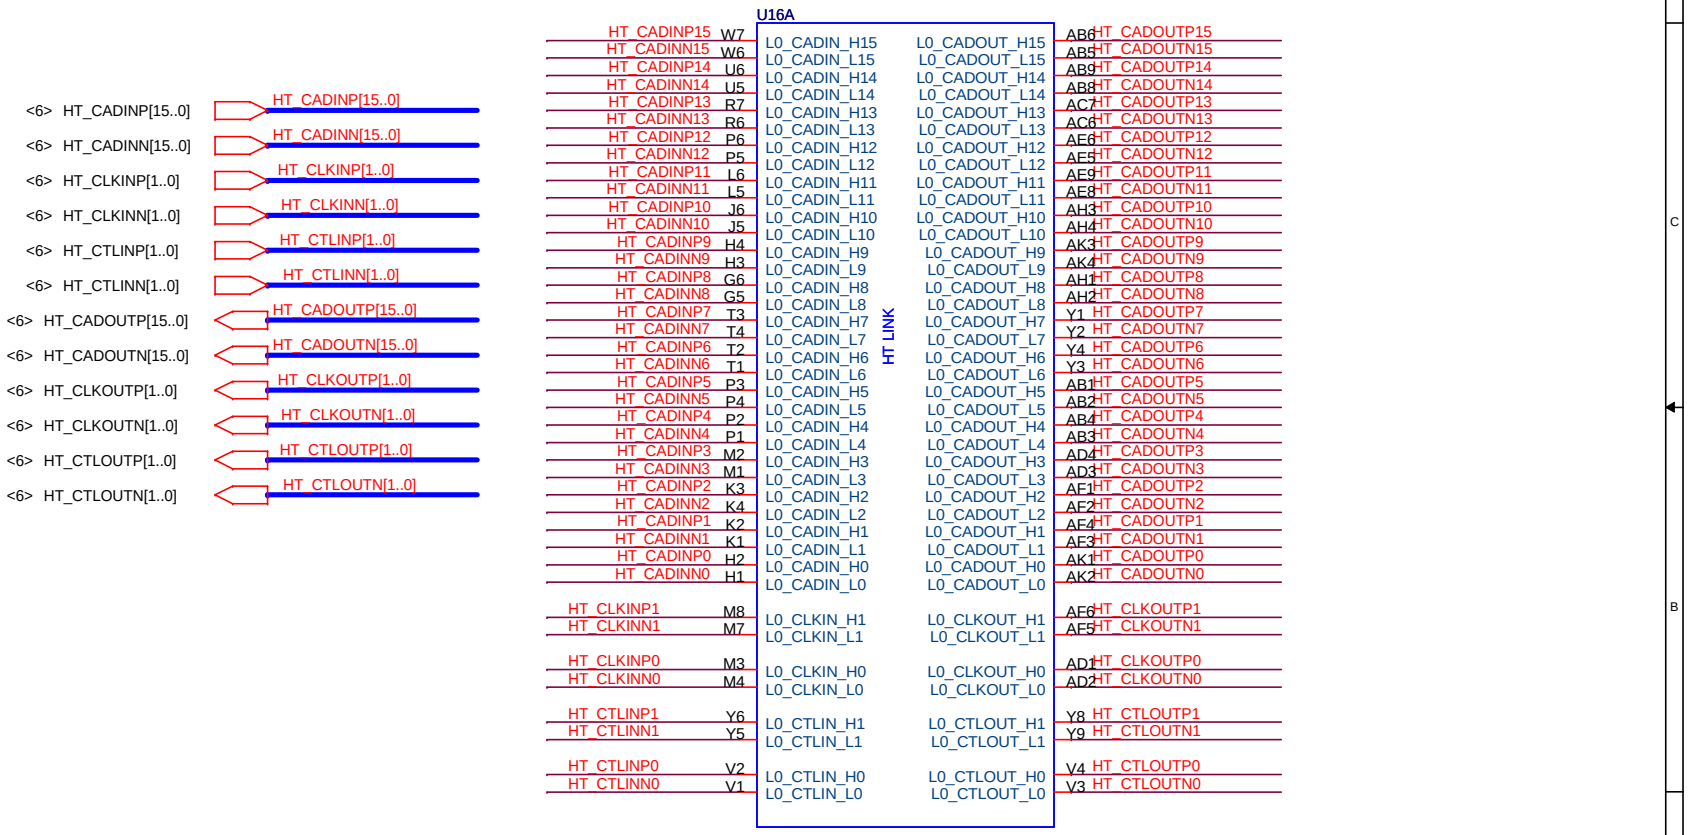

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	ASB2 HT I/F 1/4	4A

Date: Sunday, March 28, 2010 Sheet 2 of 40

Processor Memory Interface

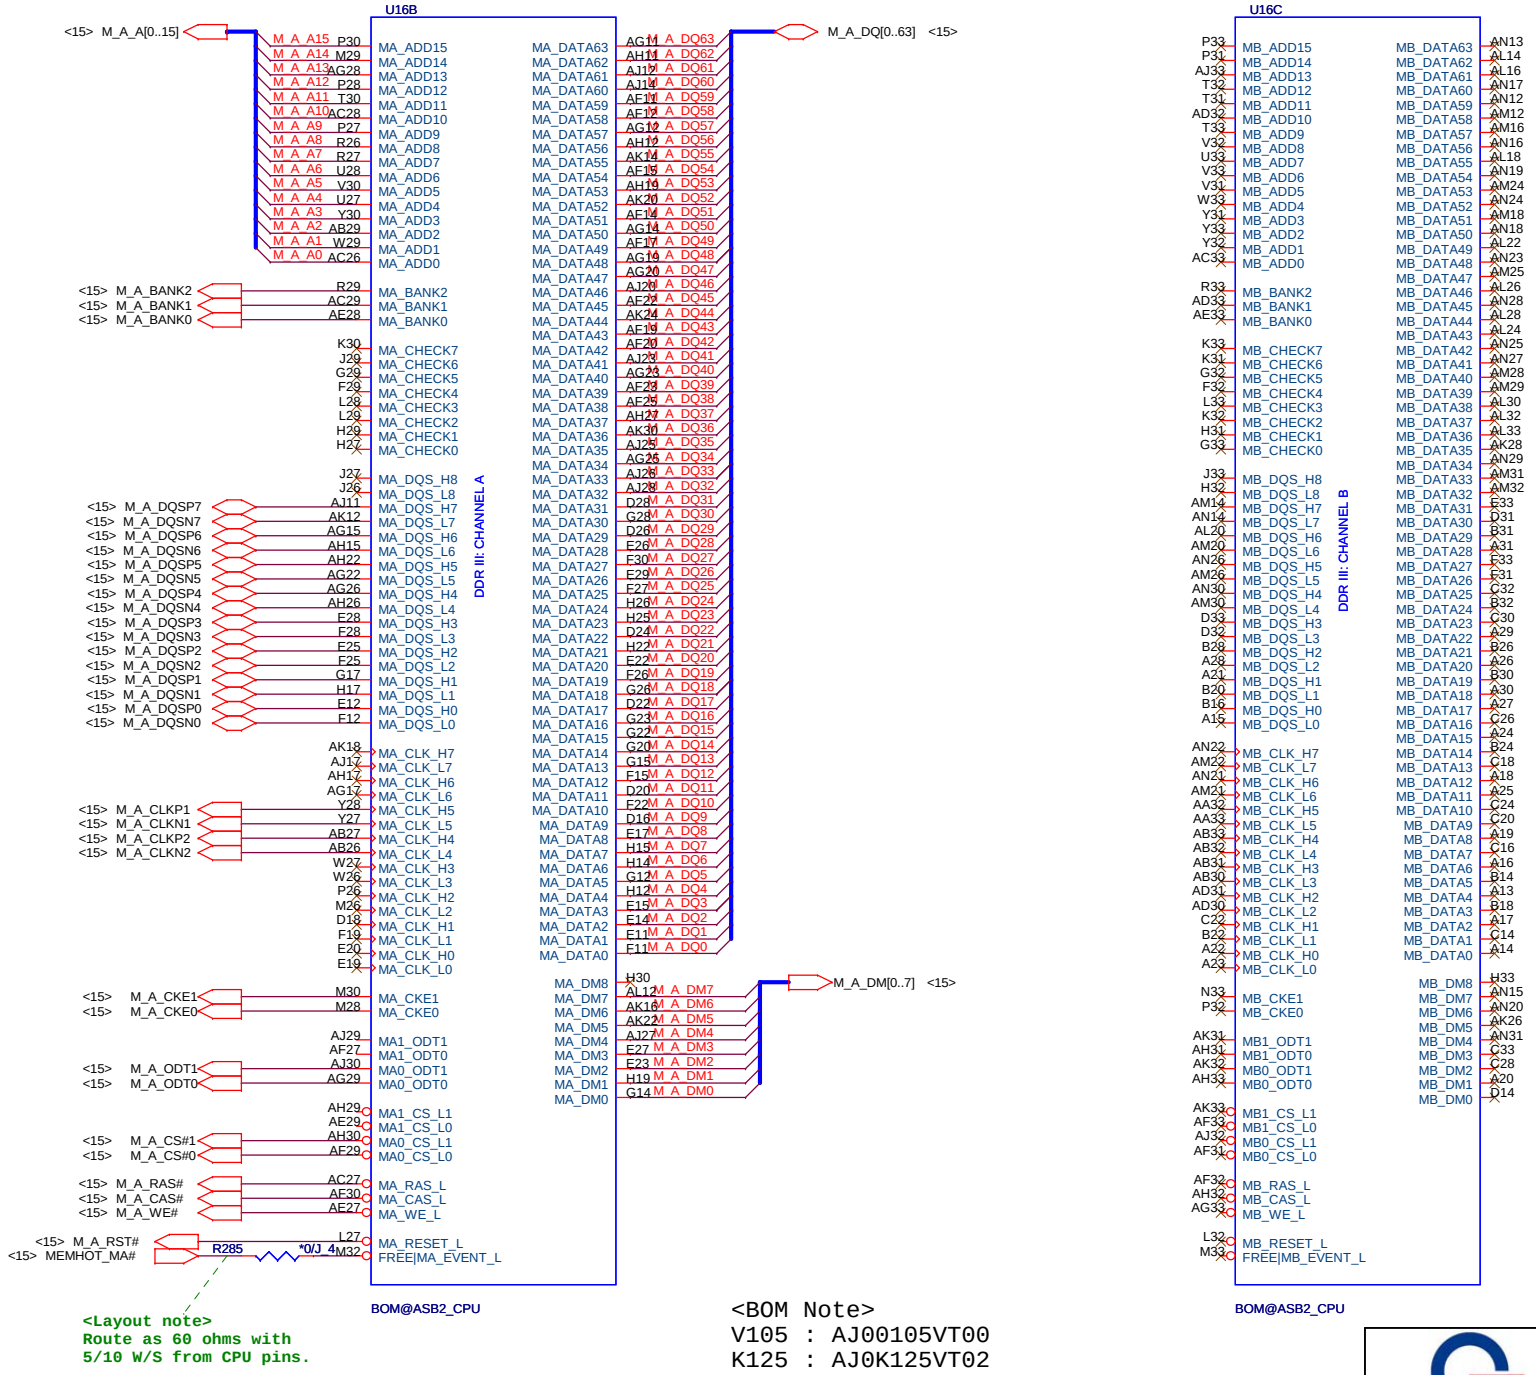

<Layout note>
Route as 60 ohms with
5/10 W/S from CPU pins.

<BOM Note>
V105 : AJ00105VT00
K125 : AJ0K125VT02
K325 : AJ0K325VT02
K625 : AJ0K625VT03

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	ASB2 DDRIII MEMORY 2/4	4A
Date: Sunday, March 28, 2010	Sheet 3 of 40	

CPU Thermal monitor(THM)

<20100303(C3A)>
Reserve R266,C315,C316,U15,R276,R410 and stuff R51~R53,R48,Q7~Q9,D2,D3,R411, for AMD SB-TSI.

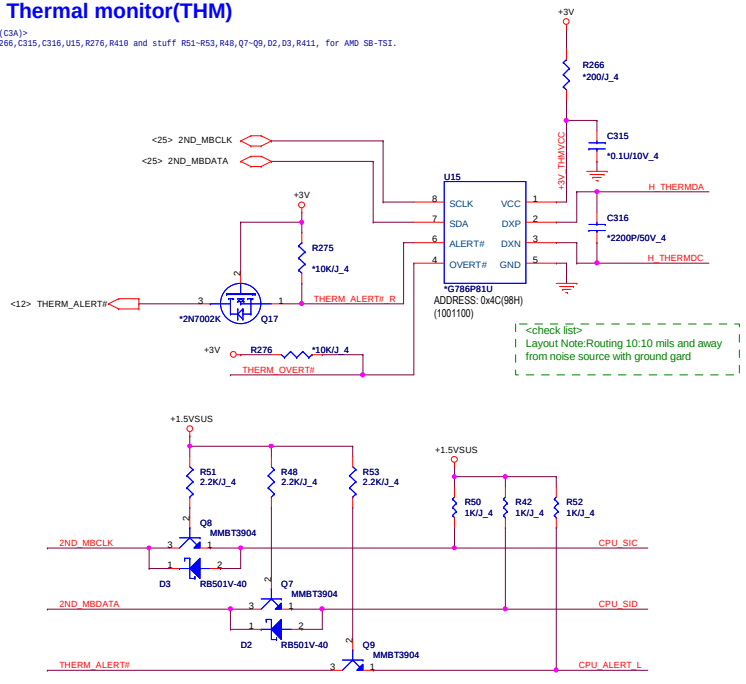

CPU FAN(THM)

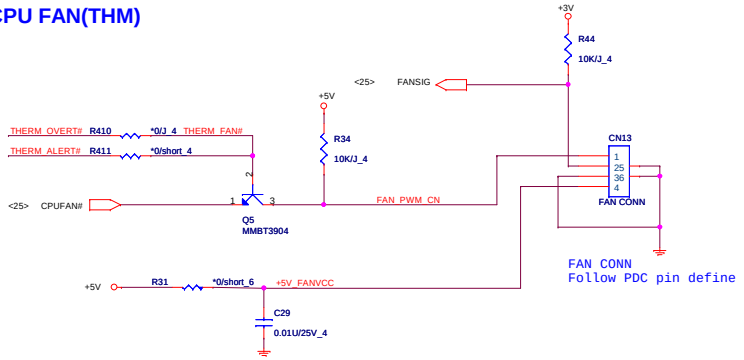

HDT Connector

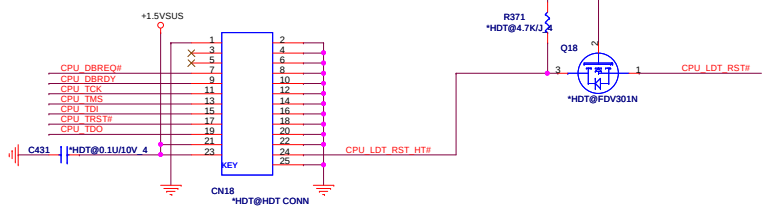

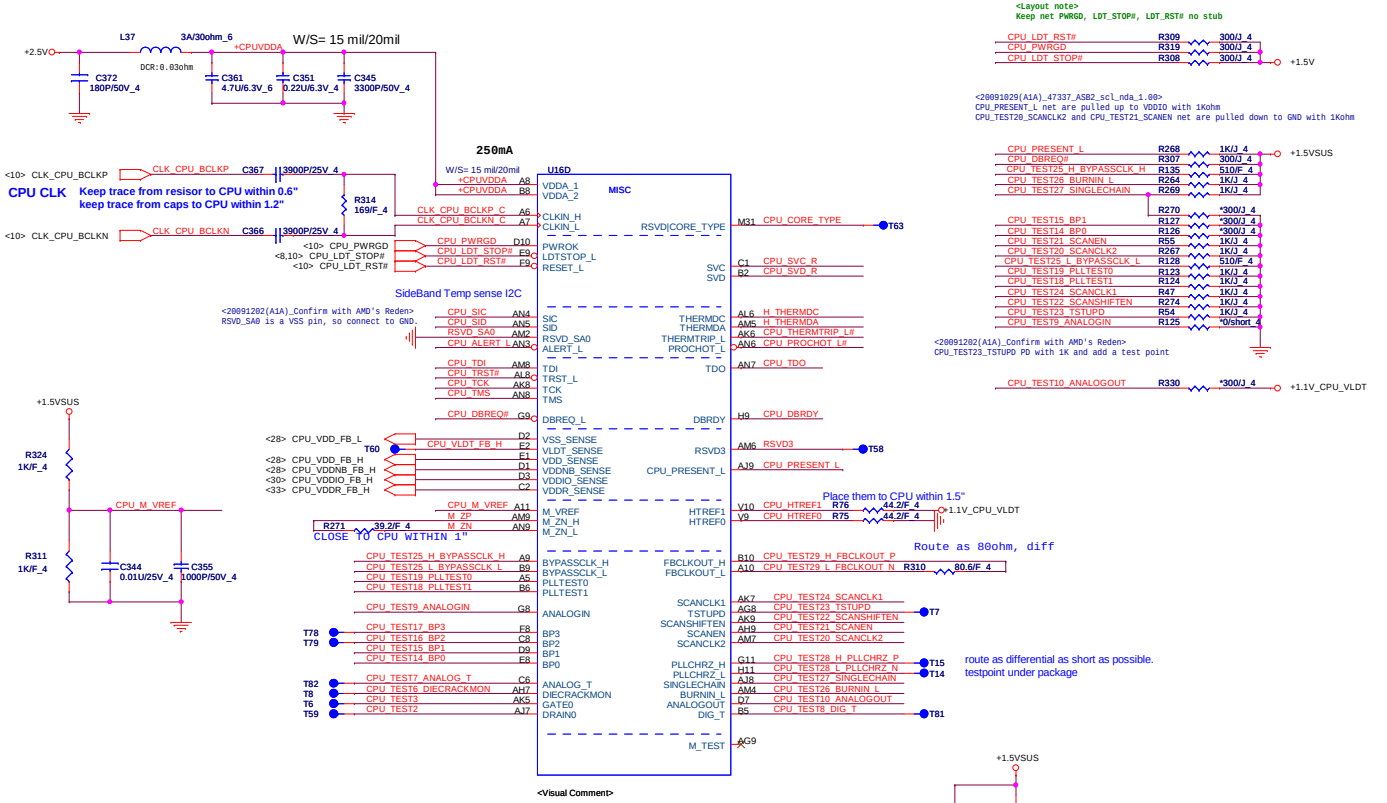

Serial VID

To override VID,
Remove three 0ohms and install 220ohm of CPU_PWRGD to GND

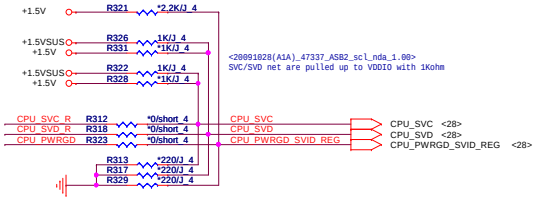

Pre-PWROK Metal MODE | VFIX MODE(Don't Support)

SVC	SVD	Voltage Output	Voltage Output
0	0	1.1V	1.4V
0	1	1.0V	1.2V
1	0	0.9V	1.0V
1	1	0.8V	0.8V

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	ASB2 CTRL & DEBUG 3/4	4A

Date: Sunday, March 28, 2010 Sheet 4 of 40

PROCESSOR POWER AND GROUND

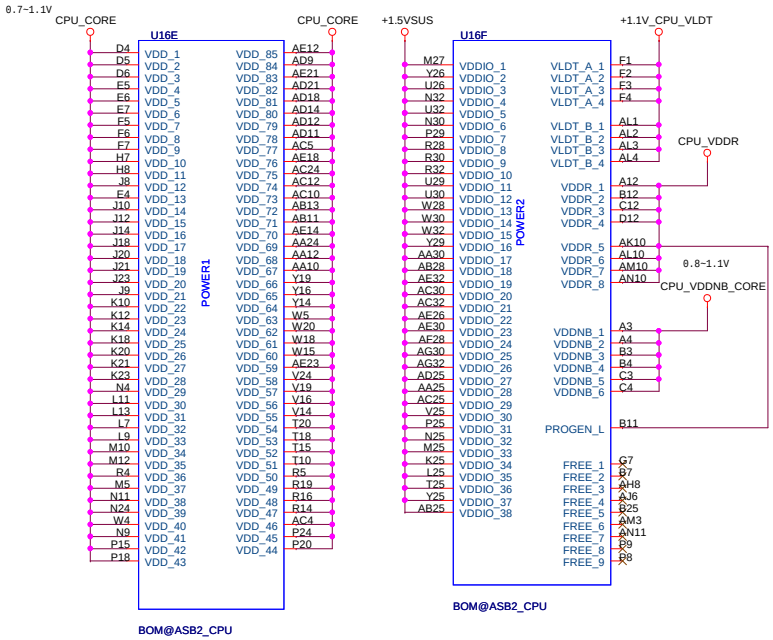

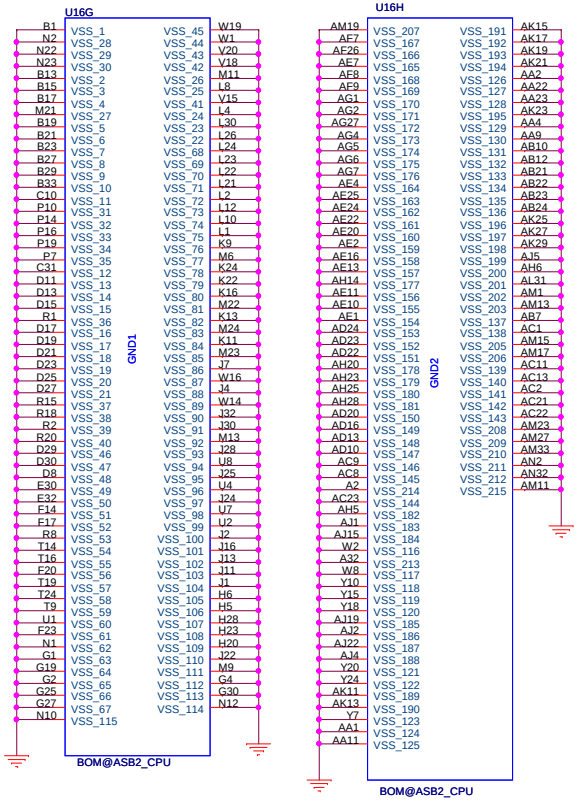

BOTTOM SIDE DECOUPLING

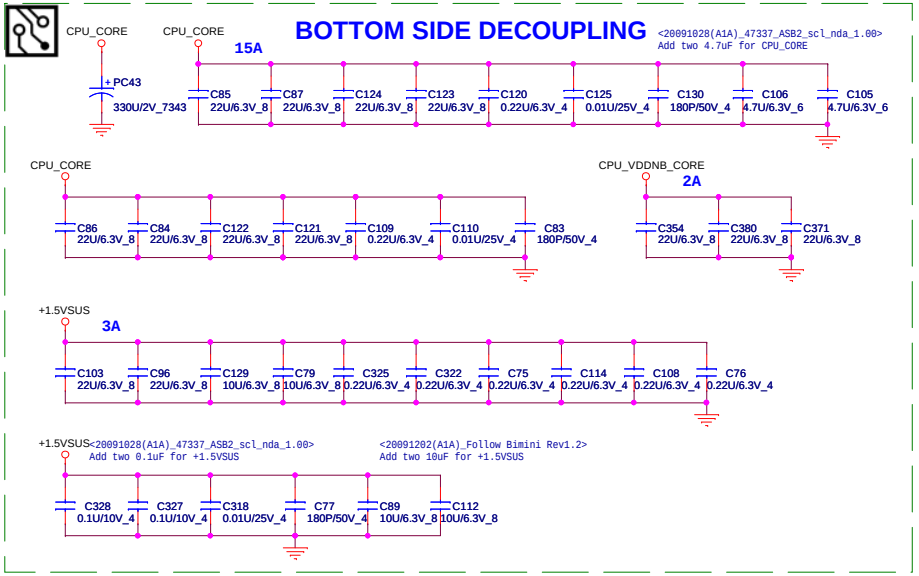

PLACE CLOSE TO PROCESSOR AS POSSIBLE

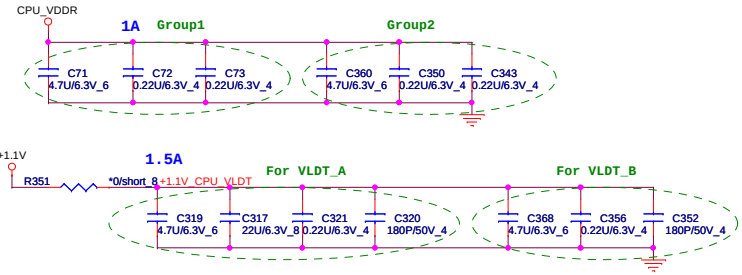

DECOUPLING BETWEEN PROCESSOR AND DIMMs
PLACE CLOSE TO PROCESSOR AS POSSIBLE

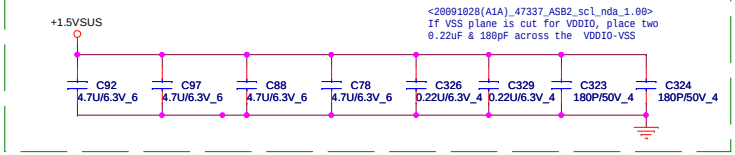

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	ASB2 PWR & GND 4/4	4A

Date: Sunday, March 28, 2010 Sheet 5 of 40

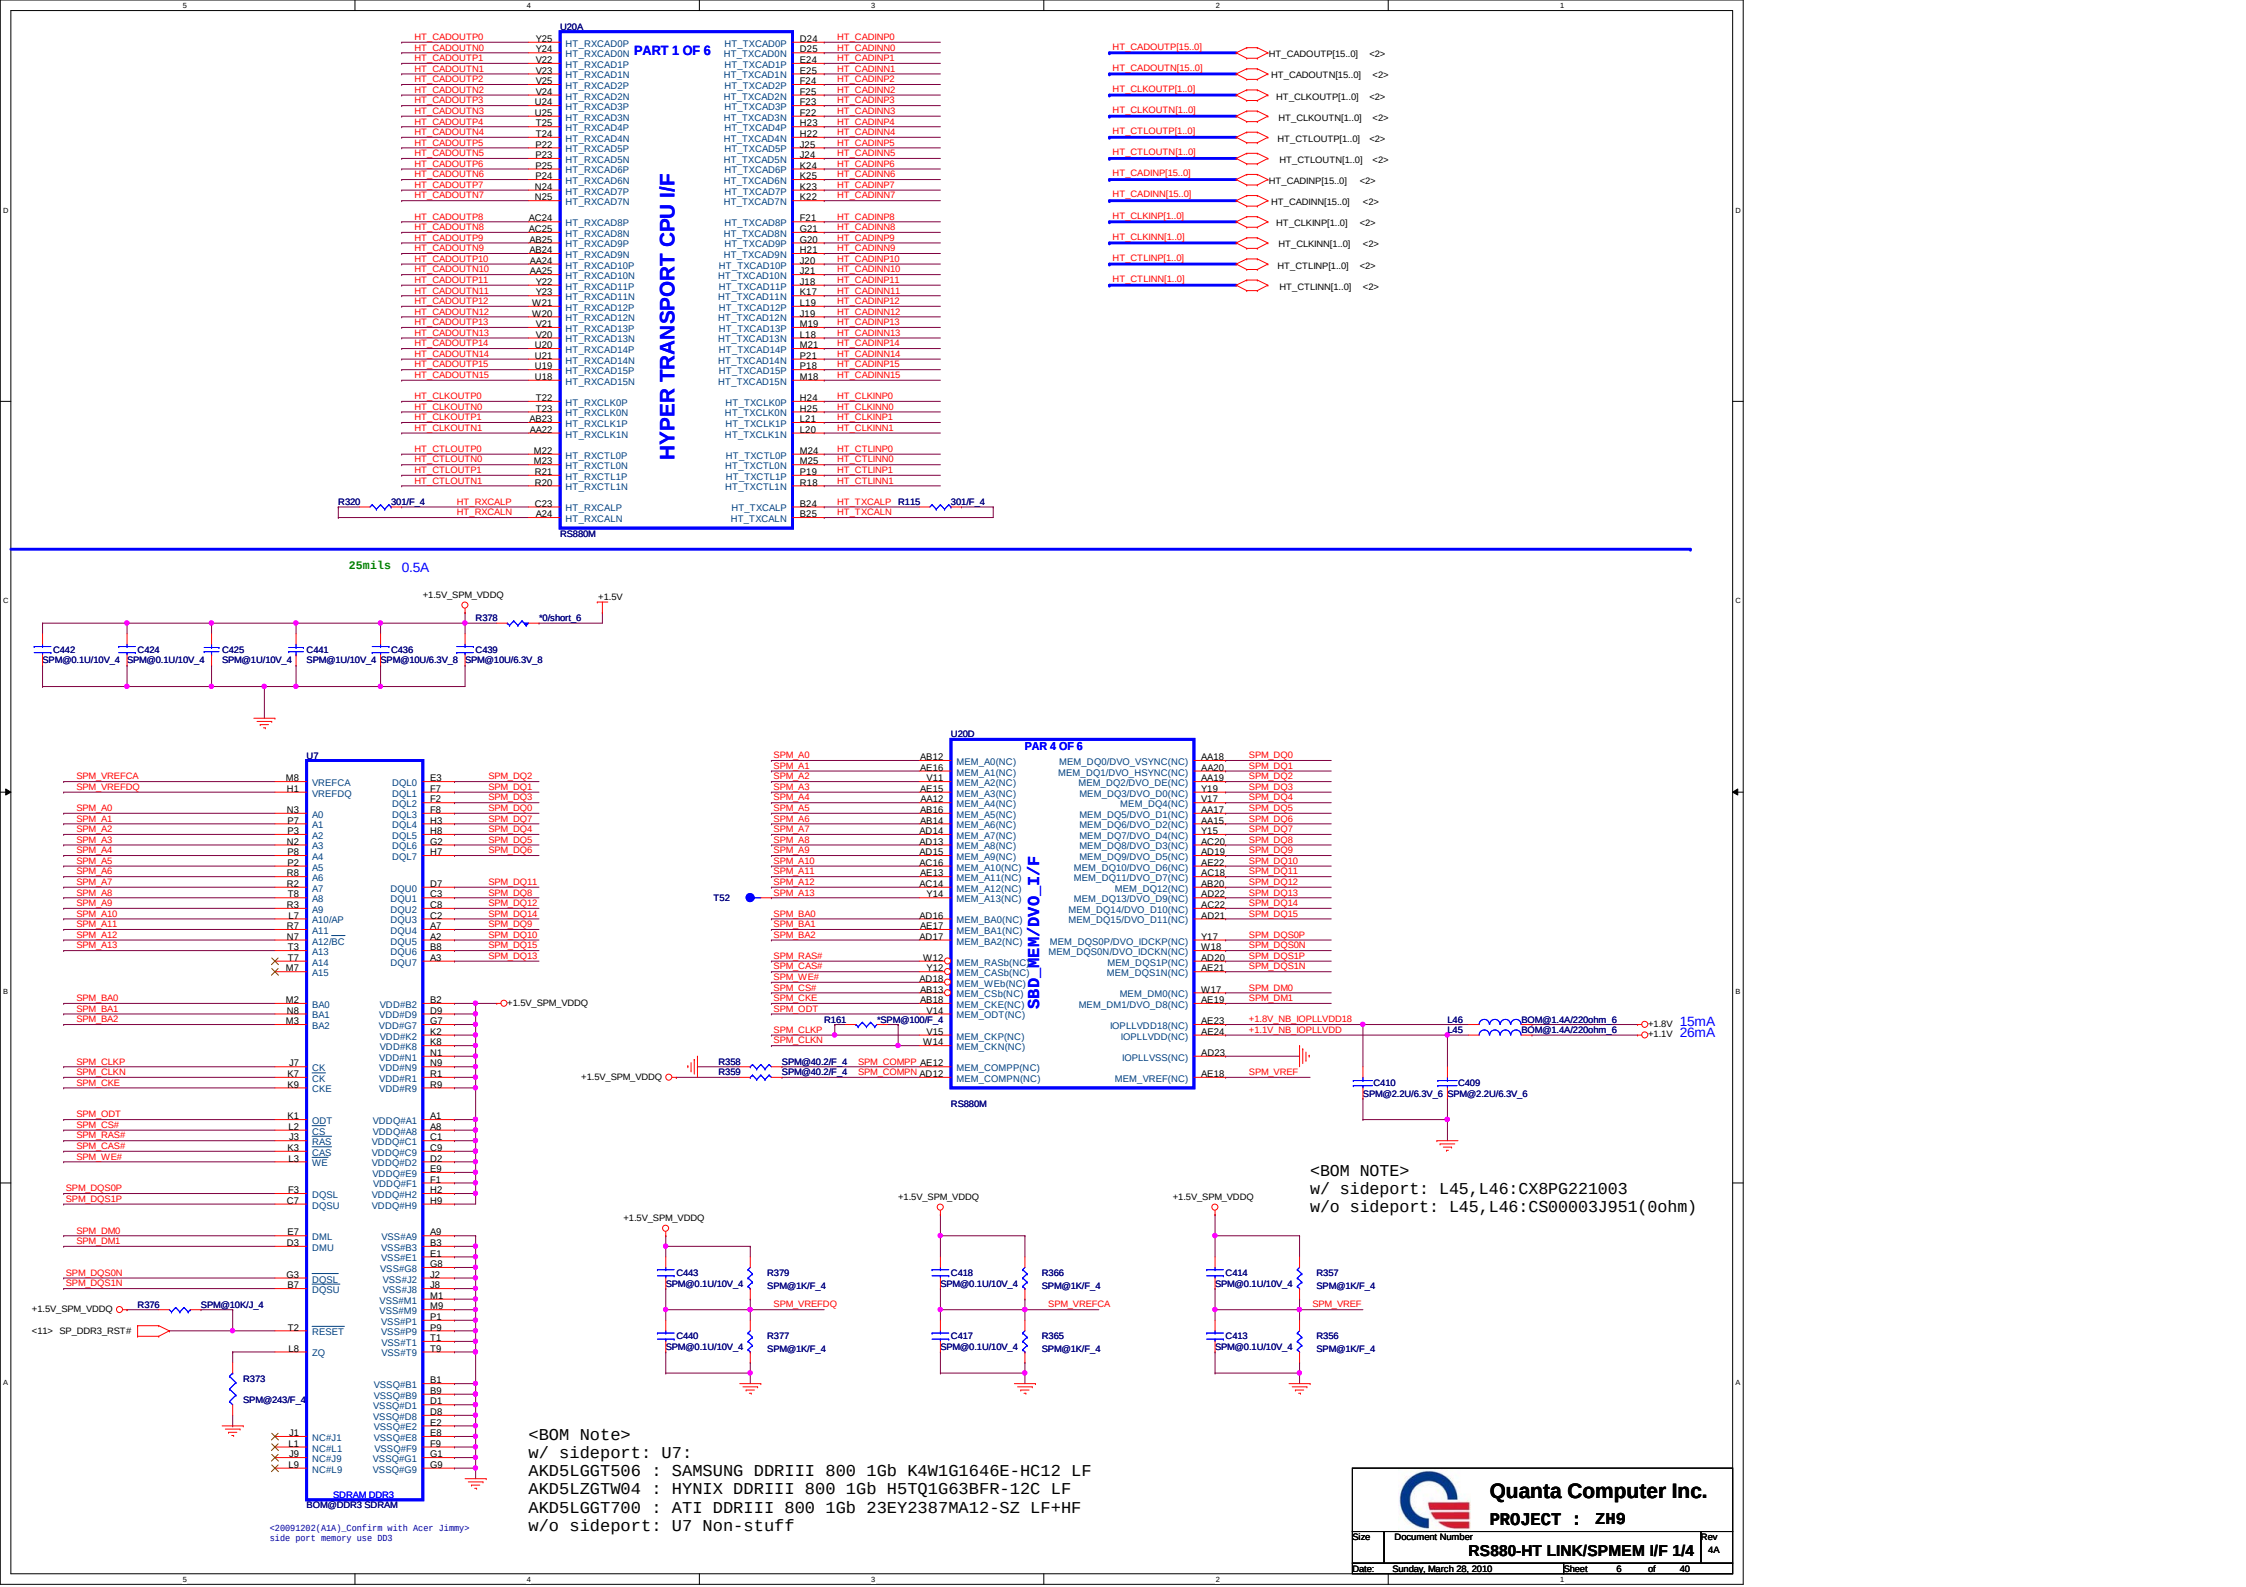
U20A
PART 1 OF 6
HYPER TRANSPORT CPU I/F
RS880M
HT_CADOUTP[15..0]
HT_CADOUTN[15..0]
HT_CLKOUTP[1..0]
HT_CLKOUTN[1..0]
HT_CTLOUTP[1..0]
HT_CTLOUTN[1..0]
HT_CADINP[15..0]
HT_CADINN[15..0]
HT_CLKINP[1..0]
HT_CLKINN[1..0]
HT_CTLINP[1..0]
HT_CTLINN[1..0]
R320 301/F_4
R115 301/F_4
25mils 0.5A
+1.5V_SPM_VDDQ
+1.5V
R378 *0/short_6
C442 SPM@0.1U/10V_4
C424 SPM@0.1U/10V_4
C425 SPM@1U/10V_4
C441 SPM@1U/10V_4
C436 SPM@10U/6.3V_8
C439 SPM@10U/6.3V_8
U7
SDRAM DDR3
BOM@DDR3 SDRAM
U20D
PAR 4 OF 6
SBD_MEM/DVO_I/F
T52
R161 *SPM@100/F_4
R358 SPM@40.2/F_4
R359 SPM@40.2/F_4
L46 BOM@1.4A/220ohm_6
L45 BOM@1.4A/220ohm_6
+1.8V 15mA
+1.1V 26mA
C410 SPM@2.2U/6.3V_6
C409 SPM@2.2U/6.3V_6
R376 SPM@10K/J_4
R373 SPM@243/F_4
C443 SPM@0.1U/10V_4
R379 SPM@1K/F_4
C440 SPM@0.1U/10V_4
R377 SPM@1K/F_4
C418 SPM@0.1U/10V_4
R366 SPM@1K/F_4
C417 SPM@0.1U/10V_4
R365 SPM@1K/F_4
C414 SPM@0.1U/10V_4
R357 SPM@1K/F_4
C413 SPM@0.1U/10V_4
R356 SPM@1K/F_4
<BOM NOTE>
w/ sideport: L45,L46:CX8PG221003
w/o sideport: L45,L46:CS00003J951(0ohm)
<BOM Note>
w/ sideport: U7:
AKD5LGGT506 : SAMSUNG DDRIII 800 1Gb K4W1G1646E-HC12 LF
AKD5LZGTW04 : HYNIX DDRIII 800 1Gb H5TQ1G63BFR-12C LF
AKD5LGGT700 : ATI DDRIII 800 1Gb 23EY2387MA12-SZ LF+HF
w/o sideport: U7 Non-stuff
<20091202(AIA)_Confirm with Acer Jimmy>
side port memory use DD3
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
RS880-HT LINK/SPMEM I/F 1/4
Rev 4A
Date: Sunday, March 28, 2010
Sheet 6 of 40

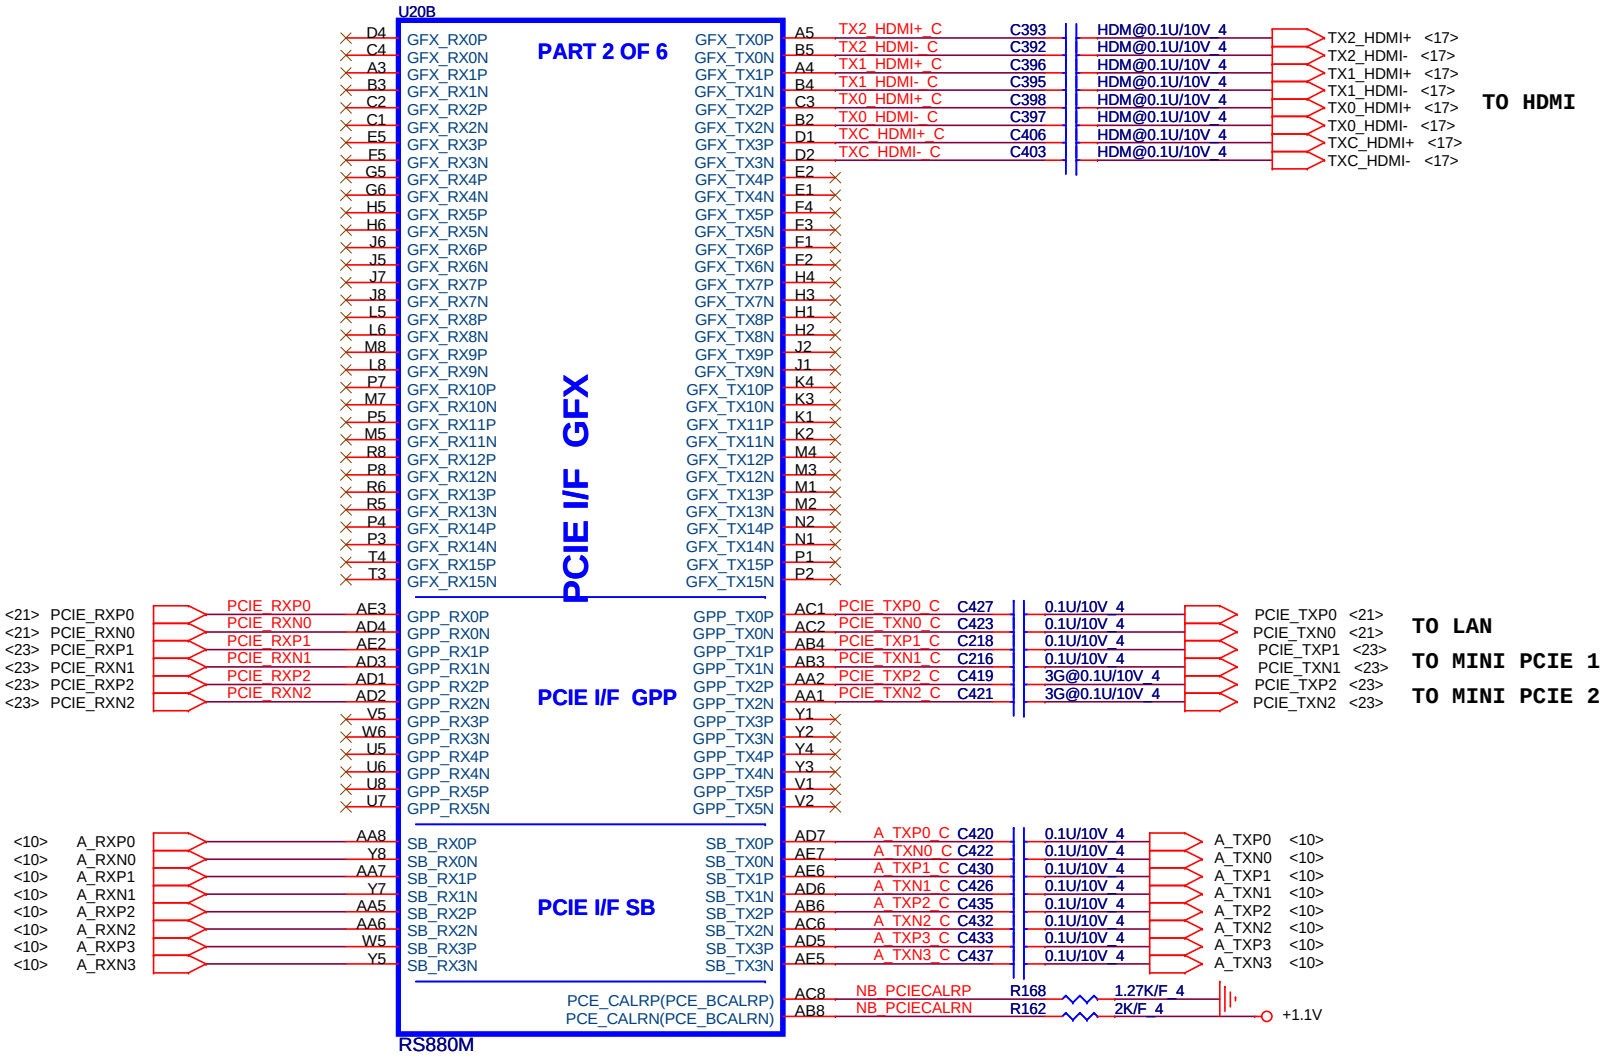

RS880 Display Port Support (muxed on GFX)

DP0	GFX_TX0,TX1,TX2 and TX3 AUX0 and HPD0
DP1	GFX_TX4,TX5,TX6 and TX7 AUX1 and HPD1

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	RS880-PCIE I/F 2/4	4A

Date: Sunday, March 28, 2010 Sheet 7 of 40

Note:Regarding LDT_STOP# signal,It's required within 40ns skew for both assertion and de-assertion between NB and CPU.

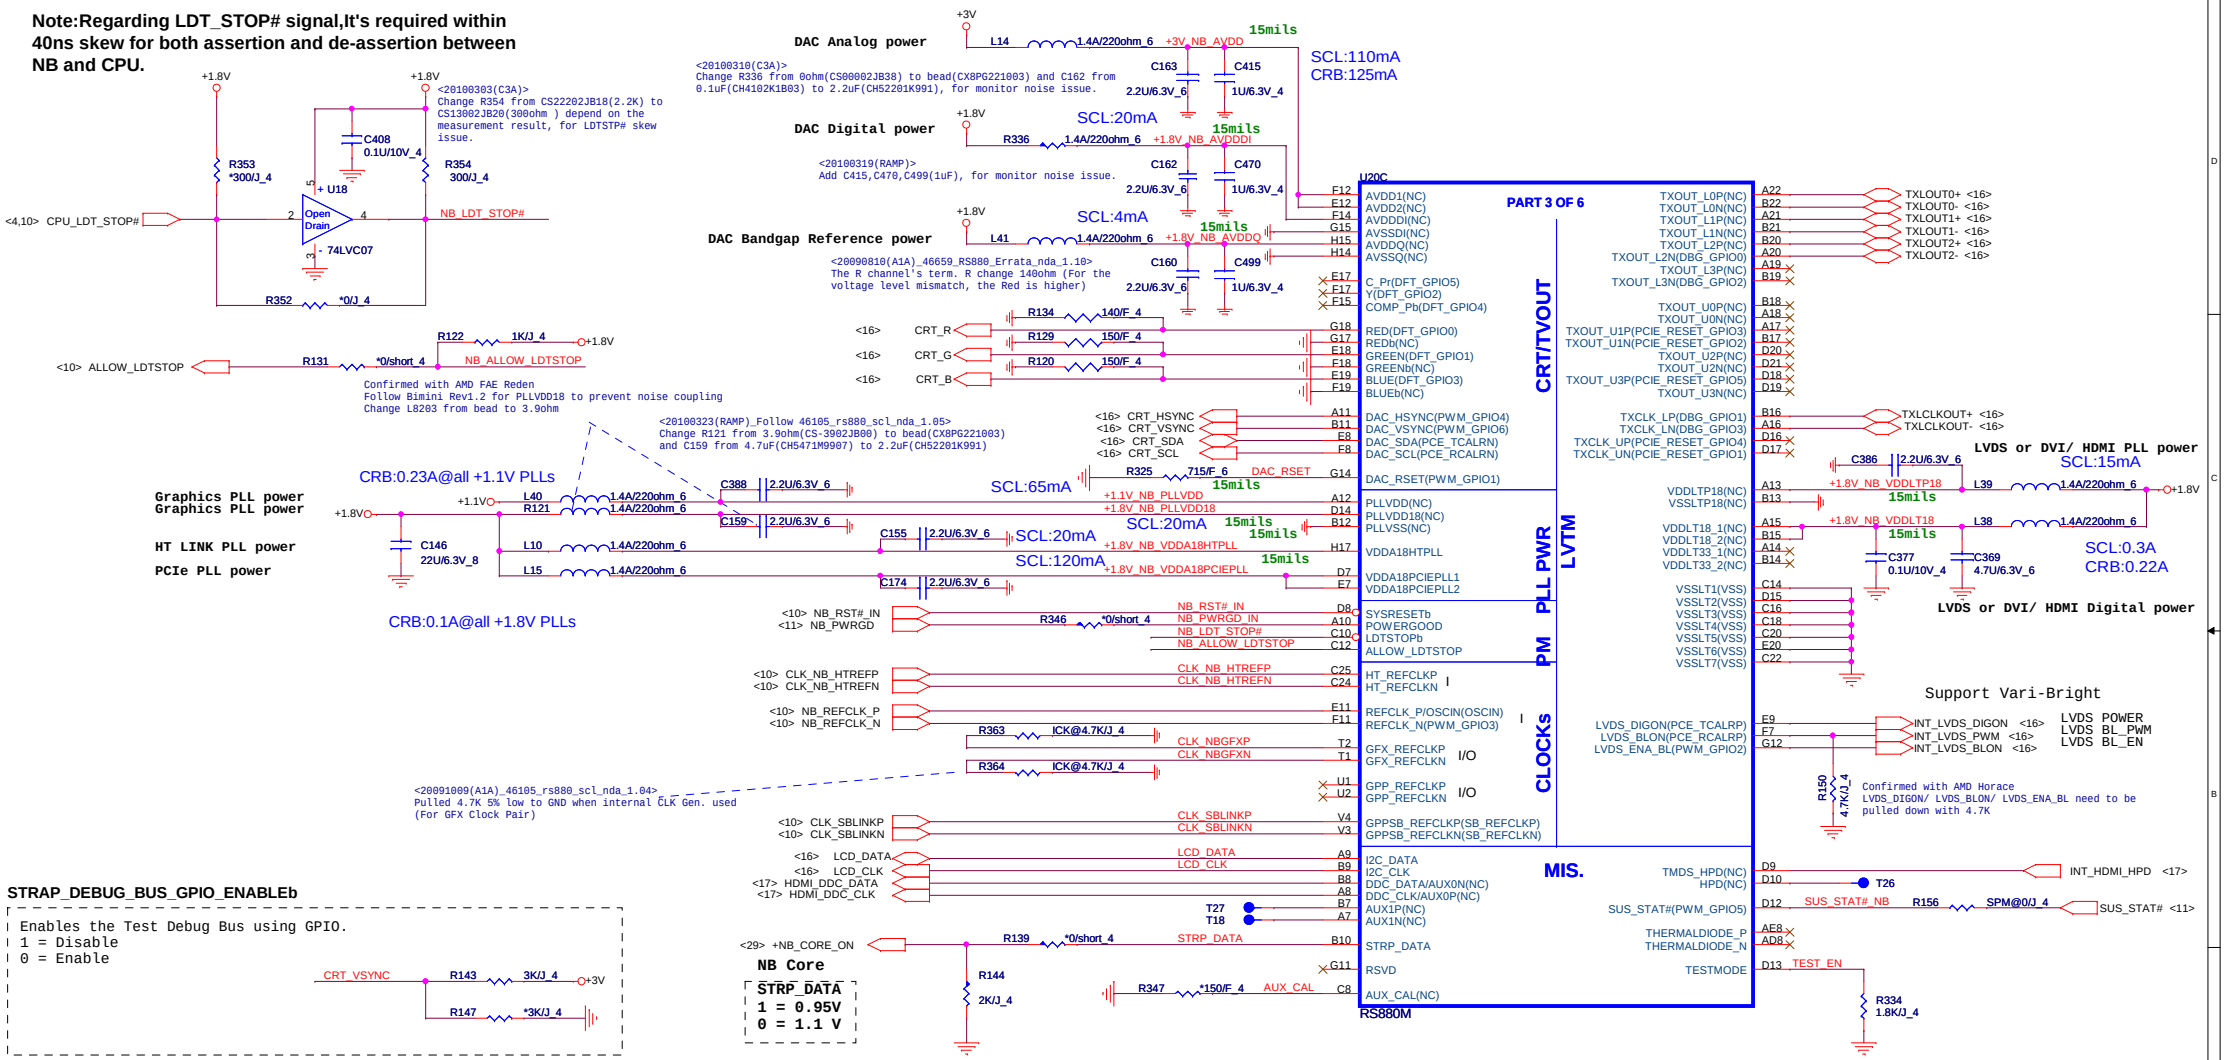

STRAP_DEBUG_BUS_GPIO_ENABLEb

```
Enables the Test Debug Bus using GPIO.
1 = Disable
0 = Enable
```

RS880M: Enables Side port memory

```
Selects if Memory SIDE PORT is available or not
1 = Memory Side port Not available
0 = Memory Side port available

  <BOM NOTE>
  w/ sideport: R142 non-stuff
  w/o sideport: R142 stuff
```

DFT_GPIO1: LOAD_EEPROM_STRAPS

```
Selects Loading of STRAPS from EPROM
1 : Bypass the loading of EEPROM straps and use Hardware Default Values
0 : I2C Master can load strap values from EEPROM if connected, or use
default values if not connected

EEPROM not implemented
```

Quanta Computer Inc.			
PROJECT : ZH9			
Size	Document Number		Rev
	RS880-SYSTEM I/F 3/4		4A
Date: Sunday, March 28, 2010		Sheet 8 of 40	

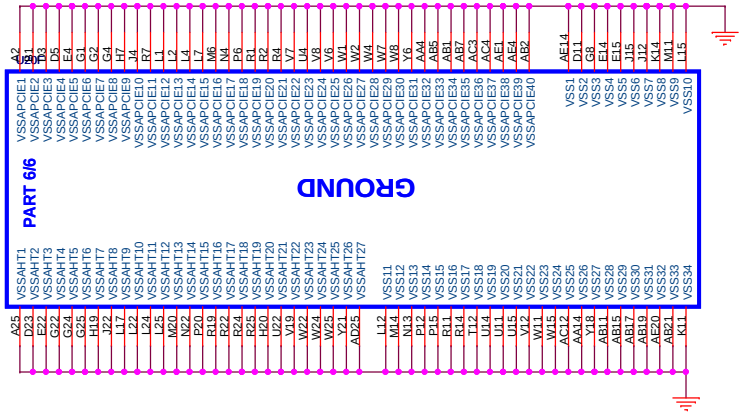

RX881/RS880 POWER DIFFERENCE TABLE

PIN NAME	RX881	RS880	PIN NAME	RX881	RS880
VDDHT	+1.1V	+1.1V	IOPLLVDD	+1.1V	+1.1V
VDDHTRX	+1.1V	+1.1V	AVDD	GND	+3.3V
VDDHTTX	+1.2V	+1.2V	AVDDDI	GND	+1.8V
VDDA18PCIE	+1.8V	+1.8V	AVDDQ	GND	+1.8V
VDD18	+1.8V	+1.8V	PLLVDD	GND	+1.1V
VDD18_MEM	GND	+1.8V	PLLVDD18	GND	+1.8V
VDDPCIE	+1.1V	+1.1V	VDDA18PCIEPLL	+1.8V	+1.8V
VDDC	+1.1V	+0.95V~+1.1V	VDDA18HTPLL	+1.8V	+1.8V
VDD_MEM	GND	+1.8V/1.5V	VDDLTP18	GND	+1.8V
VDD33	+3.3V	+3.3V	VDDLT18	GND	+1.8V
IOPLLVDD18	+1.8V	+1.8V	VDDLT33	NC	NC

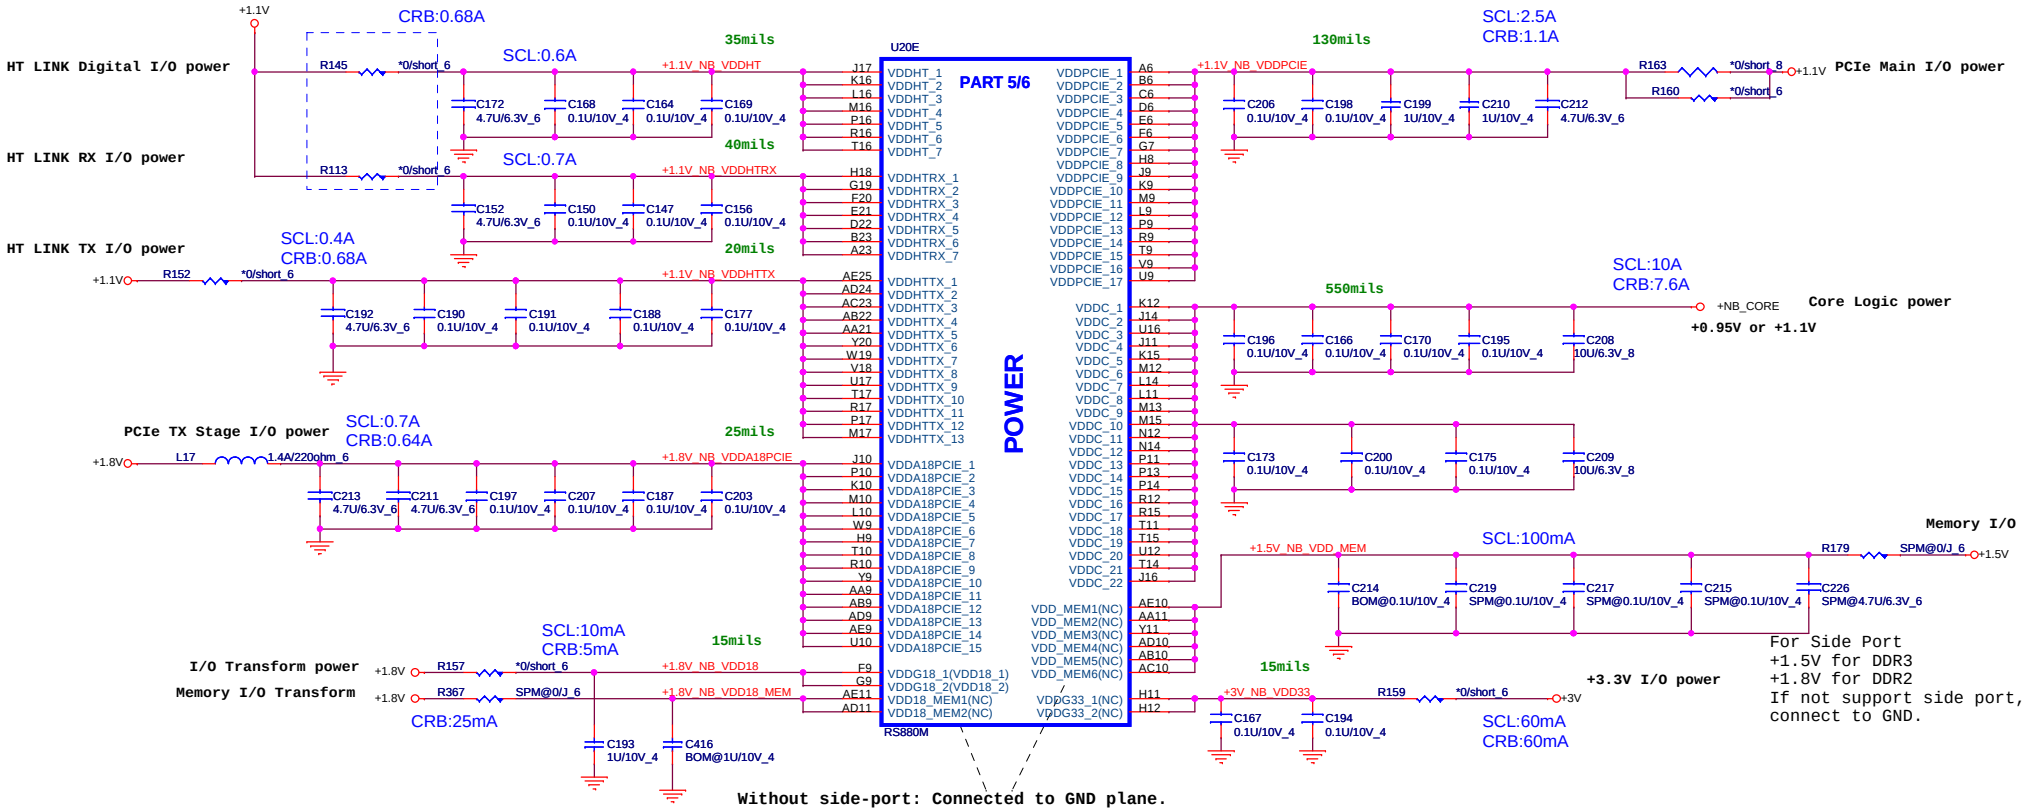

<BOM NOTE>
w/ sideport: C214:CH4102K1B03 ; C416:CH5102K9B06
w/o sideport: C214,C416:CS00002JB38(0ohm)

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	RS880-POWER 4/4	4A
Date: Sunday, March 28, 2010	Sheet 9 of 40	

PCIE_RST#: Reset PCIe Slot/Device (PCIe interface from SB)
A_RST#: Reset NB, MXM, EC, PCIe Slot/Device (PCIe interface from NB)

NB
EC

PLACE THESE PCIE AC COUPLING CAPS CLOSE TO SB820

U5A
SB800 Part 1 of 5

PCI CLKS
PCI EXPRESS INTERFACES
PCI INTERFACE
CLOCK GENERATOR
LPC
CPU
RTC

<Layout note>
Share pad with other resisters and close to external CLK Gen.

to NB for A-LINK/PCIe REF CLK
to NB Display Eng
to MINI PCIE 2
to LAN
to MINI PCIE 1
to LAN chip 25MHz

IC CTRL(605P)SB820M 218-0697014(FCBGA)
P/N : AJ069700T01

<BOM Note>
ID0/1/2 P/N Model
000 AKD5LGGT506 SAM DDR3-800 1Gb K4W1G1646E-HC12
001 AKD5LZGTW04 HYN DDR3-800 1Gb H5TQ1G63BFR-12C
010 AKD5LGGT700 ATI DDR3-800 1Gb 23EY2387MA12-SZ

From MINI PCIE 1

INTRUDER_ALERT# Left not connected (Southbridge has 50-kohm internal pull-up to VBAT).

For AMD RST
MINI-PCIE LAN chip Card reader

For VDDR
The Nile VDDR should be 0.9V all the time. The 1.05V is only for DDR3_1333 which is not supported on Nile.
MEM_1V5 is for gating the glitch on VDDR_1.2_EN
VDDR_1.2_EN: 1 : VDDR =1.05V 0: VDDR = 0.90V (Default)
VDDR_1.2_EN="0" is for DDRIII-1066, VDDR=0.9V
VDDR_1.2_EN="1" is for DDRIII-1333, VDDR=1.05V

RTC(RTC)
R = (5V - 0.2V-2V)/0.2mA = 14k

<BOM Note>
RTC BATTERY
AHL03001033 : JHT (18mAh)
AHL03001032 : MAT (17mAh)
AHL03001035 : FDK (15mAh)

Quanta Computer Inc.
PROJECT : ZH9
Size | Document Number: SB820-PCIE/CPU/LPC 1/5 | Rev: 4A
Date: Sunday, March 28, 2010 | Sheet 10 of 40

NC only ,Can't be install

+3V_S5
R100 *2.2K/J_4 SB_TEST0
R98 *2.2K/J_4 SB_TEST1
R280 *2.2K/J_4 SB_TEST2

SCL0/SDATA0 is +3.3V_S0 domain
To Clock gen/DDR/WLAN
+3V
R338 2.2K/J_4 SB_SCLK0
R335 2.2K/J_4 SB_SDATA0

SMBUS1~3 is +3.3V_S5 domain
If SMBUS and GPIO not implemented
10K PU to +3V_S5 or 10K PD
R279 10K/J_4 SB_SCLK1
R92 10K/J_4 SB_SDATA1
R133 10K/J_4 SB_SCLK2
R337 10K/J_4 SB_SDATA2
R136 10K/J_4 SB_SCLK3
R148 10K/J_4 SB_SDATA3

+1.8V
R340 300/J_4 NB_PWRGD

To Azalia
C99 *10P/50V_4
ACZ_SDOUT R85 33/J_4 ACZ_SDOUT_AUDIO <19>
C100 *10P/50V_4
ACZ_SYNC R86 33/J_4 ACZ_SYNC_AUDIO <19>
<20091030(A1A)_EMI's Suggest>
Add one 10pF to GND for BITCLK
C101 *10P/50V_4
ACZ_BCLK R87 33/J_4 ACZ_BITCLK_AUDIO <19>
R88 *10K/J_4
ACZ_RST# R71 33/J_4 ACZ_RST#_AUDIO <19>
ACZ_SDIN0 ACZ_SDIN0 <19>
R90 *10K/J_4

<10,15> CPU_MEMHOT# R91 *0/J_4
T9
<25> SUSB#
<25> SUSC#
<25> DNBSWON#
<25> ECPWROK
<8> SUS_STAT#
R294 *0/short_4 SB_PWRGD
SUS_STAT#
SB_TEST0
SB_TEST1
SB_TEST2
<25> GA20
<25> KBRST#
<25> EC_SMI#
<25> EC_SCI#
T13
<21,23> PCIE_WAKE#
<4> CPU_THERMTRIP#
<8> NB_PWRGD
CPU_THERMTRIP#
NB_PWRGD
<25> EC_RSMRST#
RSMRST#
<10> SB_GPIO_PCIE_RST#
<23> CLKREQ_MNC#
R341 *0/short_4
SB_GPIO_PCIE_RST#
INT_CLKREQ_MNC#
From MINI PCIE 2
<19> SB_BEEP
<15,23> SB_SCLK0
<15,23> SB_SDATA0
SB_SCLK0
SB_SDATA0
SB_SCLK1
SB_SDATA1
From LAN
<21> CLKREQ_LAN#
R333 *0/short_4
INT_CLKREQ_LAN#
T10
T19
LLB#
SHUTDOWN#
<6> SP_DDR3_RST#
R281 SPM@0/J_4
<20091202(A1A)_Confirm with AMD's Horace>
IDLEEXIT#(Multi function of Pin AA20) is used for server CPU.

<20> USBOC#R R277 *0/J_4 USBOC#67
<20> USBOC#L R278 *0/J_4 USBOC#0
T73 SB_JTAG_TDO
T69 SB_JTAG_TCK
T68 SB_JTAG_TDI
T70 SB_JTAG_RST#
HD audio interface is +3V_S5 voltage
<14> ACZ_SDOUT
ACZ_BCLK
ACZ_SDOUT
ACZ_SDIN0
ACZ_SYNC
ACZ_RST#

+3V_S5
R70 10K/J_4
R84 10K/J_4
R286 10K/J_4
R83 10K/J_4
R282 10K/J_4
T17
T22

U5D
SB800
Part 4 of 5
SB820M

PCI_PME#/GEVENT4#
RI#/GEVENT22#
SPI_CS3#/GBE_STAT1/GEVENT21#
SLP_S3#
SLP_S5#
PWR_BTN#
PWR_GOOD
SUS_STAT#
TEST0
TEST1/TMS
TEST2
GA20IN/GEVENT0#
KBRST#/GEVENT1#
LPC_PME#/GEVENT3#
LPC_SMI#/GEVENT23#
GEVENT5#
SYS_RESET#/GEVENT19#
WAKE#/GEVENT8#
IR_RX1/GEVENT20#
THRMTRIP#/SMBALERT#/GEVENT2#
NB_PWRGD
RSMRST#
ACPI / WAKE UP EVENTS

USBCLK/14M_25M_48M_OSC
USB_RCOMP
USB_FSD1P/GPIO186
USB_FSD1N
USB_FSD0P/GPIO185
USB_FSD0N
USB 1.1 USB MISC

CLK_REQ4#/SATA_IS0#/GPIO64
CLK_REQ3#/SATA_IS1#/GPIO63
SMARTVOLT1/SATA_IS2#/GPIO50
CLK_REQ0#/SATA_IS3#/GPIO60
SATA_IS4#/FANOUT3/GPIO55
SATA_IS5#/FANIN3/GPIO59
SPKR/GPIO66
SCL0/GPIO43
SDA0/GPIO47
SCL1/GPIO227
SDA1/GPIO228
CLK_REQ2#/FANIN4/GPIO62
CLK_REQ1#/FANOUT4/GPIO61
IR_LED#/LLB#/GPIO184
SMARTVOLT2/SHUTDOWN#/GPIO51
DDR3_RST#/GEVENT7#
GBE_LED0/GPIO183
GBE_LED1/GEVENT9#
GBE_LED2/GEVENT10#
GBE_STAT0/GEVENT11#
CLK_REQG#/GPIO65/OSCIN
GPIO

USB_HSD13P
USB_HSD13N
USB_HSD12P
USB_HSD12N
USB_HSD11P
USB_HSD11N
USB_HSD10P
USB_HSD10N
USB_HSD9P
USB_HSD9N
USB_HSD8P
USB_HSD8N
USB_HSD7P
USB_HSD7N
USB_HSD6P
USB_HSD6N
USB_HSD5P
USB_HSD5N
USB_HSD4P
USB_HSD4N
USB_HSD3P
USB_HSD3N
USB_HSD2P
USB_HSD2N
USB_HSD1P
USB_HSD1N
USB_HSD0P
USB_HSD0N
USB 2.0

BLINK/USB_OC7#/GEVENT18#
USB_OC6#/IR_TX1/GEVENT6#
USB_OC5#/IR_TX0/GEVENT17#
USB_OC4#/IR_RX0/GEVENT16#
USB_OC3#/AC_PRES/TDO/GEVENT15#
USB_OC2#/TCK/GEVENT14#
USB_OC1#/TDI/GEVENT13#
USB_OC0#/TRST#/GEVENT12#
USB OC

AZ_BITCLK
AZ_SDOUT
AZ_SDIN0/GPIO167
AZ_SDIN1/GPIO168
AZ_SDIN2/GPIO169
AZ_SDIN3/GPIO170
AZ_SYNC
AZ_RST#
HD AUDIO

GBE_COL
GBE_CRS
GBE_MDCK
GBE_MDIO
GBE_RXCLK
GBE_RXD3
GBE_RXD2
GBE_RXD1
GBE_RXD0
GBE_RXCTL/RXDV
GBE_RXERR
GBE_TXCLK
GBE_TXD3
GBE_TXD2
GBE_TXD1
GBE_TXD0
GBE_TXCTL/TXEN
GBE_PHY_PD
GBE_PHY_RST#
GBE_PHY_INTR
GBE LAN

PS2_DAT/SDA4/GPIO187
PS2_CLK/SCL4/GPIO188
SPI_CS2#/GBE_STAT2/GPIO166
FC_RST#/GPO160
PS2KB_DAT/GPIO189
PS2KB_CLK/GPIO190
PS2M_DAT/GPIO191
PS2M_CLK/GPIO192
EMBEDDED CTRL

SCL2/GPIO193
SDA2/GPIO194
SCL3_LV/GPIO195
SDA3_LV/GPIO196
EC_PWM0/EC_TIMER0/GPIO197
EC_PWM1/EC_TIMER1/GPIO198
EC_PWM2/EC_TIMER2/GPIO199
EC_PWM3/EC_TIMER3/GPIO200
KSI_0/GPIO201
KSI_1/GPIO202
KSI_2/GPIO203
KSI_3/GPIO204
KSI_4/GPIO205
KSI_5/GPIO206
KSI_6/GPIO207
KSI_7/GPIO208
KSO_0/GPIO209
KSO_1/GPIO210
KSO_2/GPIO211
KSO_3/GPIO212
KSO_4/GPIO213
KSO_5/GPIO214
KSO_6/GPIO215
KSO_7/GPIO216
KSO_8/GPIO217
KSO_9/GPIO218
KSO_10/GPIO219
KSO_11/GPIO220
KSO_12/GPIO221
KSO_13/GPIO222
KSO_14/GPIO223
KSO_15/GPIO224
KSO_16/GPIO225
KSO_17/GPIO226
EMBEDDED CTRL

<20100129(B2A)>
Stuff R110. (CLK for Cardreader from crystal
change to internal CLK.)
A10 SB_CLK_48M_CR R110 ICK@22/J_4
G19 USB_RCOMP_SB R332 11.8K/F_6
CLK_48M_CR <24> to CARD READER 48MHz

J10 USB_FSD13P
H11 USB_FSD13N
T75
T77
OHCI (dev-20, fun-5)
H9 USB_FDS12P
J8 USB_FSD12N
T72
T71

Controller	Ports mapping
OHCI0 (dev-18, fun-0)	Port 0 - 4
EHCI (dev-18, fun-2)	Port 0 - 4
OHCI0 (dev-19, fun-0)	Port 5 - 9
EHCI (dev-19, fun-2)	Port 5 - 9
OHCI0 (dev-22, fun-0)	Port 10 - 14
EHCI (dev-22, fun-2)	Port 10 - 14

B12 USB_HSD13P
A12 USB_HSD13N
F11 USB_HSD12P
E11 USB_HSD12N
E14 USB_HSD11P
E12 USB_HSD11N
J12 USB_HSD10P
J14 USB_HSD10N
A13 USB_HSD9P
B13 USB_HSD9N
D13 USB+_SIM <23>
C13 USB-_SIM <23>
MM-SIM
G12 USBP7+ <20>
G14 USBP7- <20>
CONN (Lower Right)
G16 USBP6+ <20>
G18 USBP6- <20>
CONN (Upper Right)
D16 USBP5+ <18>
C16 USBP5- <18>
BT
B14 USBP4+ <23>
A14 USBP4- <23>
MNC
E18 USBP3+ <16>
E16 USBP3- <16>
CCD
J16 USBP2+ <23>
J18 USBP2- <23>
MPC
B17 USBP1+ <24>
A17 USBP1- <24>
Card reader
A16 USBP0+ <20>
B16 USBP0- <20>
CONN (Left)

D25 SB_SCLK2
F23 SB_SDATA2
B26 SB_SCLK3
E26 SB_SDATA3
F25
F22
F21
EC_PWM2 <14>
EC_PWM3 <14>

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	SB820-ACPI/GPIO/USB 2/5	4A

Date: Sunday, March 28, 2010 Sheet 11 of 40

SATA PORT 0,1,2,3
can support AHCI
mode

SATA HDD

PLACE SATA AC COUPLING
CAPS CLOSE TO SB820

<22> SATA_TXP0
<22> SATA_TXN0
C141 0.01U/25V_4 SATA_TXP0_C
C142 0.01U/16V_4 SATA_TXN0_C
<22> SATA_RXN0
<22> SATA_RXP0
C140 0.01U/25V_4 SATA_RXN0_C
C137 0.01U/25V_4 SATA_RXP0_C

PLACE SATA_CAL
RES VERY CLOSE
TO BALL OF SB820

+1.1V_SB_VDDAN_11_SATA
R316 1K/F_4 SATA_CALRP
R315 931/F_4 SATA_CALRN

To meet SB800 SCL1.02:
DNI SATA XTAL circuit's parts

<22> SATALED#
+3V R304 10K/J_4

C151 *22P/50V_4 SATA_X1
Y3 *25MHz-SATA
R114 *1M/J_4
C145 *22P/50V_4 SATA_X2

U5B
SB800
Part 2 of 5
SB820M

SERIAL ATA
AH9 SATA_TX0P
AJ9 SATA_TX0N
AJ8 SATA_RX0P
AH8 SATA_RX0N
AH10 SATA_TX1P
AJ10 SATA_TX1N
AG10 SATA_RX1P
AE10 SATA_RX1N
AG12 SATA_TX2P
AE12 SATA_TX2N
AJ12 SATA_RX2P
AH12 SATA_RX2N
AH14 SATA_TX3P
AJ14 SATA_TX3N
AG14 SATA_RX3P
AE14 SATA_RX3N
AG17 SATA_TX4P
AE17 SATA_TX4N
AJ17 SATA_RX4P
AH17 SATA_RX4N
AJ18 SATA_TX5P
AH18 SATA_TX5N
AH19 SATA_RX5P
AJ19 SATA_RX5N
AB14 SATA_CALRP
AA14 SATA_CALRN
AD11 SATA_ACT#/GPIO67
AD16 SATA_X1
AC16 SATA_X2

SPI ROM
T67 J5 SPI_DI/GPIO164
T12 E2 SPI_DO/GPIO163
T11 K4 SPI_CLK/GPIO162
T65 K9 SPI_CS1#/GPIO165
T66 G2 ROM_RST#/GPIO161

FLASH
AH28 FC_CLK T45
AG28 FC_FBCLKOUT T31
AF26 FC_FBCLKIN T39
AF28 FC_OE#/GPIOD145 T38
AG29 FC_AVD#/GPIOD146 T37
AG26 FC_WE#/GPIOD148 T36
AF27 FC_CE1#/GPIOD149 T43
AE29 FC_CE2#/GPIOD150 T44
AF29 FC_INT1/GPIOD144 T32
AH27 FC_INT2/GPIOD147 T33
AJ27 FC_ADQ0/GPIOD128 T42
AJ26 FC_ADQ1/GPIOD129 T30
AH25 FC_ADQ2/GPIOD130 T29
AH24 FC_ADQ3/GPIOD131 T28
AG23 FC_ADQ4/GPIOD132 T23
AH23 FC_ADQ5/GPIOD133 T24
AJ22 FC_ADQ6/GPIOD134 T21
AG21 FC_ADQ7/GPIOD135 T16
AF21 FC_ADQ8/GPIOD136 T80
AH22 FC_ADQ9/GPIOD137 T20
AJ23 FC_ADQ10/GPIOD138 T25
AF23 FC_ADQ11/GPIOD139 T84
AJ24 FC_ADQ12/GPIOD140 T34
AJ25 FC_ADQ13/GPIOD141 T35
AG25 FC_ADQ14/GPIOD142 T40
AH26 FC_ADQ15/GPIOD143 T41

The flash controller function is NOT supported by the SB820M.

IF THERE IS NO IDE, TEST POINTS FOR DEBUG BUS IS MANDATORY

HW MONITOR
W5 FANOUT0/GPIO52
W6 FANOUT1/GPIO53
Y9 FANOUT2/GPIO54
SB_PROCHOT#_C
W7 FANIN0/GPIO56
V9 FANIN1/GPIO57
W8 FANIN2/GPIO58
B6 TEMPIN0/GPIO171 TEMPIN0 R109 10K/J_4
A6 TEMPIN1/GPIO172 TEMPIN1 R108 10K/J_4
A5 TEMPIN2/GPIO173 TEMPIN2 R103 10K/J_4
B5 TEMPIN3/TALERT#/GPIO174
C7 TEMP_COMM TEMP_COMM
A3 VIN0/GPIO175 VIN0 R290 10K/J_4
B4 VIN1/GPIO176 VIN1 R289 10K/J_4
A4 VIN2/GPIO177 VIN2 R288 10K/J_4
C5 VIN3/GPIO178 VIN3 R102 10K/J_4
A7 VIN4/GPIO179 VIN4 R409 10K/J_4
B7 VIN5/GPIO180 VIN5 R298 10K/J_4
B8 VIN6/GBE_STAT3/GPIO181 VIN6 R301 10K/J_4
A8 VIN7/GBE_LED3/GPIO182 VIN7 R297 10K/J_4

+3V
R106 10K/J_4
R105 10K/J_4
Q11 MMBT3904
SB_PROCHOT# <4>
R107 10K/J_4 +3V_S5
THERM_ALERT# <4>

<20100119(B2A)_Bimini Rev1.4>
Non-stuff R408 ; stuff R409
(Nile doesn't support VDDR = +1.05V for DDR3-1333)
VIN4 R408 *0/J_4 MEM_1V5 <10>

NC1 G27
NC2 Y2

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	SB820-SATA/HWM/SPI 3/5	4A
Date: Sunday, March 28, 2010	Sheet 12 of 40	

PLACE ALL THE DECOUPLING CAPS ON
THIS SHEET CLOSE TO SB AS POSSIBLE.

3.3V I/O power

Not used: Connected to GND through a 0Ω.

1.8V GPIOD I/O Power

A-Link Express III/PCIe PLL power

A-Link Express III/PCIe analog power

SATA PHY PLL power

SATA PHY analog / I/O Power

USB PHY analog / I/O Power

Support S3 wake up

USB PHY DLL analog power

Support S3 wake up

SB800 Part 3 of 5

POWER

SB820M

Core logic power

System Clock Gen analog/output power

<45484_sb800_dg_nda_1.02>
Not use interal CLK Gen: Connected to +1.1V directly.

Not support GBE: Connected to GND.

S5 I/O Power

S5 Core logic standby power

HD Audio I/O Power

USB PHY core power

System CLK Gen PLLs analog power

System CLK Gen PLLs analog power

USB PHY PLL analog power

Hardware monitor analog / I/O Power

25-MHz XTAL I/O Power

WoL--> +3.3V_S5 rail
Non-WoL--> +3.3V_S0 rail

SB800 GROUND Part 5 of 5

SB820M

Support S3 wake up

Support S3 wake up

Support S3 wake up

WoL--> +1.1V_S5 rail
Non-WoL--> +1.1V_S0 rail

<20100310(C3A)_Follow CRB>
Connect +3VSUS_SB_VDDPL_33_USB_S to
+3VSUS directly.

As GPIOs: Stuff 0.1uF

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	SB820-PWR/DECOUPLING 4/5	4A
Date: Sunday, March 28, 2010	Sheet 13 of 40	

STANDARD STRAPS

<20091202(A1A)_Confirm with AMD's Horace>
PCI_CLK4 PU with 10K for both internal and external CLK Gen.

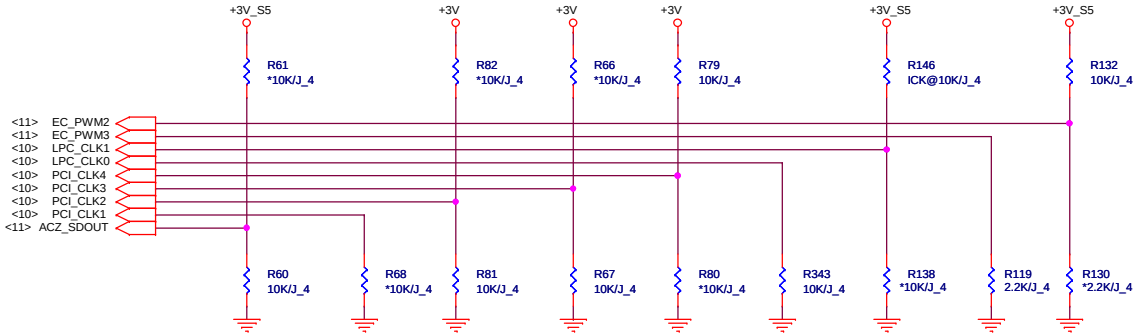

	AZ_SDOUT	PCI_CLK1	PCI_CLK2	PCI_CLK3	PCI_CLK4	LPC_CLK0	LPC_CLK1	EC_PWM3 EC_PWM2
PULL HIGH	LOW POWER MODE	PCIe Gen II	Watchdog Timer Enable	USE DEBUG STRAPS	non_Fusion CLK MODE ICK@DEFAULT	EC ENABLED	CLKGEN ENABLED ICK@DEFAULT	H, H=Reserved H, L=SPI ROM
PULL LOW	PERFORMANCE MODE DEFAULT	PCIe Gen I	Watchdog Timer Disable DEFAULT	IGNORE DEBUG STRAPS DEFAULT	FUSION CLK MODE	EC DISABLED DEFAULT	CLKGEN DISABLED ECK@DEFAULT	L, H=LPC ROM DEFAULT L, L=Reserved

This is required as the low power mode is not supported on the SB8xx.

Not Applicable to SB820M--Leave provision for PD.

PCICLK4:
CPU/NB HT Clock Selection
This strap is not used if the strap CLKGEN is configured for external clock generator mode.

internal have pull Hi 10K

DEBUG STRAPS

SB800 HAS 15K INTERNAL PU FOR PCI_AD[27:23]

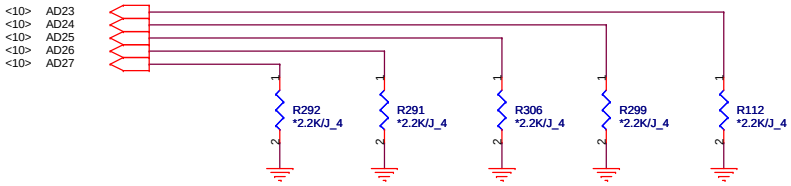

	PCI_AD27	PCI_AD26	PCI_AD25	PCI_AD24	PCI_AD23
PULL HIGH	USE PCI PLL DEFAULT	DISABLE ILA AUTORUN DEFAULT	USE FC PLL DEFAULT	USE DEFAULT PCIE STRAPS DEFAULT	DISABLE PCI MEM BOOT DEFAULT
PULL LOW	BYPASS PCI PLL	ENABLE ILA AUTORUN	BYPASS FC PLL	USE EEPROM PCIE STRAPS	ENABLE PCI MEM BOOT

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	SB820-STRAPS,PWRGD 5/5	4A
Date: Sunday, March 28, 2010	Sheet 14 of 40	

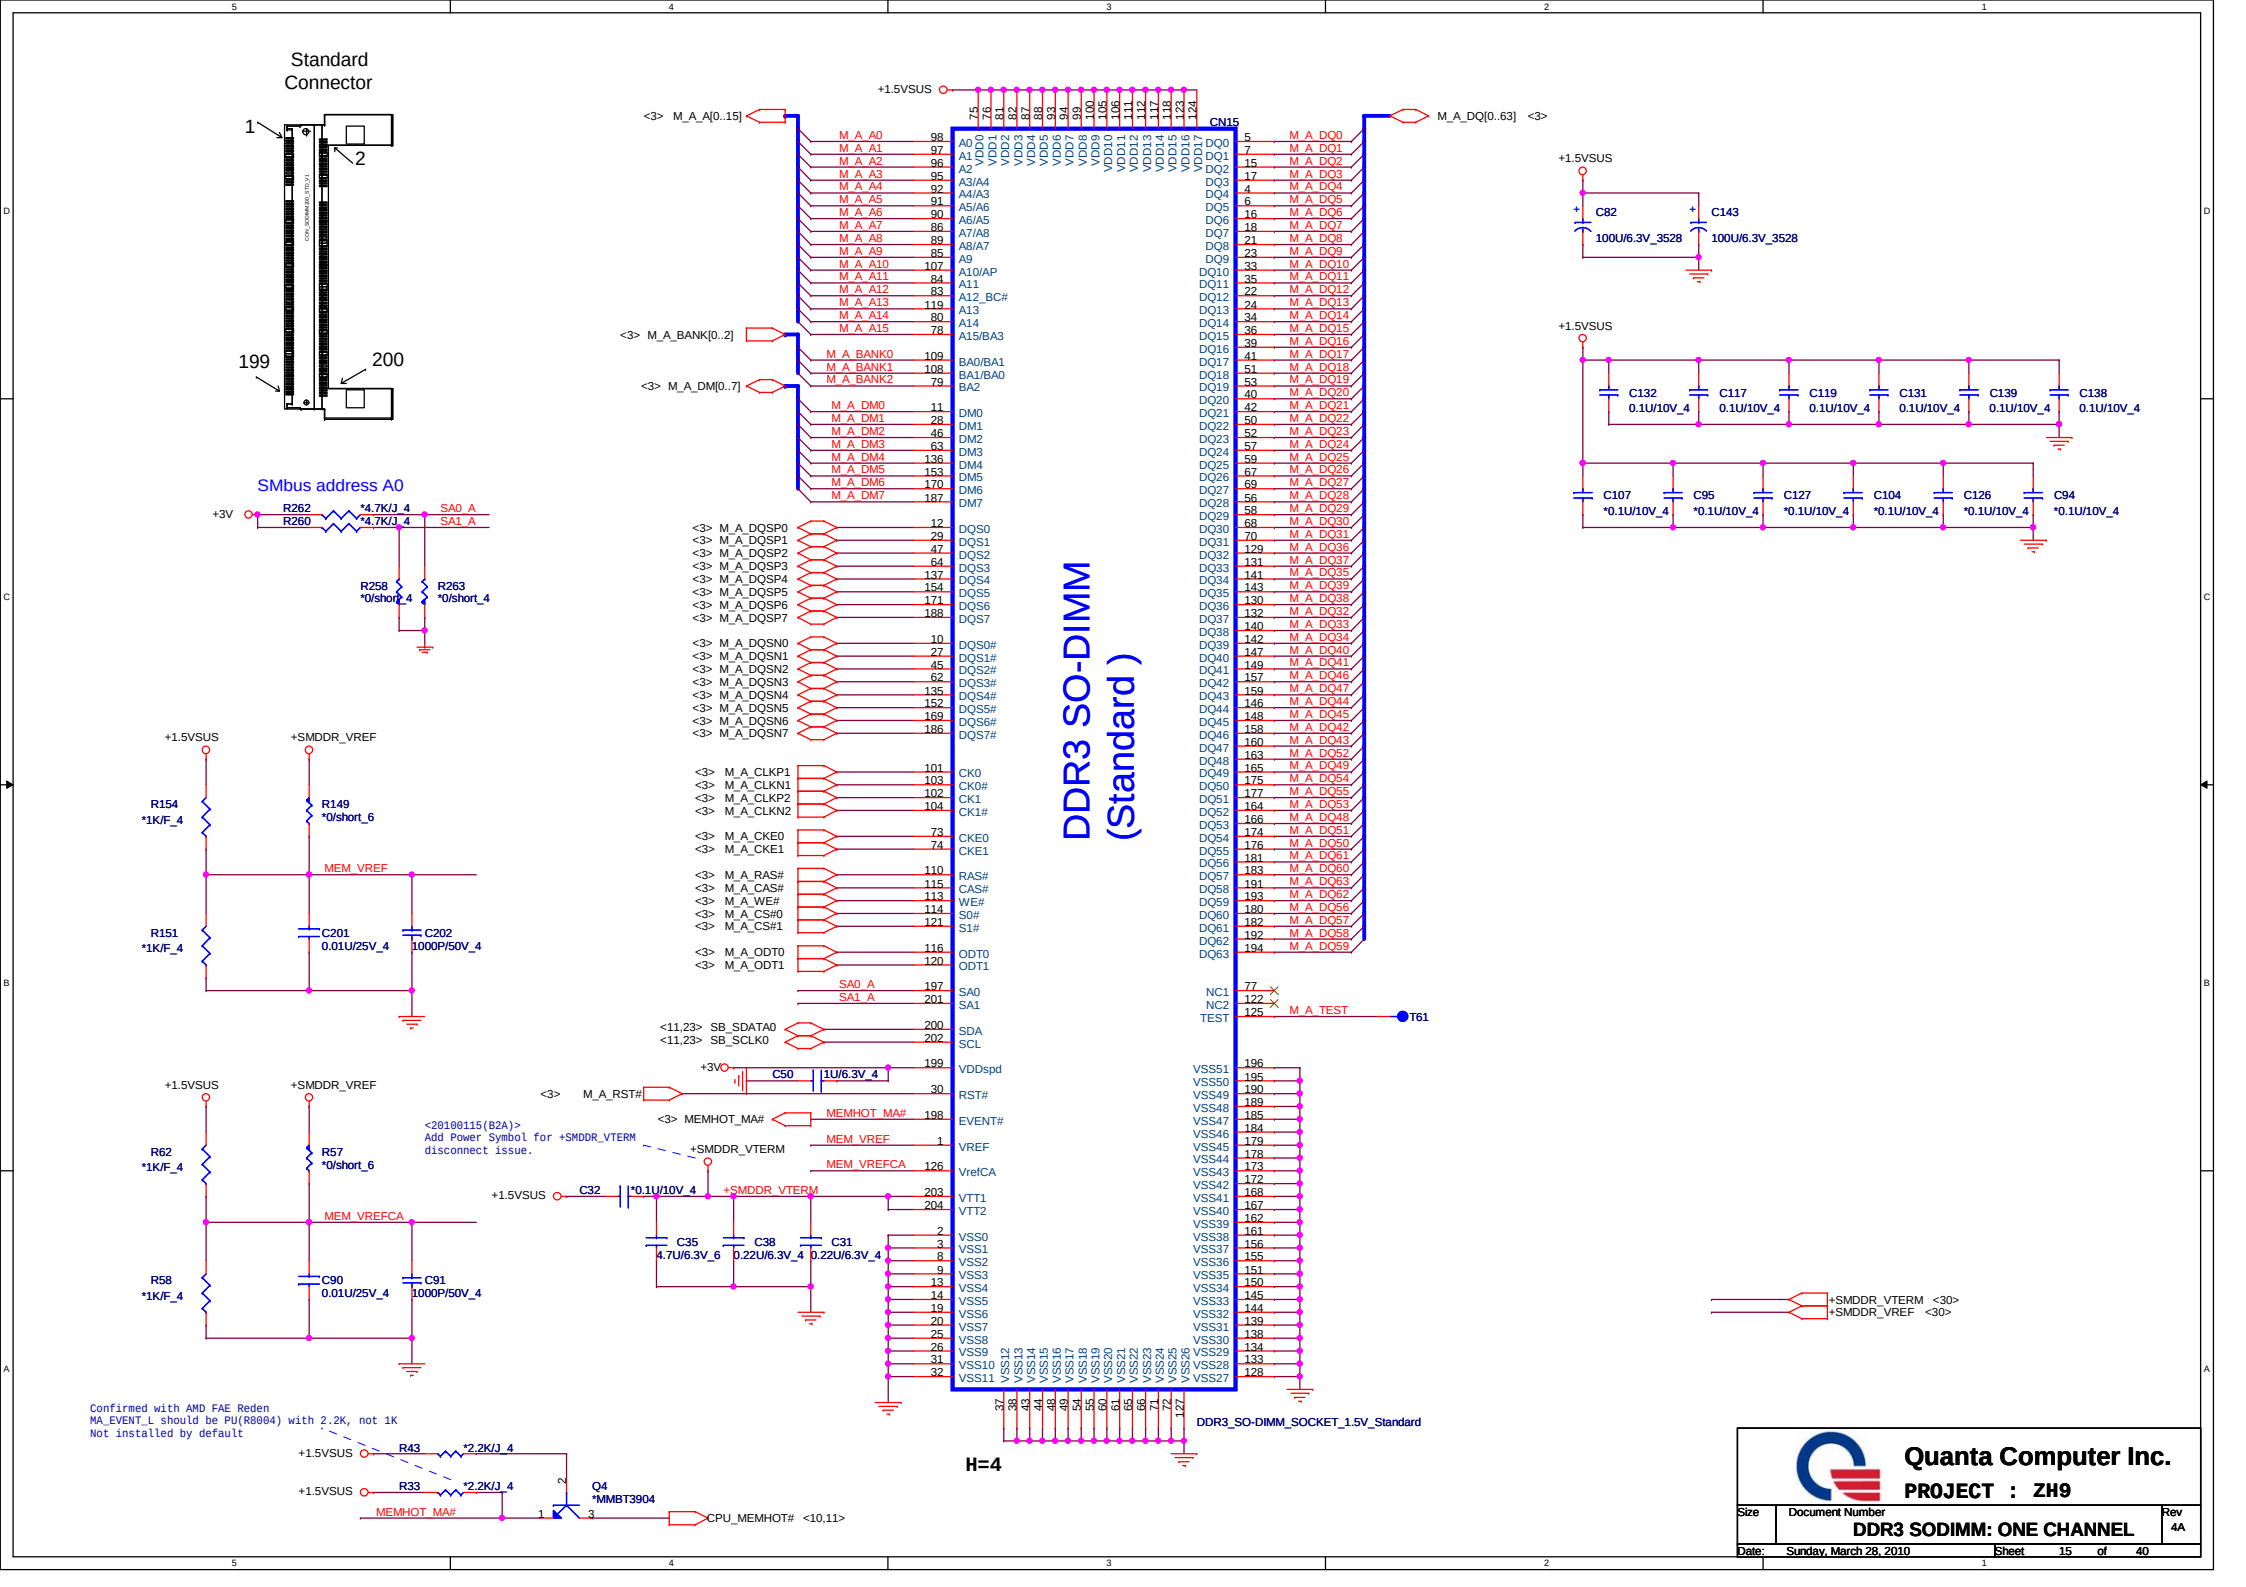
Standard Connector
1
2
199
200
SMbus address A0
+3V
R262 *4.7K/J_4
R260 *4.7K/J_4
SA0_A
SA1_A
R258 *0/short_4
R263 *0/short_4
+1.5VSUS
+SMDDR_VREF
R154 *1K/F_4
R149 *0/short_6
MEM_VREF
R151 *1K/F_4
C201 0.01U/25V_4
C202 1000P/50V_4
R62 *1K/F_4
R57 *0/short_6
MEM_VREFCA
R58 *1K/F_4
C90 0.01U/25V_4
C91 1000P/50V_4
<20100115(B2A)>
Add Power Symbol for +SMDDR_VTERM
disconnect issue.
+SMDDR_VTERM
C32 *0.1U/10V_4
C35 4.7U/6.3V_6
C38 0.22U/6.3V_4
C31 0.22U/6.3V_4
Confirmed with AMD FAE Reden
MA_EVENT_L should be PU(R8004) with 2.2K, not 1K
Not installed by default
R43 *2.2K/J_4
R33 *2.2K/J_4
Q4 *MMBT3904
MEMHOT_MA#
CPU_MEMHOT# <10,11>
<3> M_A_A[0..15]
<3> M_A_BANK[0..2]
<3> M_A_DM[0..7]
<3> M_A_DQSP0
<3> M_A_DQSP1
<3> M_A_DQSP2
<3> M_A_DQSP3
<3> M_A_DQSP4
<3> M_A_DQSP5
<3> M_A_DQSP6
<3> M_A_DQSP7
<3> M_A_DQSN0
<3> M_A_DQSN1
<3> M_A_DQSN2
<3> M_A_DQSN3
<3> M_A_DQSN4
<3> M_A_DQSN5
<3> M_A_DQSN6
<3> M_A_DQSN7
<3> M_A_CLKP1
<3> M_A_CLKN1
<3> M_A_CLKP2
<3> M_A_CLKN2
<3> M_A_CKE0
<3> M_A_CKE1
<3> M_A_RAS#
<3> M_A_CAS#
<3> M_A_WE#
<3> M_A_CS#0
<3> M_A_CS#1
<3> M_A_ODT0
<3> M_A_ODT1
<11,23> SB_SDATA0
<11,23> SB_SCLK0
+3V
C50 1U/6.3V_4
<3> M_A_RST#
<3> MEMHOT_MA#
DDR3 SO-DIMM (Standard)
CN15
M_A_DQ[0..63] <3>
NC1
NC2
TEST
M_A_TEST
T61
DDR3_SO-DIMM_SOCKET_1.5V_Standard
H=4
C82 100U/6.3V_3528
C143 100U/6.3V_3528
C132 0.1U/10V_4
C117 0.1U/10V_4
C119 0.1U/10V_4
C131 0.1U/10V_4
C139 0.1U/10V_4
C138 0.1U/10V_4
C107 *0.1U/10V_4
C95 *0.1U/10V_4
C127 *0.1U/10V_4
C104 *0.1U/10V_4
C126 *0.1U/10V_4
C94 *0.1U/10V_4
+SMDDR_VTERM <30>
+SMDDR_VREF <30>
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
DDR3 SODIMM: ONE CHANNEL
Rev 4A
Date: Sunday, March 28, 2010
Sheet 15 of 40

HALL IC(HSR)

Hall IC	ESD	TYPE	PU
APX9132H AI-TRG	2KV	CMOS	N/A
EM-6781-T3	1.5KV	CMOS	N/A

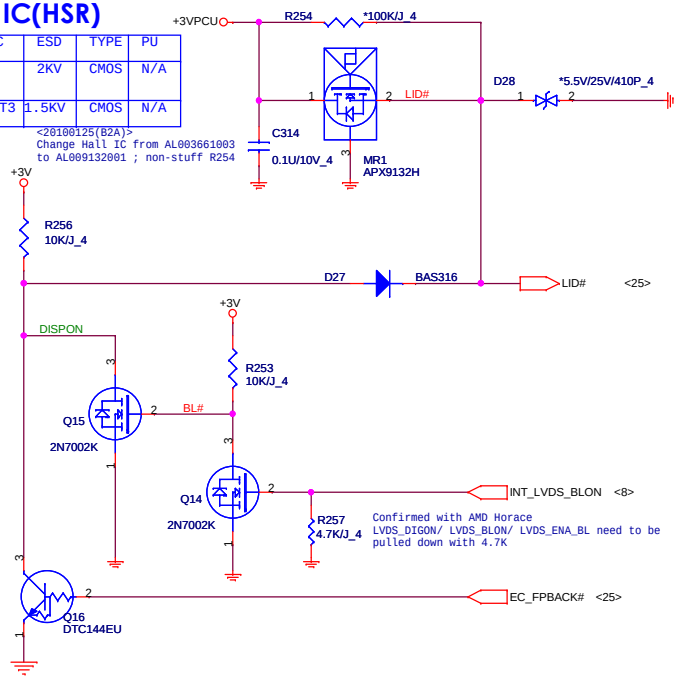

LCD POWER SWITCH(LDS)

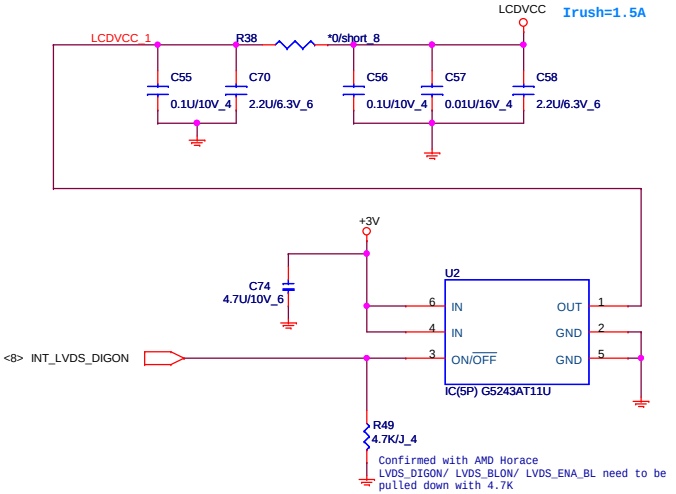

CAMERA POWER(CCD)

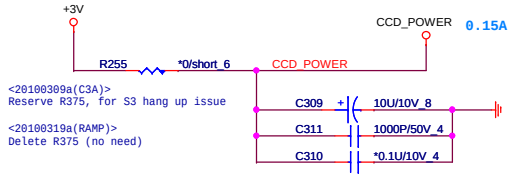

LCD MODULE(LDS)

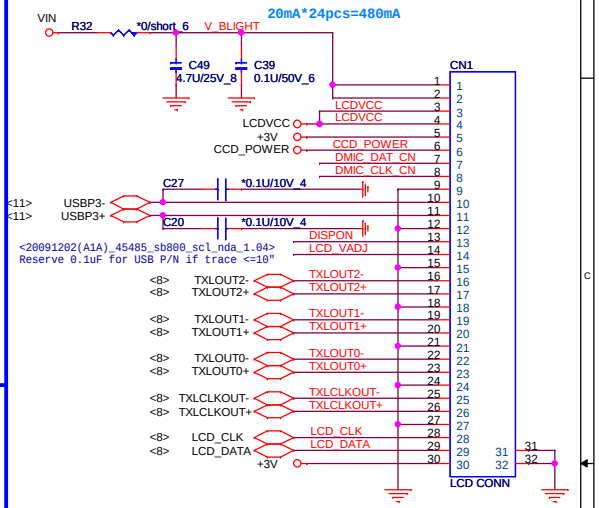

CRT(CRT)

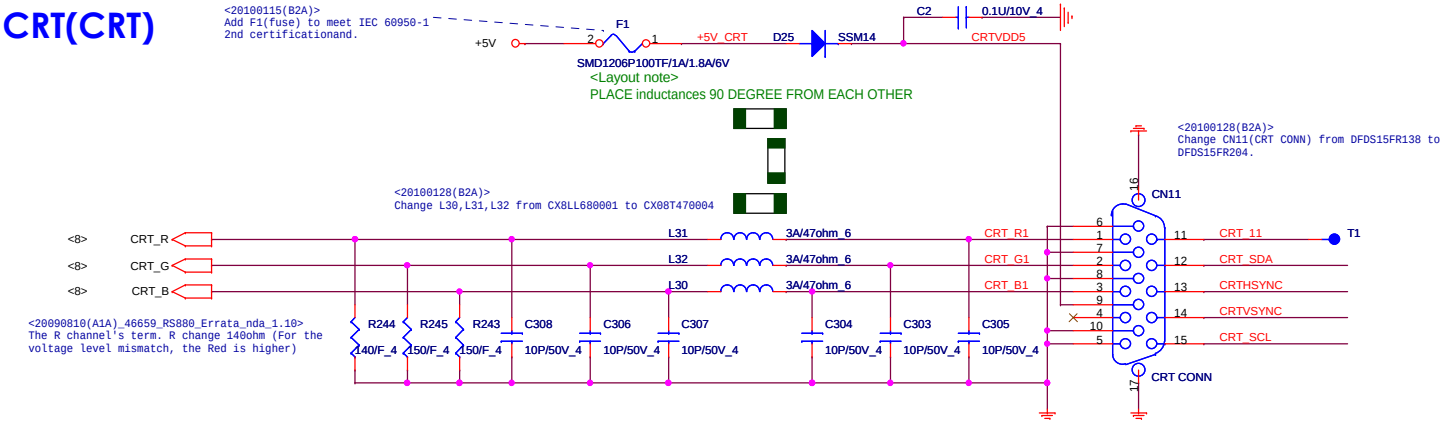

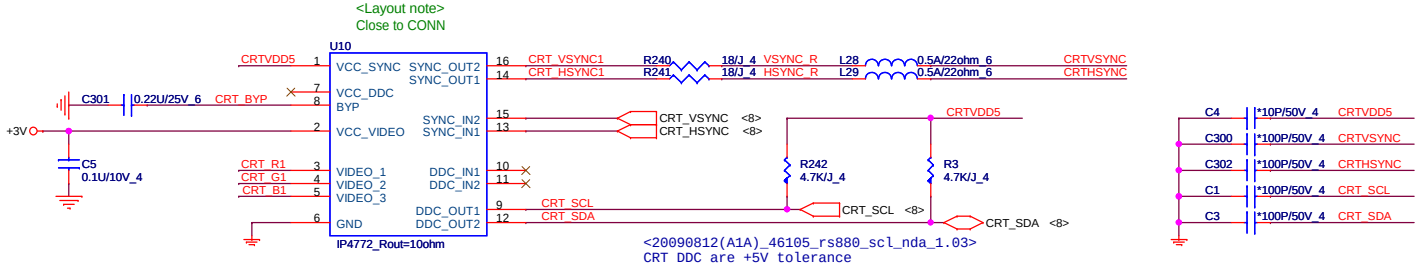

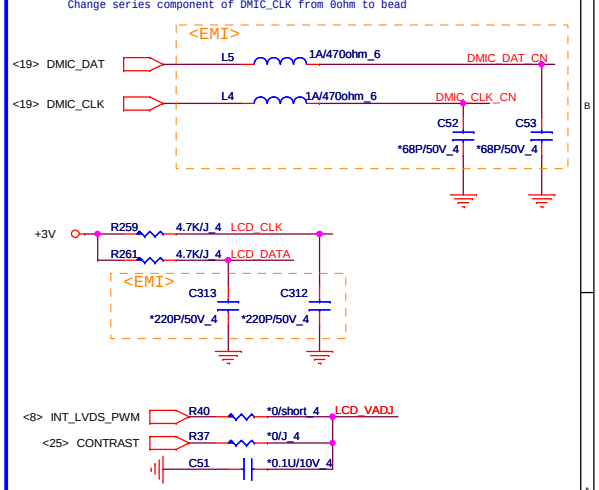

Quanta Computer Inc.		
PROJECT : ZH9		
Size	Document Number	Rev
	CRT/LVDS	4A
Date: Sunday, March 28, 2010	Sheet 16 of 40	

(HDM)

Close to HDMI Connector

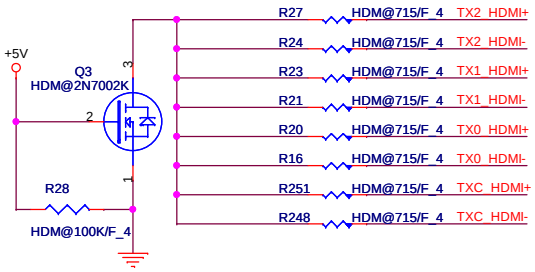

HDMI HPD SENSE

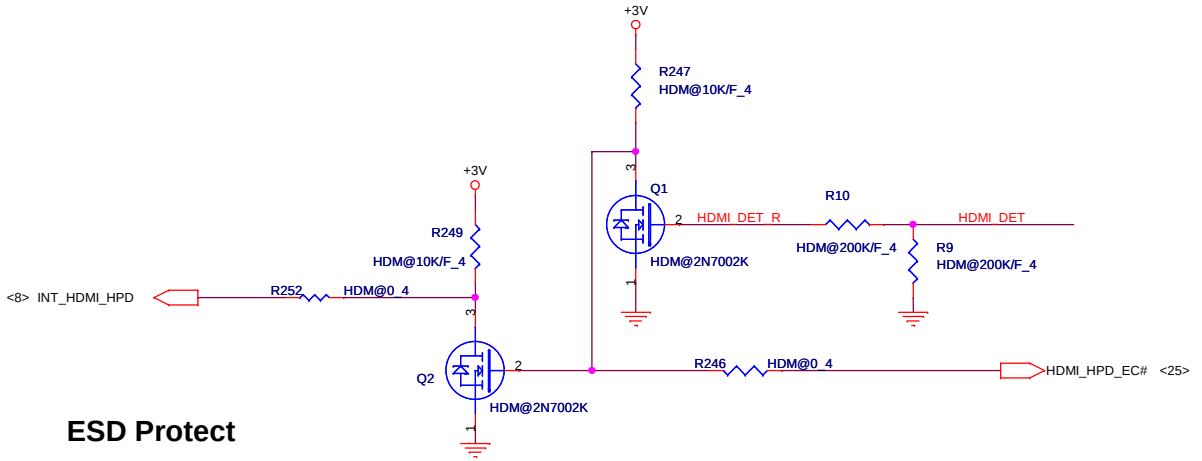

EMI reserve for HDMI(HDM)

Close connector

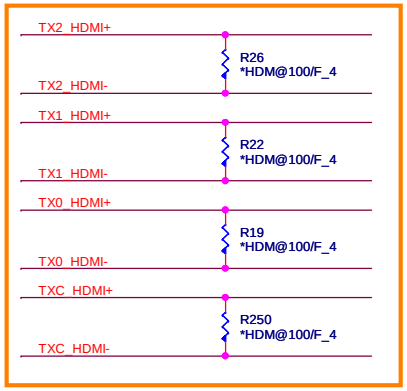

ESD Protect

close to HDMI connector

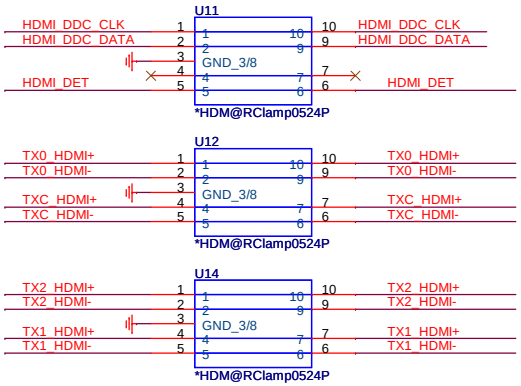

HDMI PORT

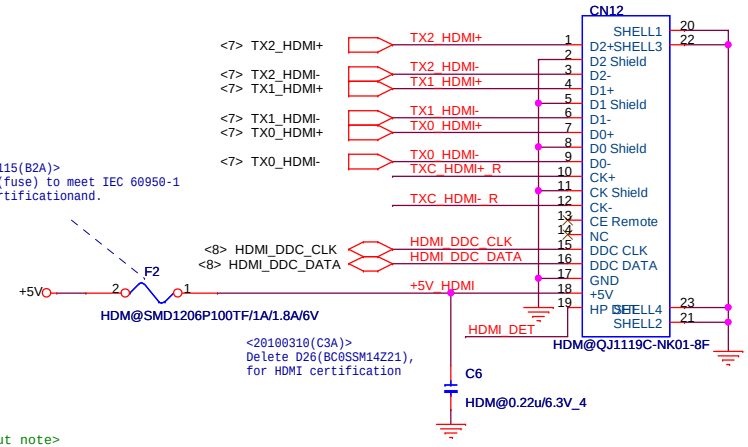

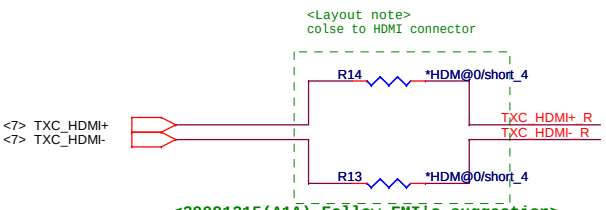



<20091215(A1A)_Follow EMI's suggestion>
add a common mode chock in HDMI CLK to prevent AMD issue

<20100324(RAMP)>
Delete L1 and change R13,R14 to shortpad.

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	HDMI	4A
Date: Sunday, March 28, 2010	Sheet 17 of 40	

KEYBOARD(KBC)

<20100303(C3A)>
Change CP1~CP6 footprint from 8p4r-0402 to 8p4r-0402-smt, for SMT open issue.

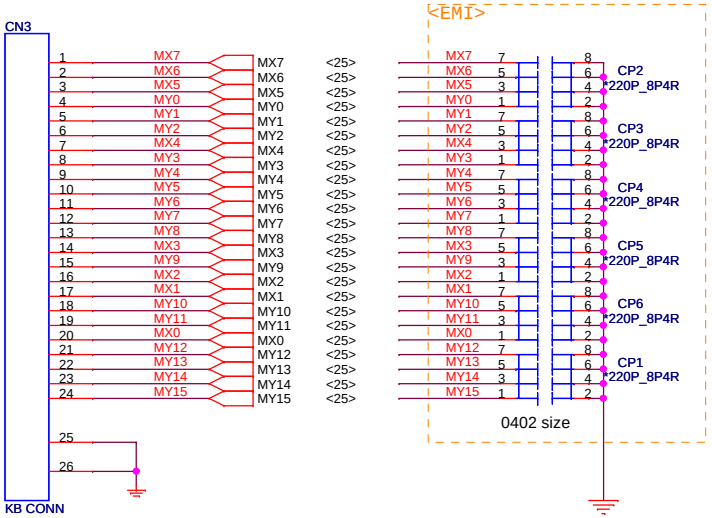

BLUETOOTH(BTM)

BT	PWR	LED
T77H056.00	+3V	
T60H928.33	+3V	

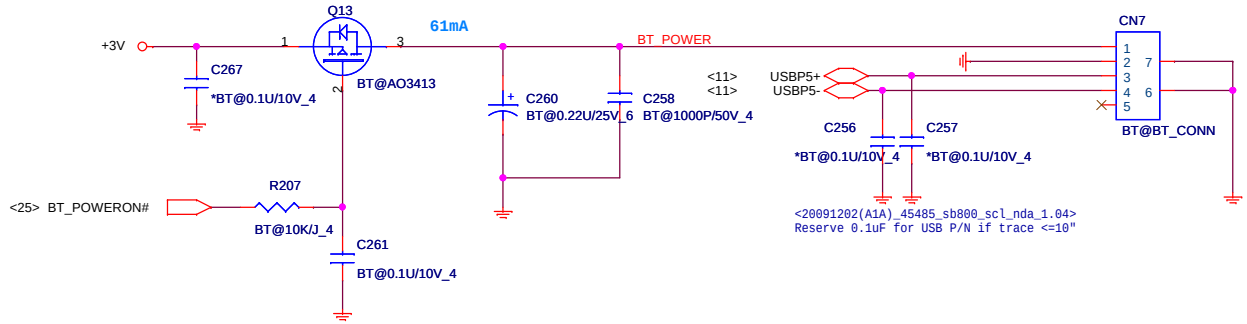

TOUCH PAD(TPD)

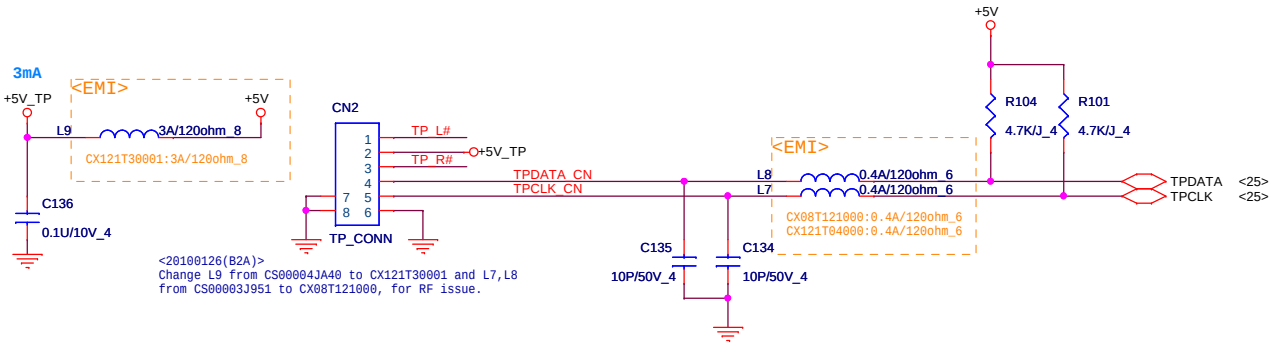

<20100126(B2A)>
Change SW2,SW3 from DHP00AC1G00 to DHP00533K00, for SMT issue.

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	KB/BT/TP/LED/Power Connector	4A
Date: Sunday, March 28, 2010	Sheet 18 of 40	

AUDIO CODEC

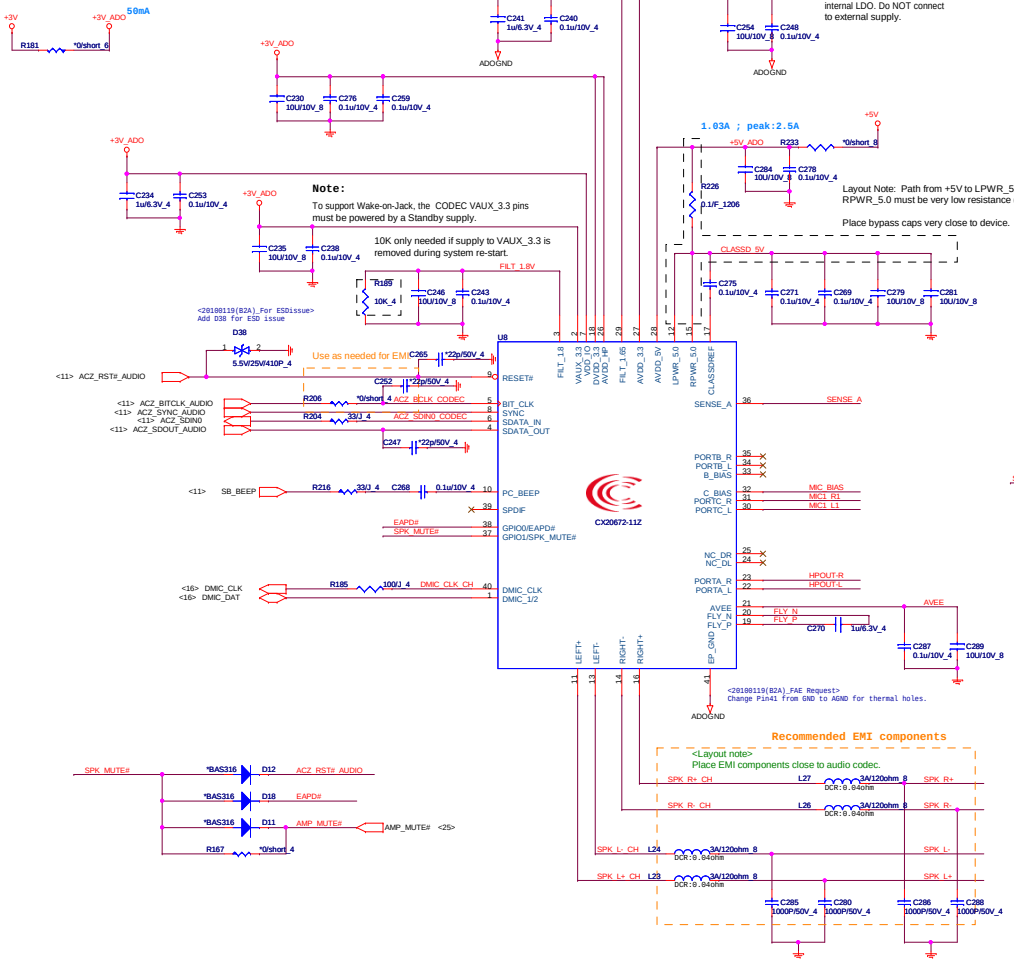

<Layout note>

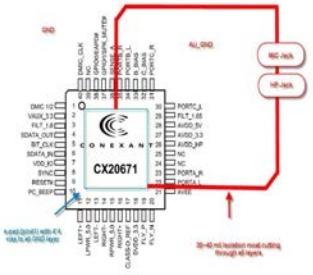

JACK DETECT RESISTORS

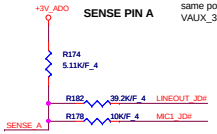

Sense resistor 5.11K must be connected to same power supply that is used for VAUX_3.3 pins.

Port Configuration

```
Port A:  Headphone jack (jack shared with S/PDIF)
Port B:  Internal analog mono mic (stereo option)/Line In
Port C:  Microphone jack
Port D:  LineOut jack(need cap) or Headphone jack(cap less)
Port G:  Internal stereo speakers
Port J:  Optional Internal stereo digital mic
Port H:  S/PDIF (jack shared with headphone)
```

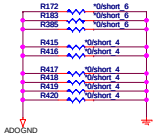

<20100309(C3A)>
Delete R388,R375 ; Chagne C415,C290 to R415,R416(0ohm),
Stuff R172,R183,R385, Add R417~R420(0ohm), for EMI issue.

<20100311(C3A)>
Change R415,R417 to shortpad, for layout issue

<20100324(RAMP)>
Change R172,R183,R385,R416,R418~R420 to shortpad.

Speaker (AMP)

<20100126(B2A)>
Change R234,R239 from 0ohm(CS0800J3951) to 6.8ohm(CS-6803J900), for SPL

<20100323(RAMP)>
Change R234,R239 from 6.8ohm(CS-6803J900) to 6.8ohm(CS-6802FB80), for cost and shortage issue.

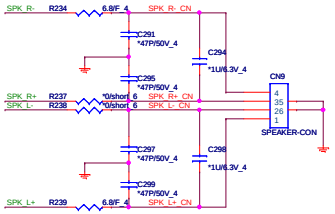

Earphone(AMP)

<Layout note>20091223
follow EMI suggestion , modify PIN6 from dummy to ADOGND

<20100309(C3A)>
Change L22,L25 from 0ohm to CX08T601000, C272,C283 to CH1686K9B00, for EMI issue.

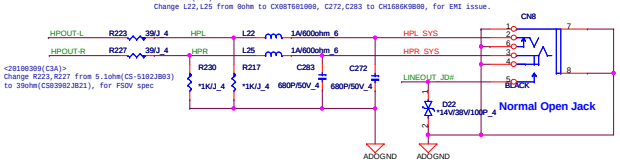

<20100309(C3A)>
Change R223,R227 from 5.1ohm(CS-5102JB03)
to 39ohm(CS0390ZJB21), for FSOV spec

System MIC(AMP)



<Layout note>20091223
follow EMI suggestion , modify PIN6 from dummy to ADOGND

<20100309(C3A)>
Change L18,L21 from 0ohm to CX08T601000, for EMI issue.

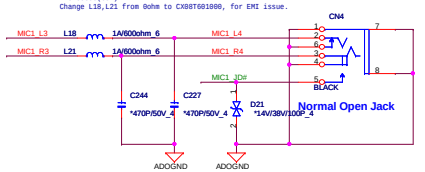

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	AUDIO CODEC CX20672	4A
Date: Sunday, March 28, 2010	Sheet 19 of 40	

USB(USB)

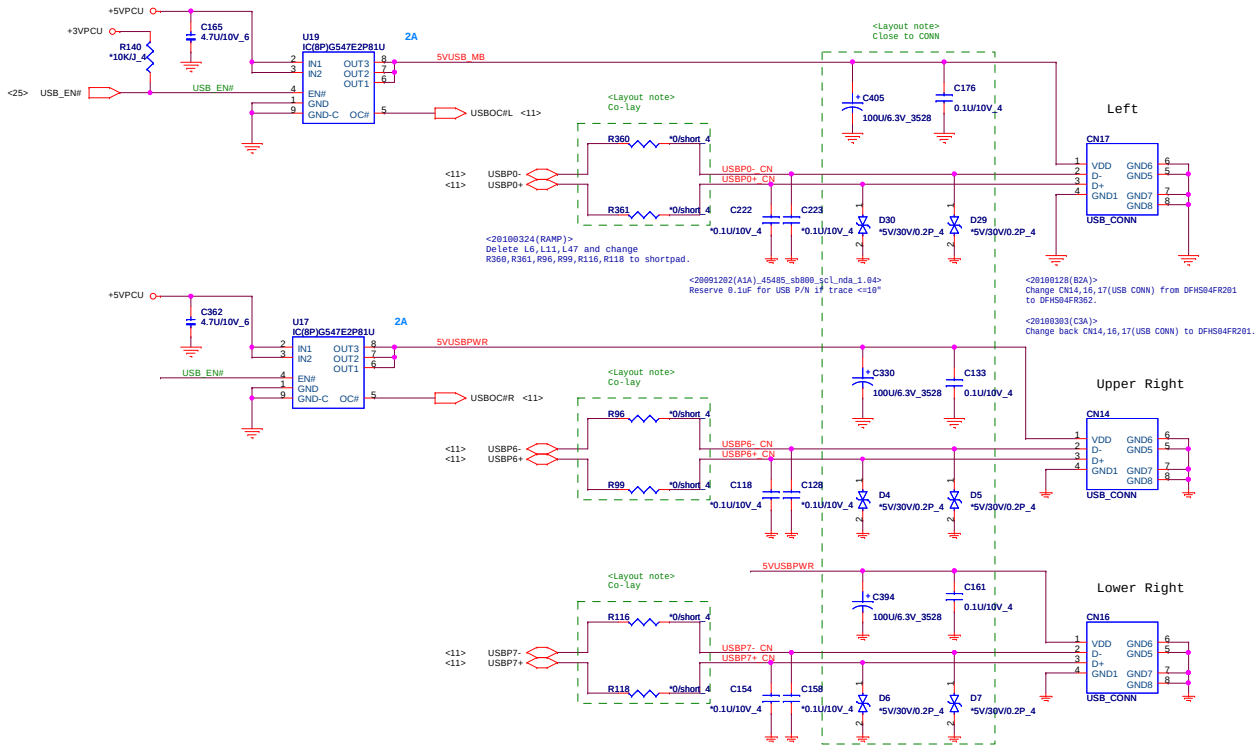

EMI(EMC)

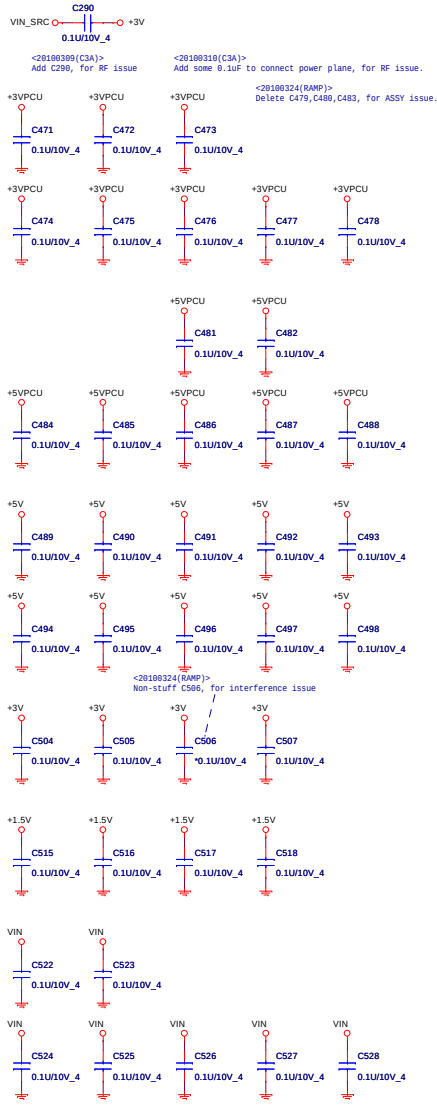

HOLE(OTH)

TOP(HDD Hole)

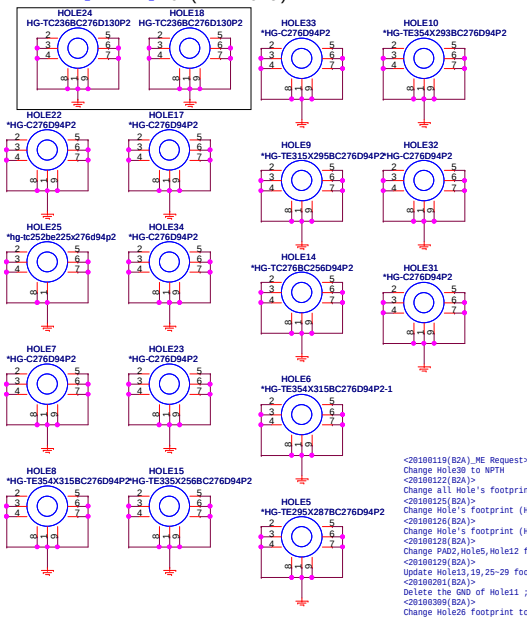

BOT (Mini-PCIe Hole)

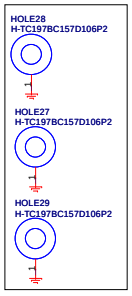

BOT(Thermal Hole)

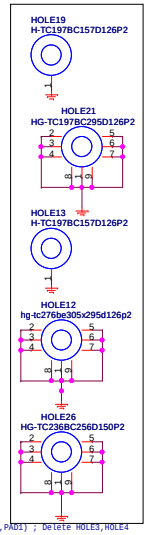

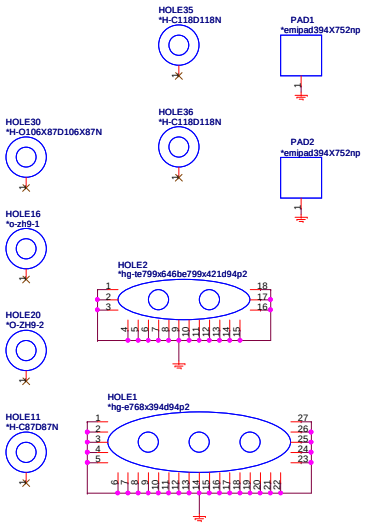

<20100119(B2A)_ME Request>
Change Hole30 to NPTH
<20100122(B2A)>
Change all Hole's footprint for 凸鍋
<20100125(B2A)>
Change Hole's footprint (HOLE12,HOLE25,HOLE1,HOLE2,HOLE20,PAD1) ; Delete HOLE3,HOLE4
<20100126(B2A)>
Change Hole's footprint (HOLE12)
<20100128(B2A)>
Change PAD2,Hole5,Hole12 footprint ; add two holes (Hole35,Hole36)
<20100129(B2A)>
Update Hole13,19,25~29 footprint.
<20100201(B2A)>
Delete the GND of Hole11 ; add a nut(MBFJ6002010) on Hole26 on BOT side.
<20100309(B2A)>
Change Hole26 footprint to HG-TC236BC256D150P2

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	USB on Board/LED/SW/HOLE	4A
Date: Sunday, March 28, 2010	Sheet 20 of 40	

<BOM note>
If center tap power come from internal switch regulator
=>Stuff 52SWR@ (Default)
If center tap power come from internal LDO
=>Stuff 52LDO@

<20100303(C3A)_FAE's suggestion>
Change L3 from CV-4710MN03 to CV-4710TZ01.

<Layout note>
Close to Pin40

L3 52SWR@4.7uH/1A DCR:0.15ohm
C46 52SWR@1000P/50V_4
C47 52SWR@0.1U/16V_4
C30 52SWR@10U/10V_8
VDDCT
VDDCT_REG R35 *52LDO@0/J_6
C37 0.1U/16V_4
C48 *52LDO@1U/10V_4

C67 *3P/50V_4
<10> CLK_25M_LAN XTLI_LAN
C43 33P/50V_4 XTLO_LAN
XTLI_LAN
Y1 25MHz-LAN
C44 33P/50V_4

<20100129(B2A)>
Non-stuff Y1,C43,C44 ; Stuff C67. Change the value of C43,C44 from 27pF to 33pF. (CLK for LAN from crystal change to internal CLK.)

<20100310(C3A)>
Stuff Y1,C43,C44 ; Non-Stuff C67. (14M_25M_48M_OSC is S0 plane, doesn't support WoL.)

76.1mA ; 30mil <Layout note> Close to Pin1

+3V_S5 +3V_LAN
R36 *0/short_6
C69 10U/10V_8 C45 1U/10V_4 C36 0.1U/16V_4 C28 1000P/50V_4

Power Sequence:
VDD33 to PERSTn >= 100ms

U1 AR8152 5X5mm 40-Pin QFN

1	VDD33	AVDDH	22
2	PERSTn	CLKREQn	23
3	WAKEn	DVDDL	24
4	VDDCT_REG	SMCLK	25
5	VDDCT	SMDATA	26
6	AVDDL_REG	TESTMODE	27
7	XTLO	TEST_RST	28
8	XTLI	TX_N	29
9	AVDDH_REG	TX_P	30
10	RBIAS	AVDDL	31
11	TRXP0	REFCLK_N	32
12	TRXN0	REFCLK_P	33
13	NC	AVDDL	34
14	TRXP1	RX_P	35
15	TRXN1	RX_N	36
16	NC	DVDDL_REG	37
17	NC	LED0	38
18	NC	LED1	39
19	NC	LX	40
20	NC	GND	41
21	NC		

AR8152-AL1A-RL

<10,23,24> PLTRST#
Int. PU in SB
<11,23> PCIE_WAKE#
VDDCT_REG
20mil VDDCT C40 0.1U/16V_4
20mil AVDDL C41 1U/10V_4 C42 0.1U/16V_4
20mil AVDDH C33 1U/10V_4 C34 0.1U/16V_4
R29 2.37K/F_4 RBIAS
TX0P TX0N TX1P TX1N
XTLO_LAN XTLI_LAN

<Layout note>
Close to LAN Chip
1nF reserved for EMI
RN2 49.9/F_4P2R
RN1 49.9/F_4P2R
C21 0.1U/16V_4 C18 *1000P/50V_4
C14 0.1U/16V_4 C15 *1000P/50V_4

AVDDH C9 0.1U/16V_4
+3V_S5 R413 *4.7K/J_4
<20100303(C3A)> Reserve R413,R414, for e-fuse.
R412 *0/short_4
PU in CLK Gen.
CLKREQ_LAN# <11>
DVDDL C8 0.1U/16V_4
R414 *1K/J_4
SMBUS for debug only
R15 4.7K/J_4 +3V_LAN
PCIE_RXN0_LAN C7 0.1u/10V_4 PCIE_RXN0 <7>
PCIE_RXP0_LAN C10 0.1u/10V_4 PCIE_RXP0 <7>
AVDDL C11 0.1U/16V_4
CLK_PCIE_LANN <10>
CLK_PCIE_LANP <10>
PCIE_TXP0 <7>
PCIE_TXN0 <7>
C13 0.1U/16V_4
DVDDL 20mil
LAN_ACTLED
LAN_LINKLED#
LX 40mil
C19 0.1U/16V_4 C16 1U/10V_4

AR8152-A : w/o 802.3az
AR8152-B : w/ 802.3az

ATHEROS AR8152

+3V_S5	1	VDD33	AVDDL_REG	6	+1.1V regulator output (For all the analog 1.1V supply pins)
+1.1V analog power	31/34	AVDDL	AVDDH_REG	9	+2.7V regulator output (Connected to pin 22)
+1.1V digital power	24	DVDDL	DVDDL_REG	37	+1.1V regulator output (For all the digital 1.1V supply pins)
+2.7V analog power	22	AVDDH	VDDCT_REG	4	+1.8V regulator output (For VDDCT when LDO mode)
+1.7V analog power	5	VDDCT	LX	40	+1.7V Switching regulator (For VDDCT when switching mode)

TRANSFORMER

VDDCT L2 *0/short_6 AVDD_CEN
CX8EG601000: 0.5A/600ohm_6
C22 1U/6.3V_4
C24 0.1U/16V_4
C26 *1000P/50V_4
C23 0.1U/16V_4
C25 *1000P/50V_4
InF reserved for EMI

U13 NS0014 LF_Bothhand

TX1N	8 TD-	TX- 9	X-TX1N
TX1P	7 TD+	TX+ 10	X-TX1P
	6 CT	CT 11	TERM0
	5 NC	NC 12	
	4 NC	NC 13	
	3 CT	CT 14	TERM1
TX0N	2 RD-	RX- 15	X-TX0N
TX0P	1 RD+	RX+ 16	X-TX0P

R18 75/F_8 R17 75/F_8
C12 1000P/3KV_1808 TERM9

RJ45

R25 5.1K/J_8
C17 *0.1u/50V_8 LAN_ACTLED
Active LED Pin:
Non-overclocking=>active high
R30 *52LDO@5.1K/J_8
C54 *0.1u/50V_8 LAN_LINKLED#
LINK LED Pin:
SWR mode=>active low
LDO mode=>active high

<20100125(B2A)>
Connect pin4,5,7,8 of CN10 to net TERM9, for EMI and Safety issue

CN10 RJ45-CONN

LAN_ACTLED R8 510/J_6	12	Y-	
	10	Y+	
TERM9	8	NC4/3-	
	7	NC/3+	
X-TX1N	6	RX-/1-	
TERM9	5	NC2/2-	
	4	NC1/2+	
X-TX1P	3	RX+/1+	
X-TX0N	2	TX-/0-	
X-TX0P	1	TX+/0+	
		GND	14
		GND	13
R7 *52LDO@0/J_8			
LAN_LINKLED# R6 52SWR@510/J_6	11	G-	
R5 *52LDO@510/J_6	9	G+	
+3V_S5 R4 *52SWR@0/short_8			

<20100125(B2A)>
Change CN10 from DFTJ12FR069(SUY) to DFTJ12FR066(FOX), for SMT issue.

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	LAN AR8152L	4A
Date: Sunday, March 28, 2010	Sheet 21 of 40	

2.5" SATA HDD(HDD)

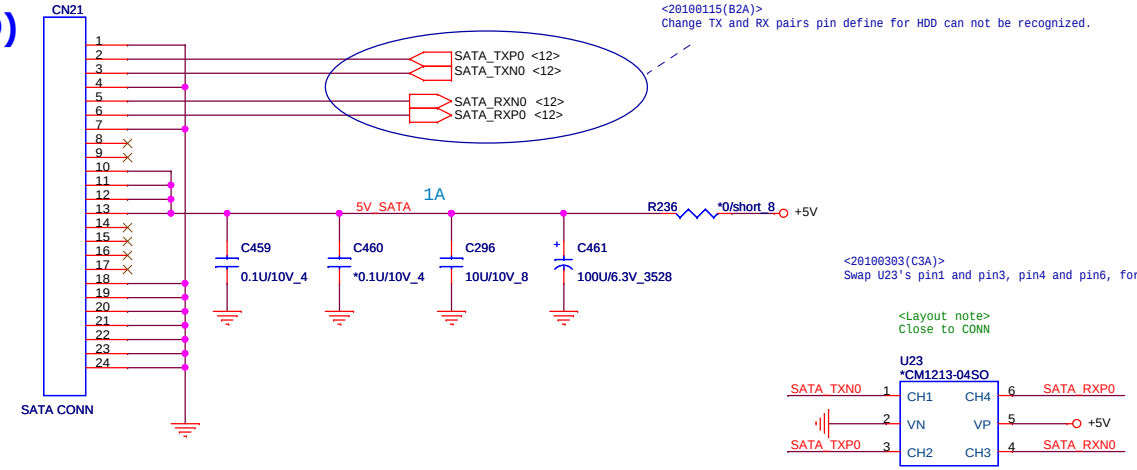

<20100115(B2A)>
Change TX and RX pairs pin define for HDD can not be recognized.

<20100303(C3A)>
Swap U23's pin1 and pin3, pin4 and pin6, for layout issue.

<Layout note>
Close to CONN

LED/SW(UIF)

<20091214(A1A)_Confirm with Acer Johnson_Yeh>
The JV01_NL and SJV01_NL had 4 LEDs --> Power / Battery / HDD / Communication

<20100203(B2A)>
Change R401 from CS13302JB21 to CS12702JB14
Change R402 from CS13302JB21 to CS14702JB28
Change R403 from CS13302JB21 to CS11202JB21
Change R404,R406 from CS13302JB21 to CS15602JB19
Change R405,R407 from CS13302JB21 to CS13602JB13
For LED's light issue.

<20100326(RAMP)>
Change R401 from CS12702JB14 to CS13302JB21
Change R404,R406 from CS15602JB19 to CS14702JB28
Change R403 from CS11202JB21 to CS12702JB14
Change R405,R407 from CS13602JB13 to CS12702JB14
For LED's light issue.

CAPS LED

NUM LED

HDD LED

3G LED

WLAN LED

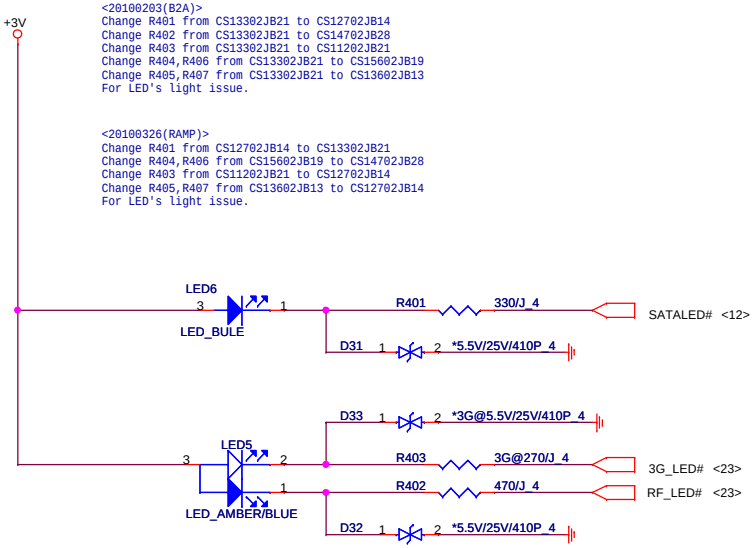

BT LED

PWR indicator

<20100125(B2A)>
Change SW1 from DHP00AC1G00 to DHP00533K00, for SMT issue.

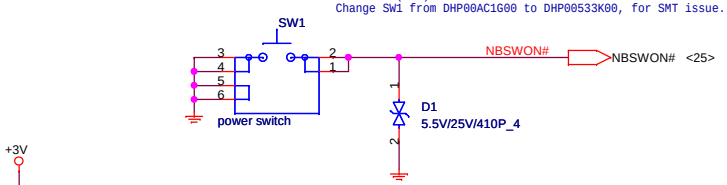

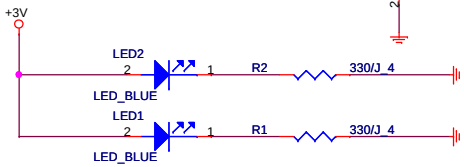

PWR LED

SUS LED

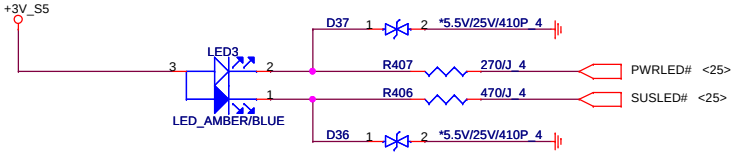

FULL LED

CHG LED

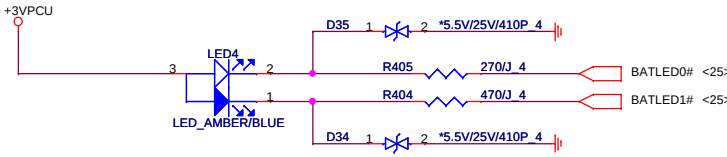

<LED spec>
BLUE :
Vf = 2.7~3.2V ; If = 5mA
BLUE/ORANGE :
BH→Vf = 2.7~3.7V ; If = 20mA max=25mA
S2→Vf = 1.7~2.4V ; If = 20mA max=25mA

ID(Left-->Right)
Power LED/BATT LED/HDD LED/WiFi LED

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	SATA HDD/LED/SW	4A
Date: Sunday, March 28, 2010	Sheet 22 of 40	

Mini Card(MPC)

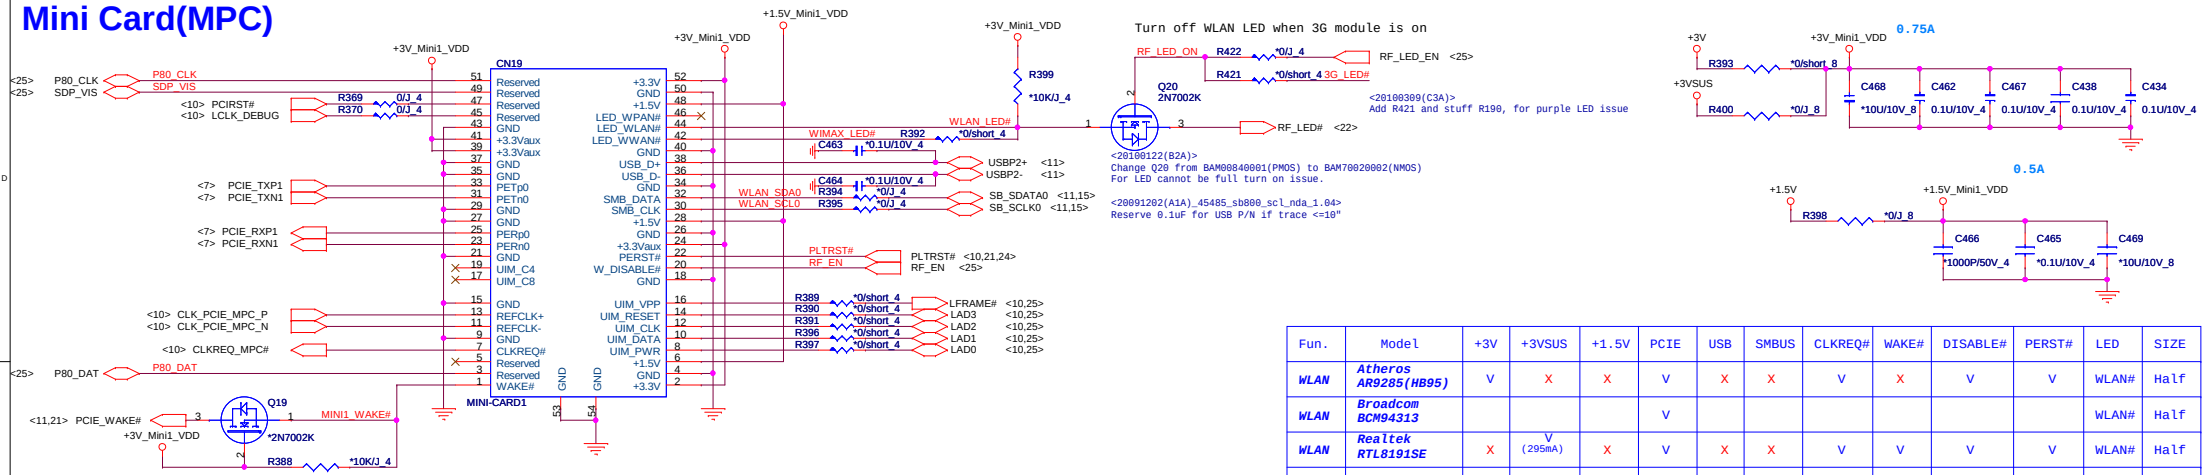

Fun.	Model	+3V	+3VSUS	+1.5V	PCIE	USB	SMBUS	CLKREQ#	WAKE#	DISABLE#	PERST#	LED	SIZE
WLAN	Atheros AR9285(HB95)	V	X	X	V	X	X	V	X	V	V	WLAN#	Half
WLAN	Broadcom BCM94313				V							WLAN#	Half
WLAN	Realtek RTL8191SE	X	V (295mA)	X	V	X	X	V	V	V	V	WLAN#	Half

Mini Card 2(MNC)

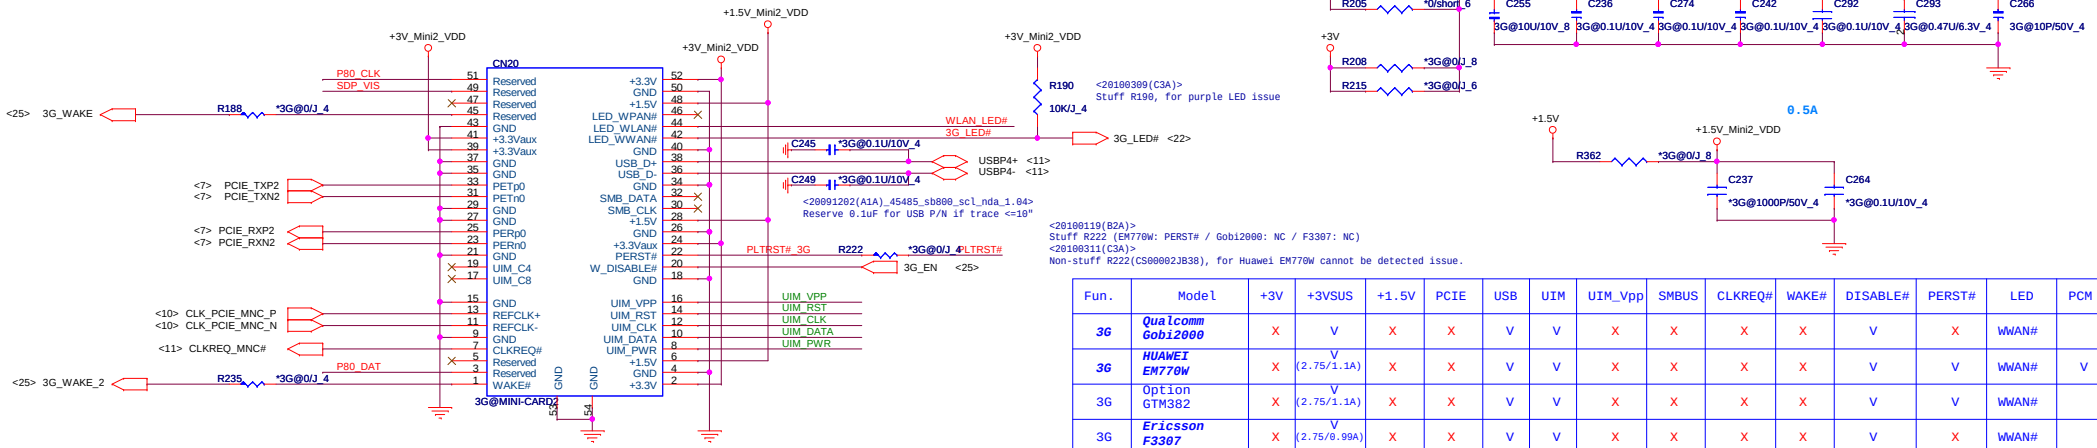

Fun.	Model	+3V	+3VSUS	+1.5V	PCIE	USB	UIM	UIM_Vpp	SMBUS	CLKREQ#	WAKE#	DISABLE#	PERST#	LED	PCM	SIZE
3G	Qualcomm Gobi2000	X	V	X	X	V	V	X	X	X	X	V	X	WWAN#		Full
3G	HUAWEI EM770W	X	V (2.75/1.1A)	X	X	V	V	X	X	X	X	V	V	WWAN#	V	Full
3G	Option GTM382	X	V (2.75/1.1A)	X	X	V	V	X	X	X	X	V	V	WWAN#		Full
3G	Ericsson F3307	X	V (2.75/0.99A)	X	X	V	V	X	X	X	X	V	X	WWAN#		Full
Wimax	Intel 5150(512...)	X	V (643mA)	X	V	V	X	X	X	V	V	V	V	WLAN# WWAN#		Full

MultiMedia SIM

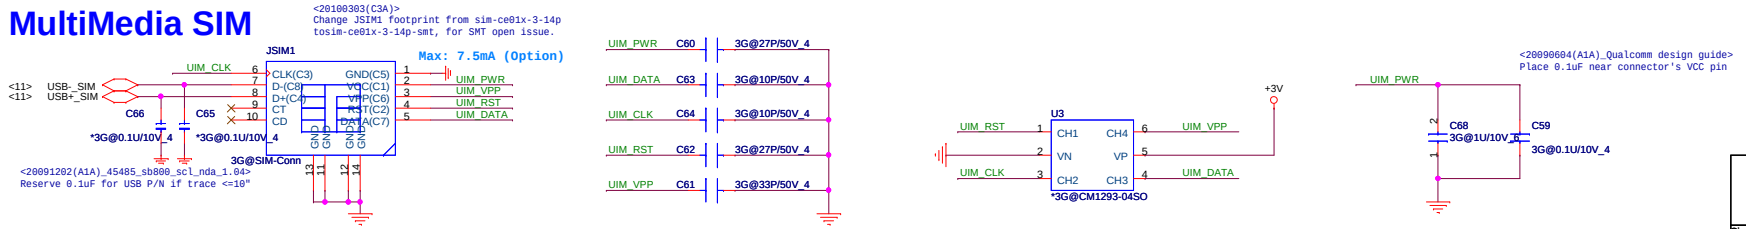

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	Mini-Card/WL/3G/SIM	4A
Date: Sunday, March 28, 2010	Sheet 23 of 40	

AU6437B52-GBL-GR (MMC)

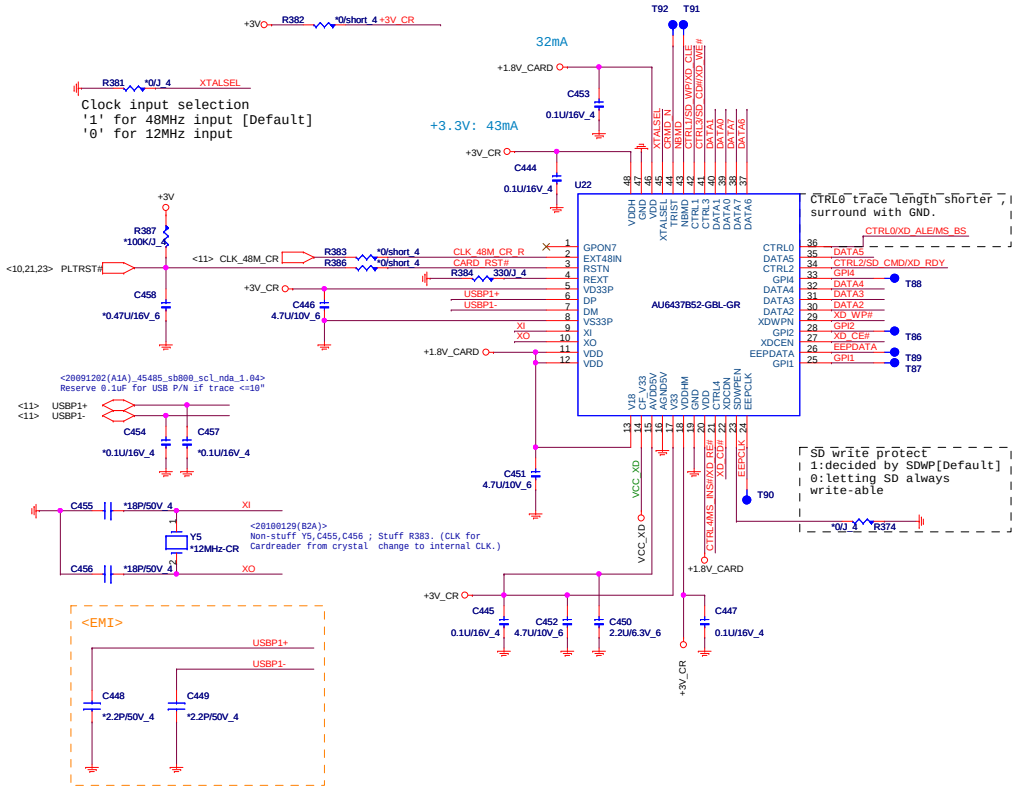

4 IN 1 CARD READER (MMC)

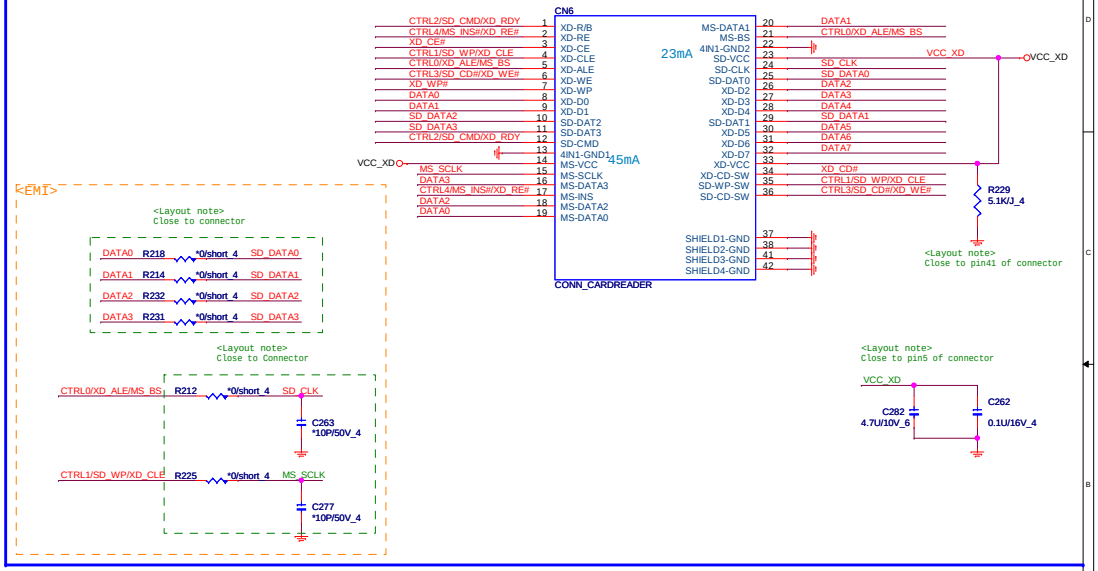

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	AU6437 (Card Reader)	4A

Date: Sunday, March 28, 2010 Sheet 24 of 40

EC(KBC)

U6

NPCE781L(A0DX)

<Layout note>
Place every 0.1uF
close to every
power pin

<20090602(A1A)_Vendor suggest>
Place 10nF-0.1uF capacitors for
every AD input. And close to the AD
input.

DS page248, GA20/KBRST# are VCC well, but
they were held low when VDD well is off.

<20090831(A1A)_EC team suggest>
1.remove diode from EC_SCI#

<EMI>

<20090602(A1A)_Vendor suggest>
Add 2.2ohm series resister for
ESD/EOS issue

<20090831(A1A)_EC team suggest>
1.remove diode from DNBSWON#

<20090831(A1A)_EC team suggest>
1.change R7027/R7028 to 1M or 100K ohm
2.change PWR/SUS LED's power from +3VPCU to +3V_S5 or +3VSUS
can reduce pull-high resistor of SUSLED#/PWRLED#

<20090721_FAE suggestion>
Stuff 100K and close to EC side
for improving power consumption

<20100319(RAMP)>
Non-stuff D9,D17, for cost down.

I/O ADDRESS SETTING

TEST Mode	TEST#	XORTR#	TRIST#
no test mode selected (normal operation)	1	X	X
XOR-tree test mode	0	0	1
ICT mode	0	1	0
Reserved exclusively for Nuvoton use	0	00 or 11	

SHBM=0: Enable shared memory with host BIOS

SM BUS PU

1ST: Battery
2ND: CPU Thermal Sensor / DTS
3RD: VGA Thermal Sensor

SPI FLASH

1/13 Comfirm by vendor mail :
If the Southbridge enables 'Long Wait Abort' by default, the
flash device should be 50MHz (or faster)

HWPG

INTERNAL KEYBOARD STRIP SET

Plam Rest
Thermal Sersor

Quanta Computer Inc.
PROJECT : ZH9

Size	Document Number	Rev
	NPCE781L & FLASH	4A
Date: Sunday, March 28, 2010	Sheet 25 of 40	

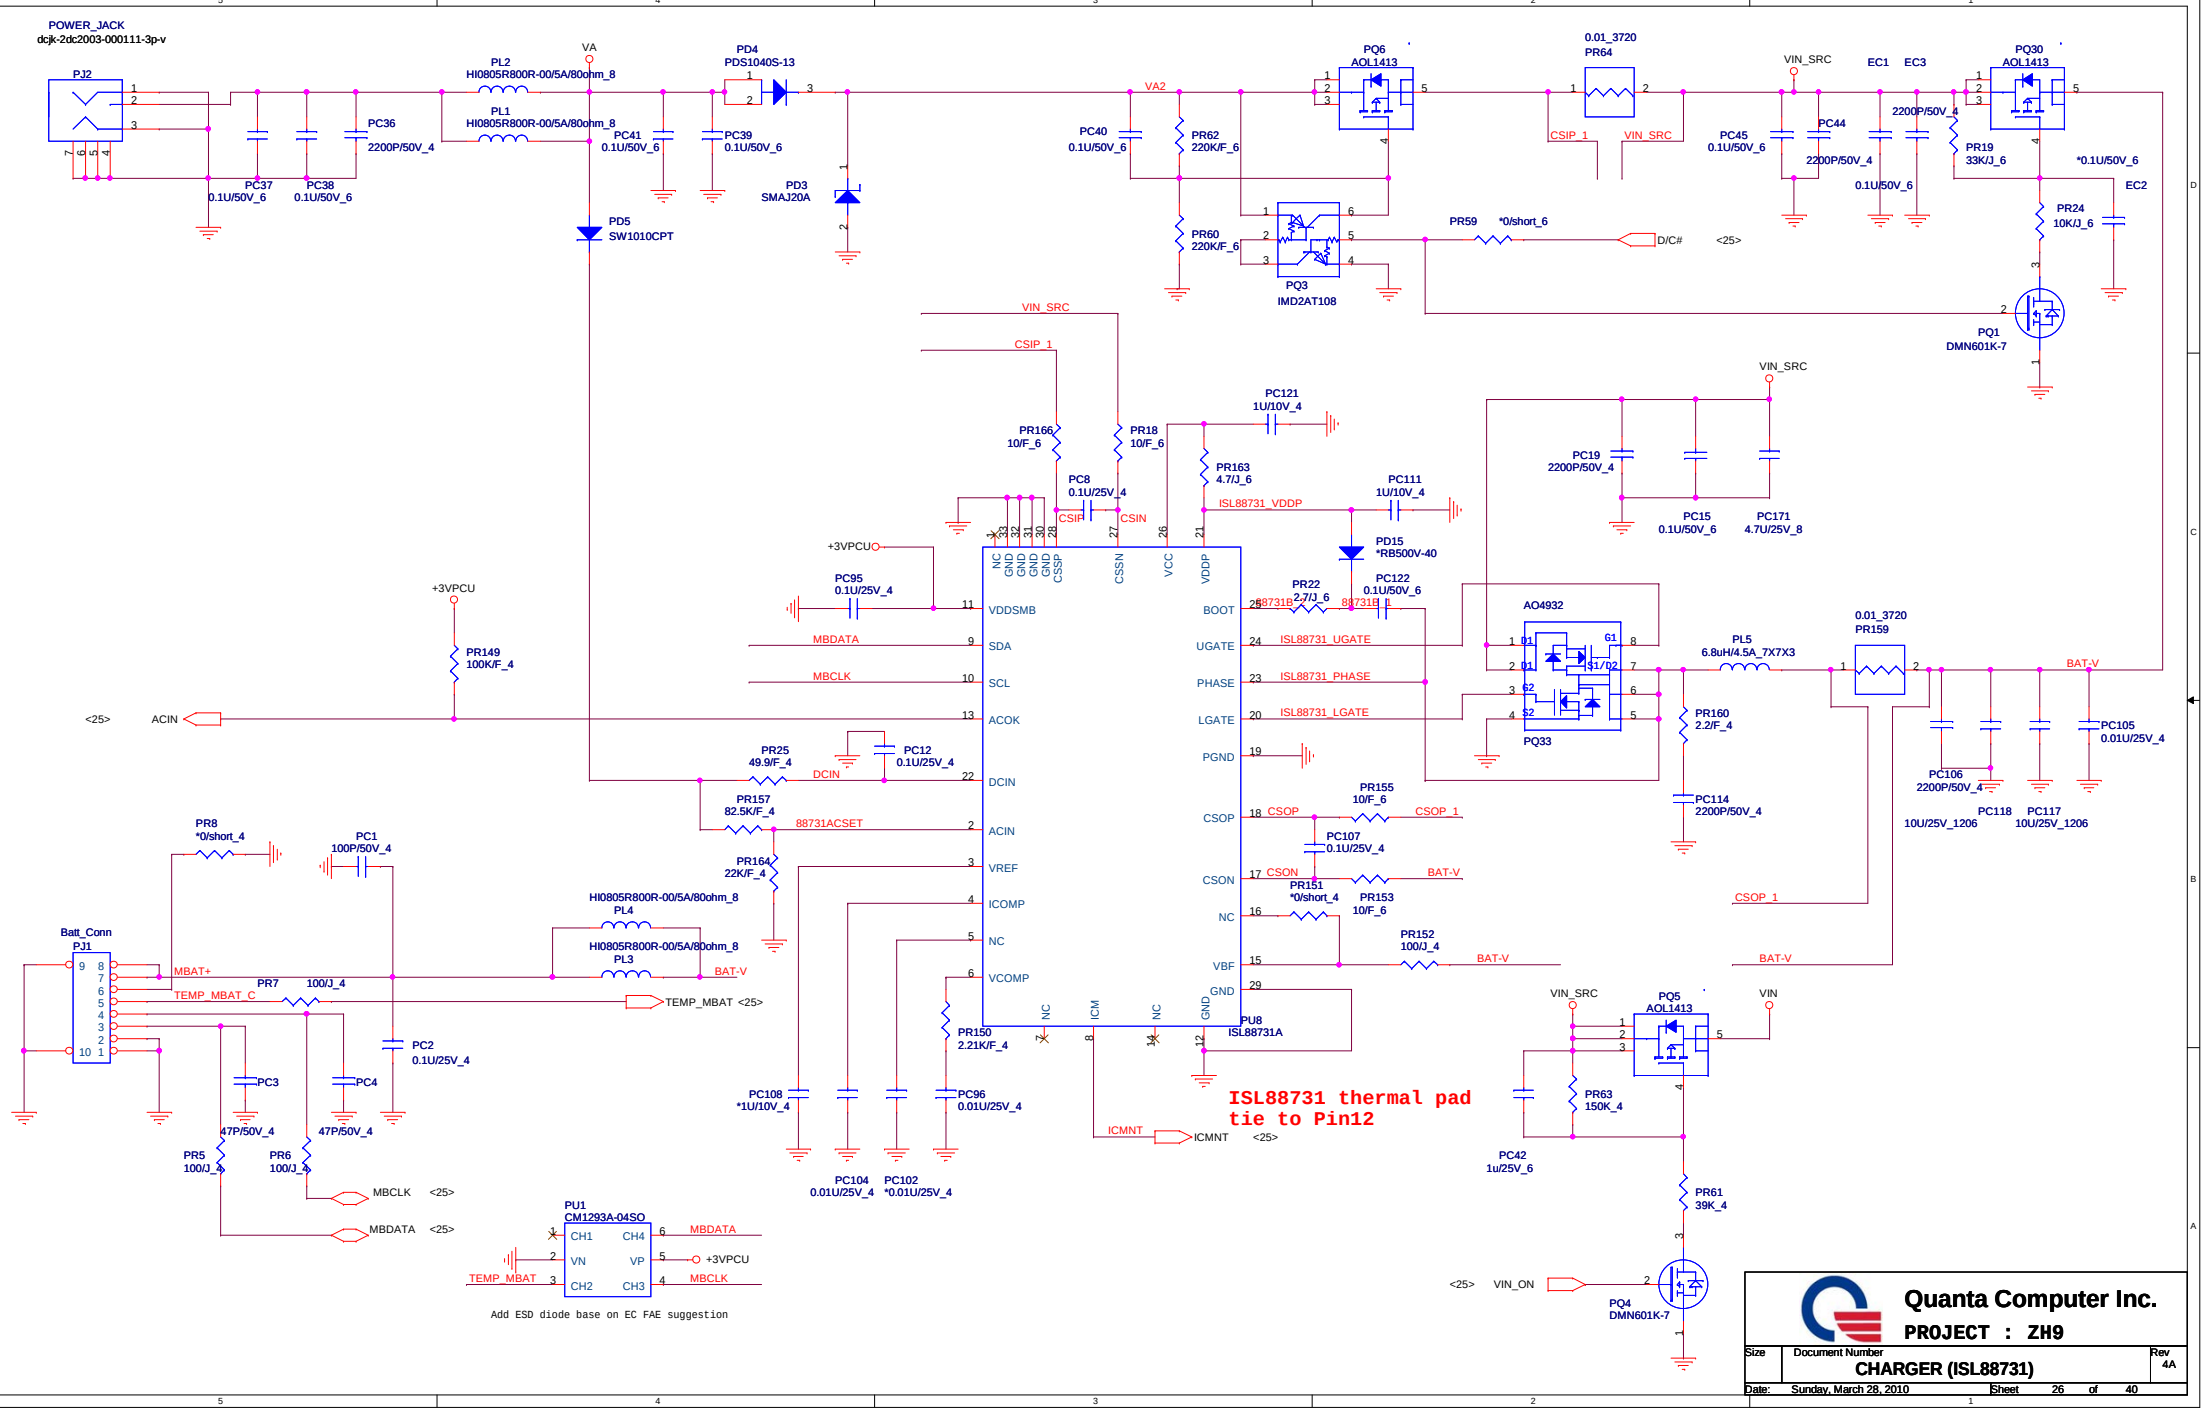
POWER_JACK
dcjk-2dc2003-000111-3p-v
PJ2
VA
PL2
HI0805R800R-00/5A/80ohm_8
PL1
HI0805R800R-00/5A/80ohm_8
PD4
PDS1040S-13
PD3
SMAJ20A
PD5
SW1010CPT
PC36
2200P/50V_4
PC37
0.1U/50V_6
PC38
0.1U/50V_6
PC41
0.1U/50V_6
PC39
0.1U/50V_6
VA2
PC40
0.1U/50V_6
PR62
220K/F_6
PR60
220K/F_6
PQ6
AOL1413
PQ3
IMD2AT108
PR64
0.01_3720
CSIP_1
VIN_SRC
PR59
*0/short_6
D/C#
<25>
PC45
0.1U/50V_6
PC44
2200P/50V_4
EC1
EC3
EC2
PQ30
AOL1413
PR19
33K/J_6
*0.1U/50V_6
PR24
10K/J_6
PQ1
DMN601K-7
PR166
10/F_6
PR18
10/F_6
PC8
0.1U/25V_4
CSIP
CSIN
PC121
1U/10V_4
PR163
4.7/J_6
ISL88731_VDDP
PC111
1U/10V_4
PD15
*RB500V-40
PC122
0.1U/50V_6
PC19
2200P/50V_4
PC15
0.1U/50V_6
PC171
4.7U/25V_8
+3VPCU
PC95
0.1U/25V_4
PR149
100K/F_4
<25>
ACIN
MBDATA
MBCLK
PR25
49.9/F_4
PC12
0.1U/25V_4
DCIN
PR157
82.5K/F_4
88731ACSET
PR164
22K/F_4
PR22
2.7/J_6
88731BOOT
88731LG1
AO4932
PQ33
PL5
6.8uH/4.5A_7X7X3
0.01_3720
PR159
BAT-V
PR160
2.2/F_4
PC114
2200P/50V_4
PC106
2200P/50V_4
PC118
10U/25V_1206
PC117
10U/25V_1206
PC105
0.01U/25V_4
CSOP_1
PR155
10/F_6
PC107
0.1U/25V_4
PR151
*0/short_4
PR153
10/F_6
PR152
100/J_4
PR8
*0/short_4
PC1
100P/50V_4
HI0805R800R-00/5A/80ohm_8
PL4
HI0805R800R-00/5A/80ohm_8
PL3
Batt_Conn
PJ1
MBAT+
PR7
100/J_4
TEMP_MBAT_C
TEMP_MBAT <25>
PC2
0.1U/25V_4
PC3
PC4
47P/50V_4
47P/50V_4
PR5
100/J_4
PR6
100/J_4
MBCLK <25>
MBDATA <25>
PU1
CM1293A-04SO
CH1
CH4
VN
VP
CH2
CH3
MBDATA
+3VPCU
MBCLK
TEMP_MBAT
Add ESD diode base on EC FAE suggestion
PC108
*1U/10V_4
PC104
0.01U/25V_4
PC102
*0.01U/25V_4
PC96
0.01U/25V_4
PR150
2.21K/F_4
ICMNT
ICMNT <25>
PU8
ISL88731A
NC
GND
BOOT
UGATE
PHASE
LGATE
PGND
CSOP
CSON
VBF
VCC
VDDP
CSSN
CSSP
VDDSMB
SDA
SCL
ACOK
VREF
ICOMP
VCOMP
ICM
ISL88731_UGATE
ISL88731_PHASE
ISL88731_LGATE
ISL88731 thermal pad tie to Pin12
PQ5
AOL1413
PR63
150K_4
PC42
1u/25V_6
PR61
39K_4
PQ4
DMN601K-7
<25>
VIN_ON
VIN
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
CHARGER (ISL88731)
Rev
4A
Date: Sunday, March 28, 2010
Sheet 26 of 40

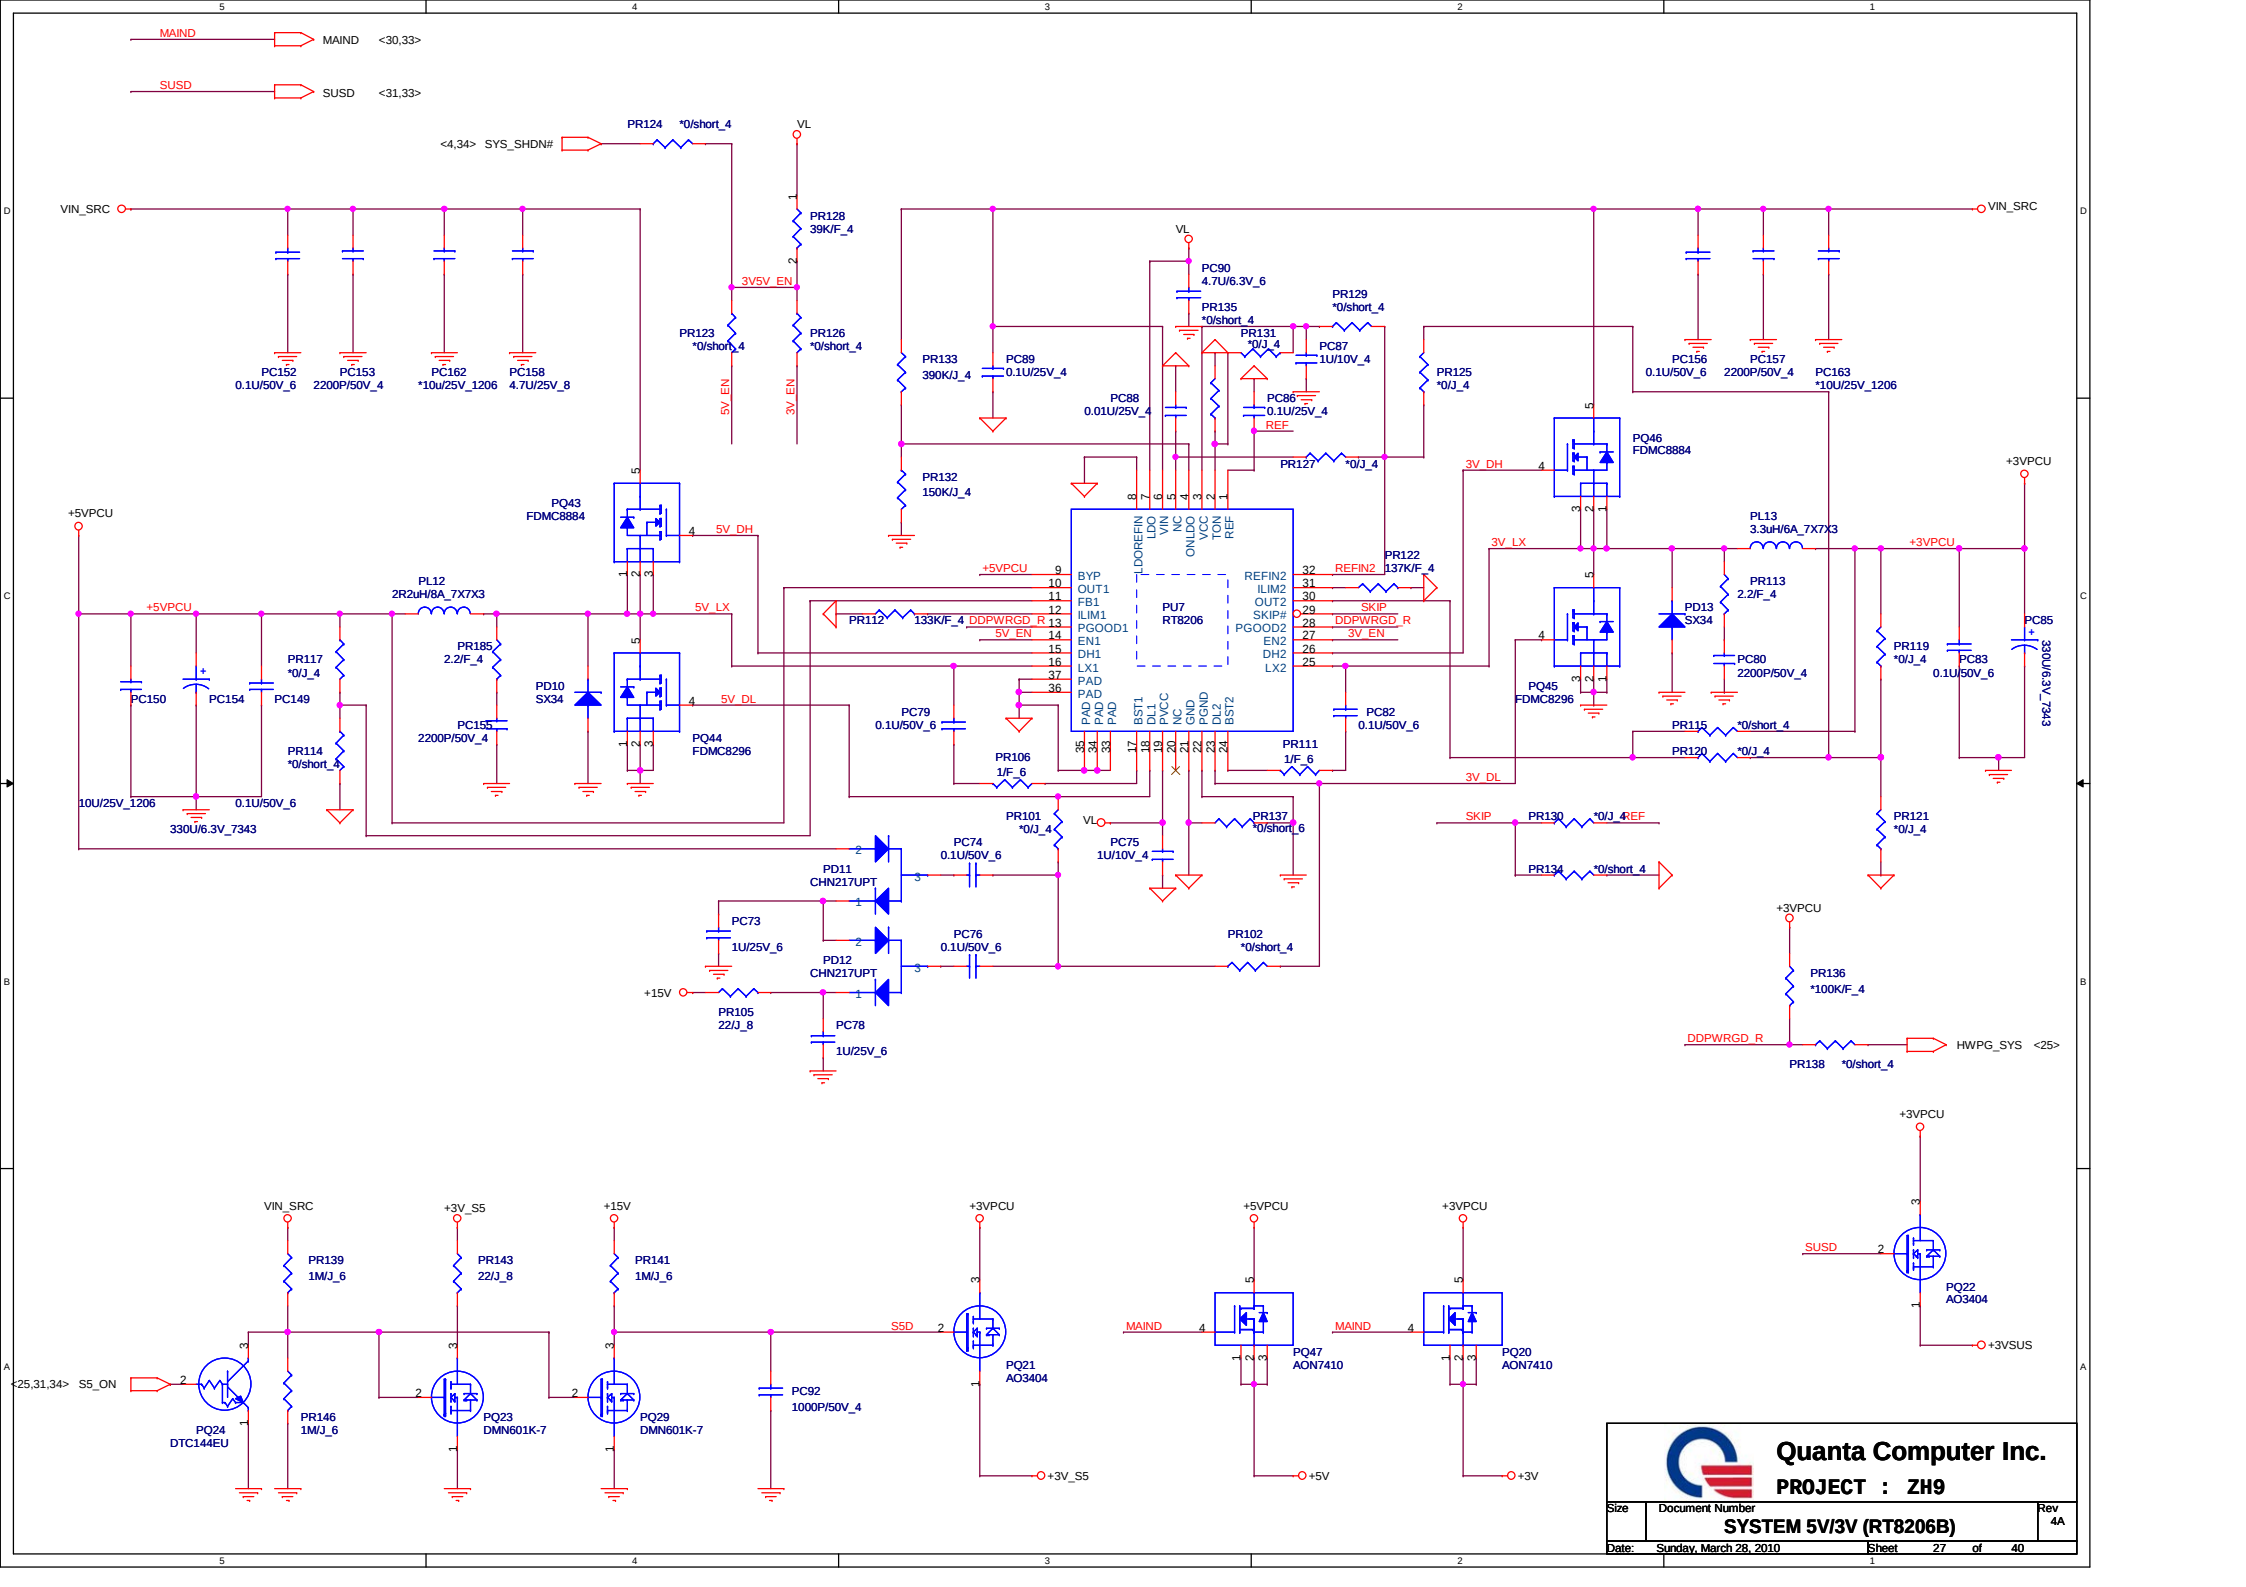
MAIND
MAIND <30,33>
SUSD
SUSD <31,33>
<4,34> SYS_SHDN#
PR124 *0/short_4
VL
VIN_SRC
PR128 39K/F_4
PR123 *0/short_4
PR126 *0/short_4
3V5V_EN
5V_EN
3V_EN
PC152 0.1U/50V_6
PC153 2200P/50V_4
PC162 *10u/25V_1206
PC158 4.7U/25V_8
PR133 390K/J_4
PC89 0.1U/25V_4
PR132 150K/J_4
PC90 4.7U/6.3V_6
PR135 *0/short_4
PR131 *0/J_4
PR129 *0/short_4
PC87 1U/10V_4
PC88 0.01U/25V_4
PC86 0.1U/25V_4
REF
PR127 *0/J_4
PR125 *0/J_4
PC156 0.1U/50V_6
PC157 2200P/50V_4
PC163 *10U/25V_1206
PQ46 FDMC8884
3V_DH
3V_LX
PL13 3.3uH/6A_7X7X3
+3VPCU
PR113 2.2/F_4
PD13 SX34
PC80 2200P/50V_4
PC83 0.1U/50V_6
PC85 330U/6.3V_7343
PR119 *0/J_4
PR121 *0/J_4
PR115 *0/short_4
PR120 *0/J_4
+5VPCU
PQ43 FDMC8884
5V_DH
5V_LX
PL12 2R2uH/8A_7X7X3
PR185 2.2/F_4
PD10 SX34
PC155 2200P/50V_4
PQ44 FDMC8296
5V_DL
PR117 *0/J_4
PR114 *0/short_4
PC150
PC154
PC149
10U/25V_1206
0.1U/50V_6
330U/6.3V_7343
PU7 RT8206
LDOREFIN
LDO
VIN
NC
ONLDO
VCC
TON
REF
BYP
OUT1
FB1
ILIM1
PGOOD1
EN1
DH1
LX1
PAD
REFIN2
ILIM2
OUT2
SKIP#
PGOOD2
EN2
DH2
LX2
BST1
DL1
PVCC
NC
GND
PGND
DL2
BST2
PR112 133K/F_4
DDPWRGD_R
5V_EN
3V_EN
PR122 137K/F_4
SKIP
PC79 0.1U/50V_6
PC82 0.1U/50V_6
PR106 1/F_6
PR111 1/F_6
PR101 *0/J_4
PR137 *0/short_6
PC74 0.1U/50V_6
PC75 1U/10V_4
PD11 CHN217UPT
PC73 1U/25V_6
PC76 0.1U/50V_6
PD12 CHN217UPT
PR102 *0/short_4
+15V
PR105 22/J_8
PC78 1U/25V_6
PQ45 FDMC8296
SKIP
PR130 *0/J_4 REF
PR134 *0/short_4
PR136 *100K/F_4
DDPWRGD_R
HWPG_SYS <25>
PR139 1M/J_6
PR143 22/J_8
PR141 1M/J_6
<25,31,34> S5_ON
PQ24 DTC144EU
PR146 1M/J_6
PQ23 DMN601K-7
PQ29 DMN601K-7
PC92 1000P/50V_4
S5D
PQ21 AO3404
+3V_S5
MAIND
PQ47 AON7410
PQ20 AON7410
+5V
+3V
SUSD
PQ22 AO3404
+3VSUS
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
SYSTEM 5V/3V (RT8206B)
Rev 4A
Date: Sunday, March 28, 2010
Sheet 27 of 40

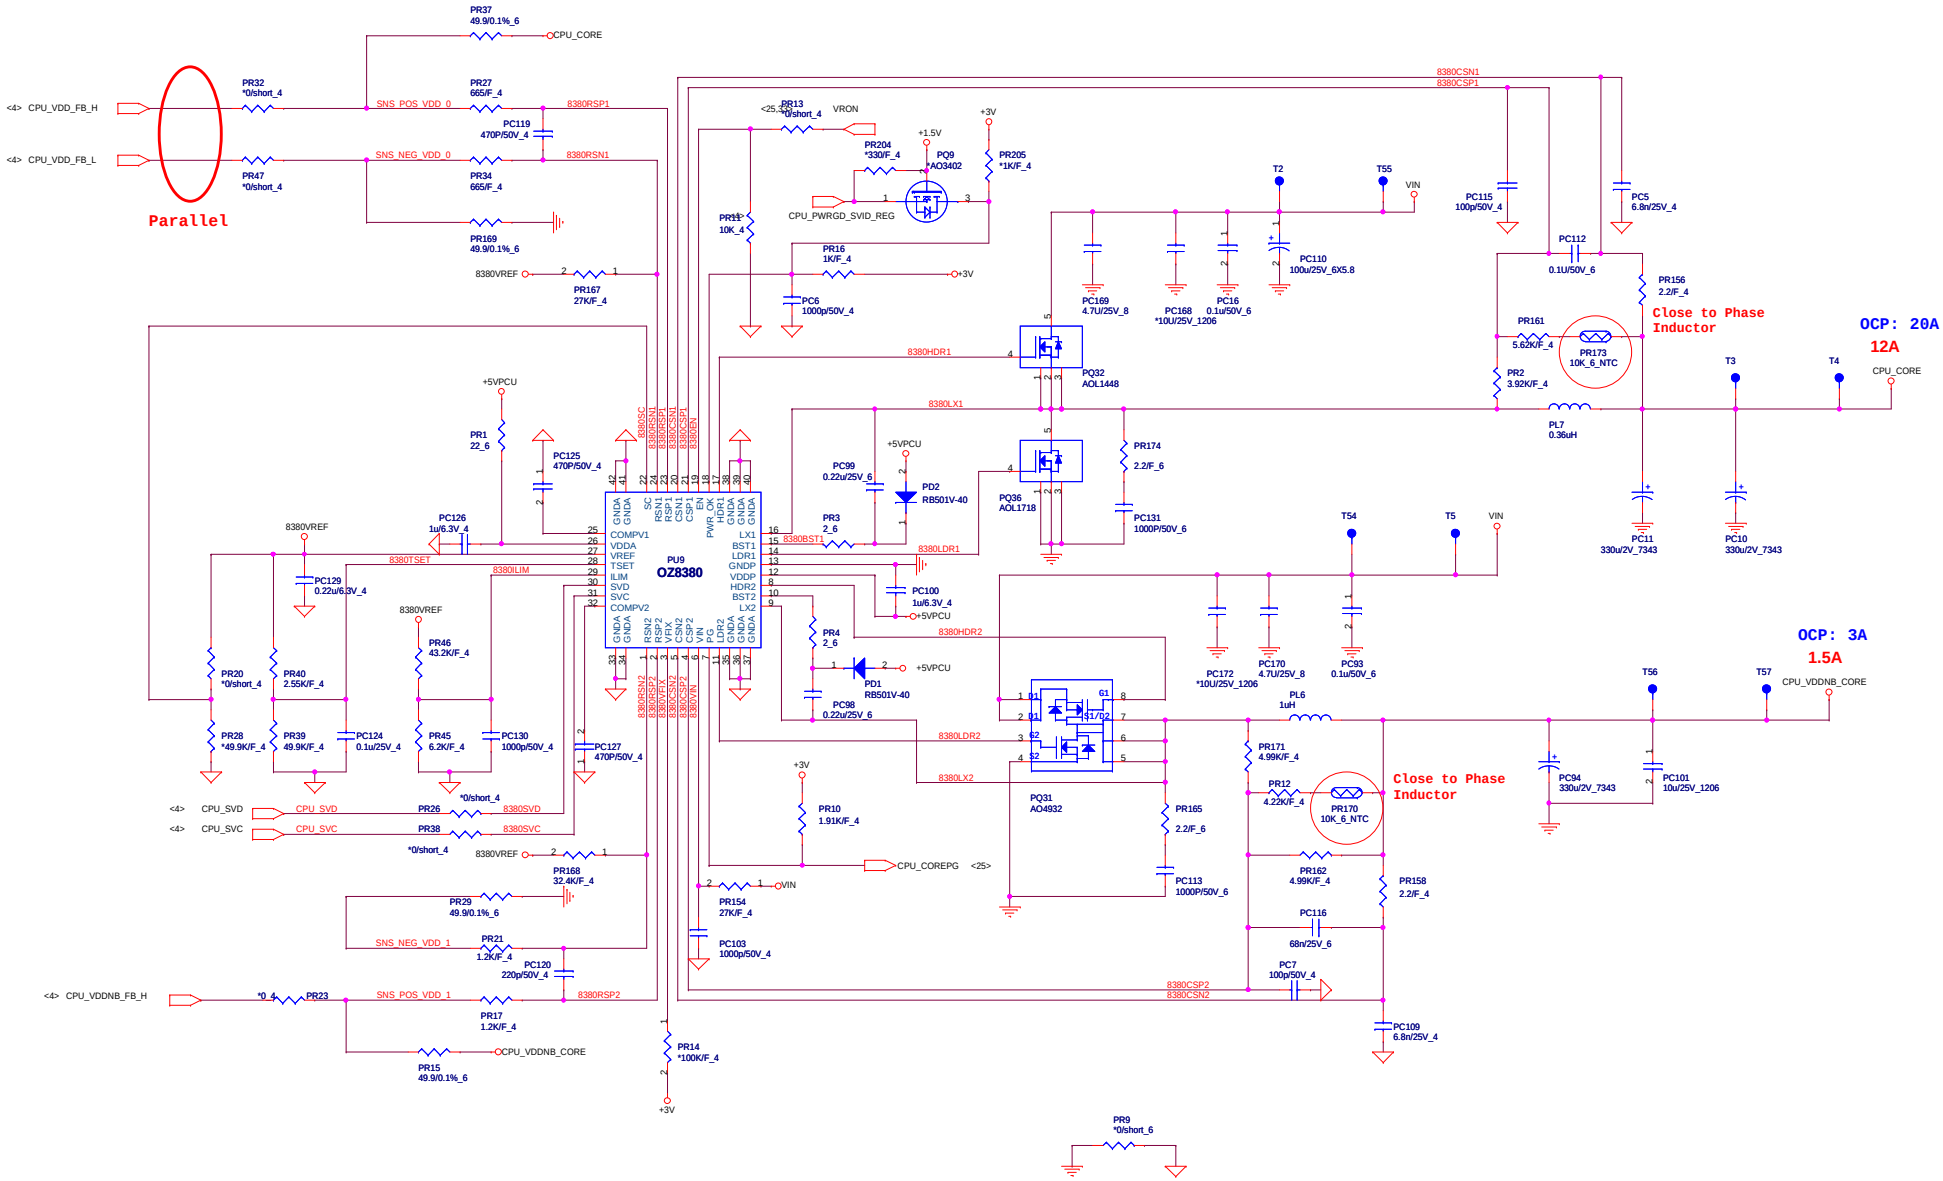
Parallel
PU9
OZ8380
Close to Phase Inductor
OCP: 20A
12A
Close to Phase Inductor
OCP: 3A
1.5A
Quanta Computer Inc.
PROJECT : ZH9
AMD CPU Core (OZ8380)
Size
Document Number
Rev
4A
Date: Sunday, March 28, 2010
Sheet 28 of 40

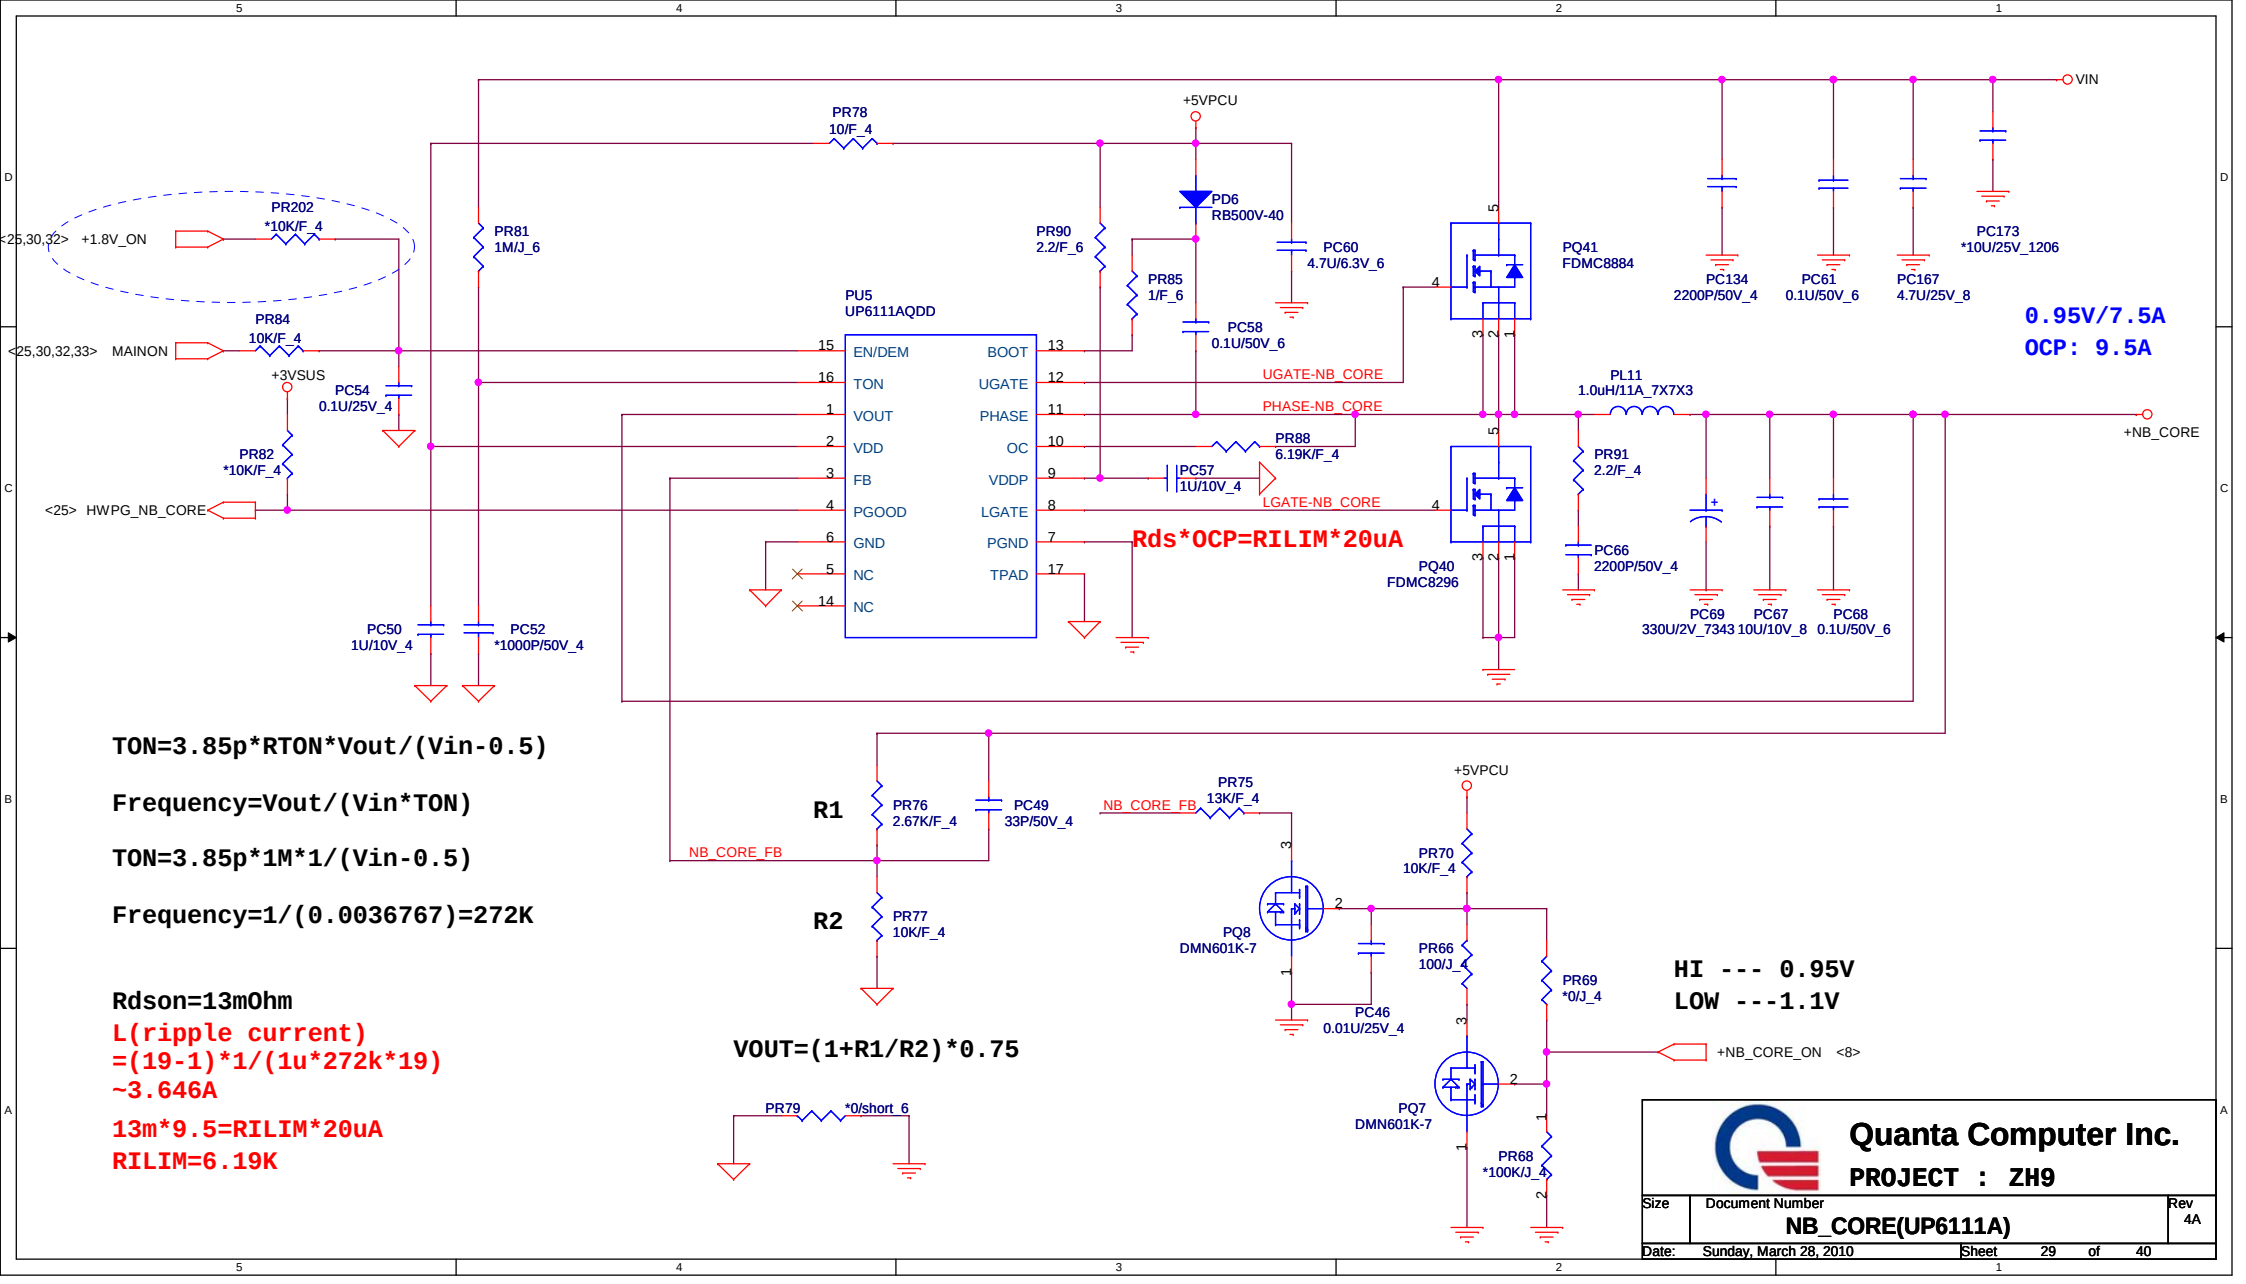
VIN
+5VPCU
PR78
10/F_4
PD6
RB500V-40
PR202
*10K/F_4
<25,30,32> +1.8V_ON
PR81
1M/J_6
PR90
2.2/F_6
PR85
1/F_6
PC60
4.7U/6.3V_6
PC58
0.1U/50V_6
PU5
UP6111AQDD
PR84
10K/F_4
<25,30,32,33> MAINON
+3VSUS
PC54
0.1U/25V_4
PR82
*10K/F_4
<25> HWPG_NB_CORE
EN/DEM
TON
VOUT
VDD
FB
PGOOD
GND
NC
NC
BOOT
UGATE
PHASE
OC
VDDP
LGATE
PGND
TPAD
UGATE-NB_CORE
PHASE-NB_CORE
LGATE-NB_CORE
PR88
6.19K/F_4
PC57
1U/10V_4
Rds*OCP=RILIM*20uA
PQ41
FDMC8884
PQ40
FDMC8296
PC134
2200P/50V_4
PC61
0.1U/50V_6
PC167
4.7U/25V_8
PC173
*10U/25V_1206
0.95V/7.5A
OCP: 9.5A
PL11
1.0uH/11A_7X7X3
PR91
2.2/F_4
PC66
2200P/50V_4
PC69
330U/2V_7343
PC67
10U/10V_8
PC68
0.1U/50V_6
+NB_CORE
PC50
1U/10V_4
PC52
*1000P/50V_4
TON=3.85p*RTON*Vout/(Vin-0.5)
Frequency=Vout/(Vin*TON)
TON=3.85p*1M*1/(Vin-0.5)
Frequency=1/(0.0036767)=272K
Rdson=13mOhm
L(ripple current)
=(19-1)*1/(1u*272k*19)
~3.646A
13m*9.5=RILIM*20uA
RILIM=6.19K
R1
R2
PR76
2.67K/F_4
PC49
33P/50V_4
PR77
10K/F_4
NB_CORE_FB
VOUT=(1+R1/R2)*0.75
PR79
*0/short_6
PR75
13K/F_4
PR70
10K/F_4
PQ8
DMN601K-7
PR66
100/J_4
PC46
0.01U/25V_4
PR69
*0/J_4
PQ7
DMN601K-7
PR68
*100K/J_4
+NB_CORE_ON <8>
HI --- 0.95V
LOW ---1.1V
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
NB_CORE(UP6111A)
Rev
4A
Date: Sunday, March 28, 2010
Sheet 29 of 40

[PWM]

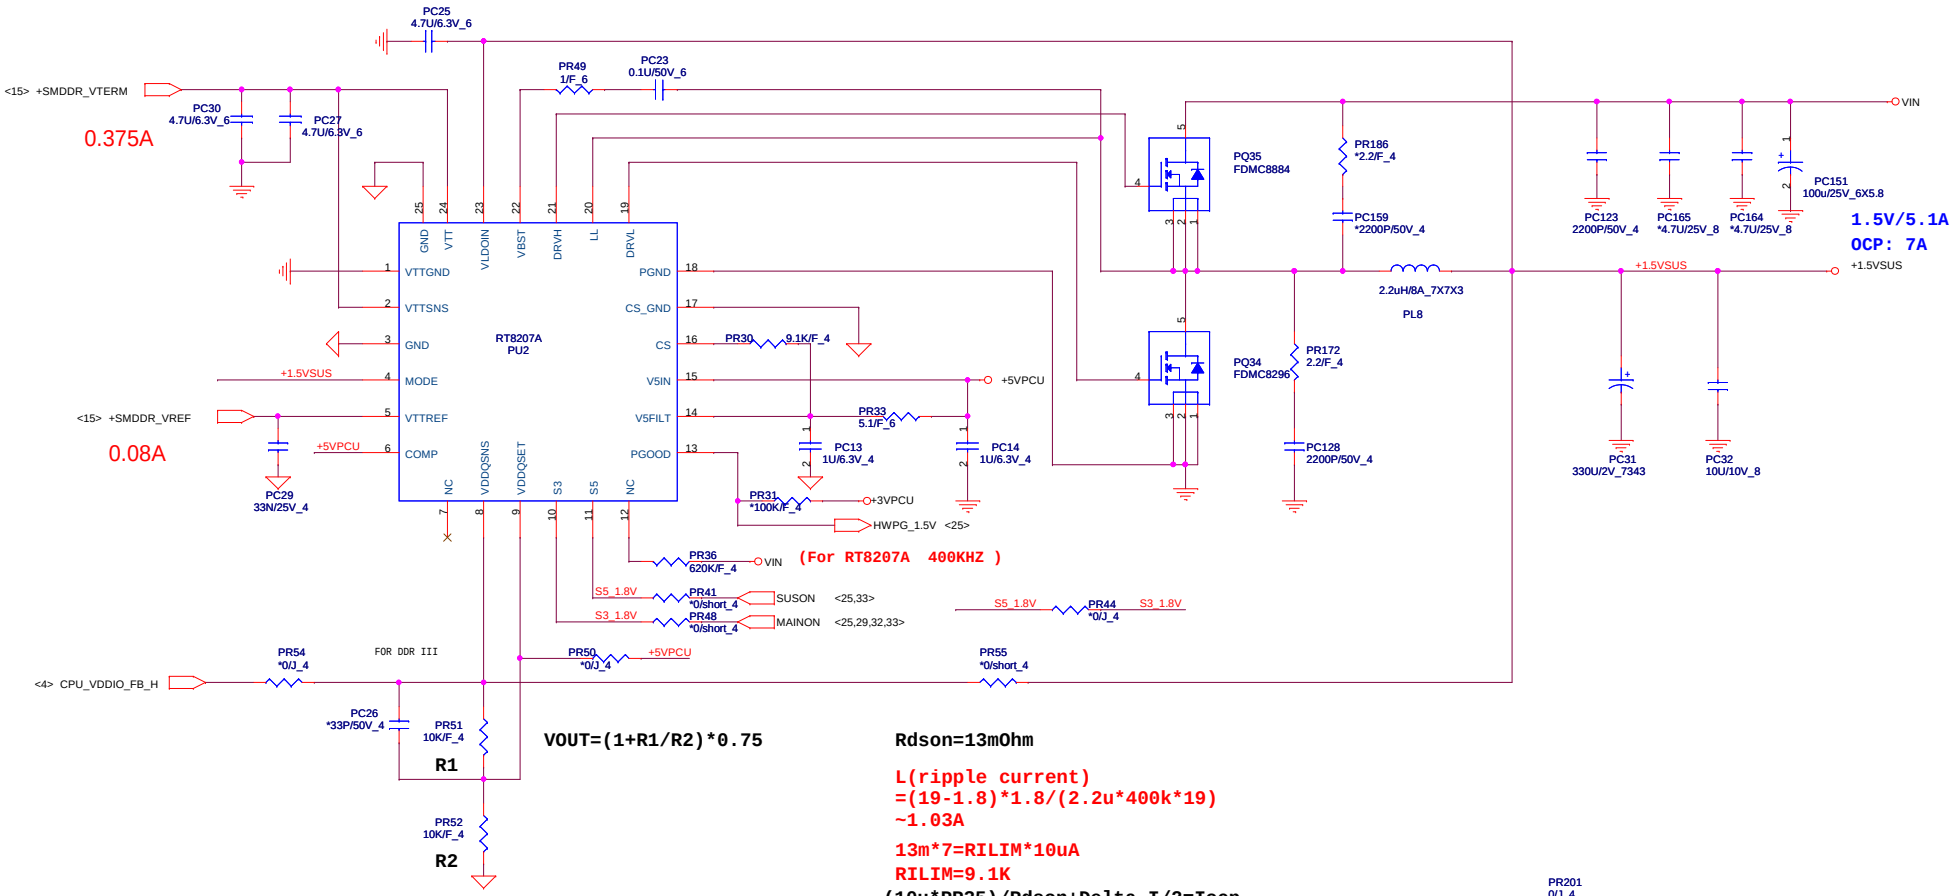

VOUT=(1+R1/R2)*0.75

Rdson=13mOhm

L(ripple current)
=(19-1.8)*1.8/(2.2u*400k*19)
~1.03A

13m*7=RILIM*10uA
RILIM=9.1K
(10u*PR35)/Rdson+Delta_I/2=Iocp

PR56 *0/short_6

MAIND MAIND <27,33>

PR201 0/J_4
MAIND +1.8V_D

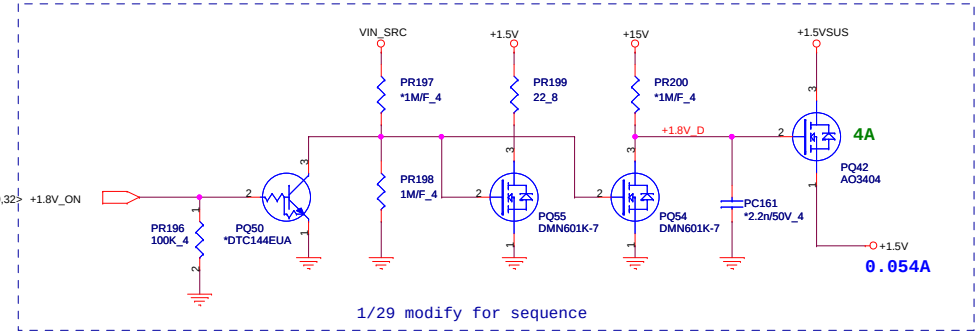

Quanta Computer Inc.		
PROJECT : ZH9		
Size	Document Number: DDR 1.5V(RT8207A)	Rev: 4A
Date: Sunday, March 28, 2010	Sheet 30 of 40	

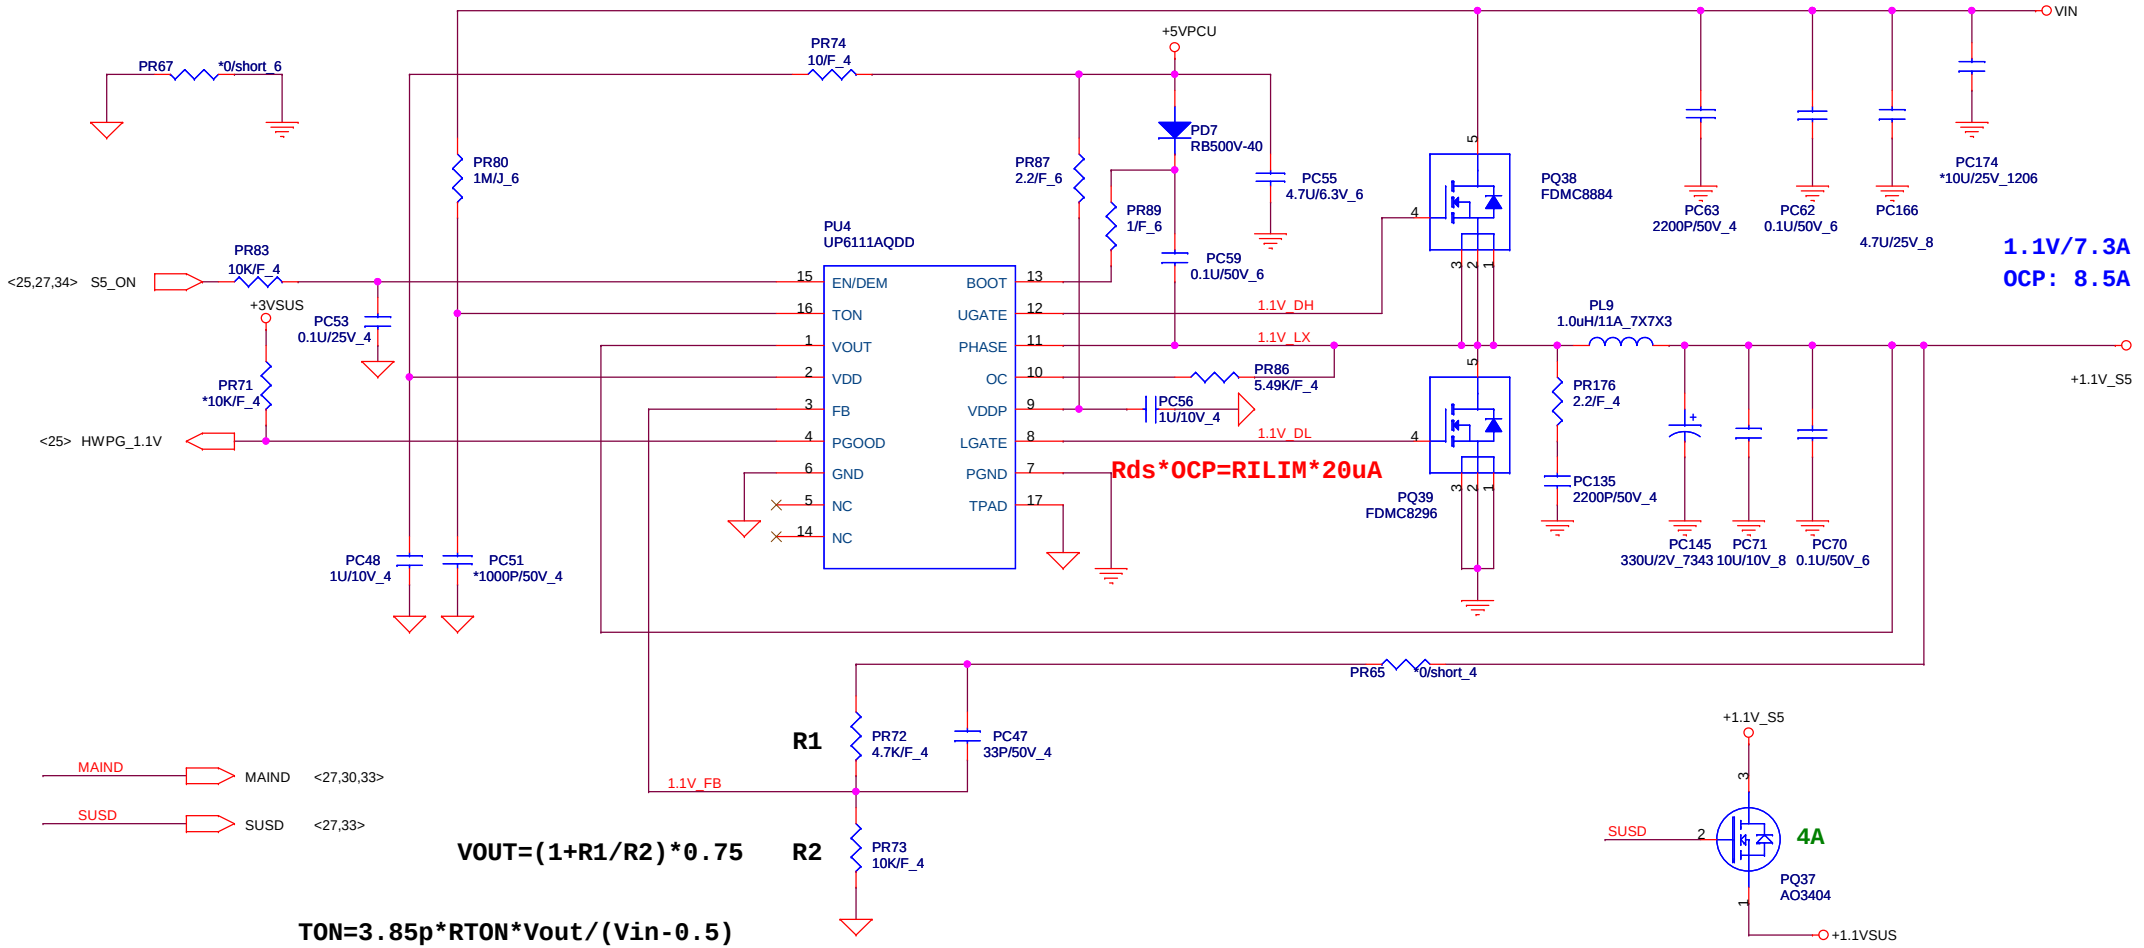

Quanta Computer Inc.		
PROJECT : ZH9		
Size	Document Number: VCCP 1.1V(UP6111A)	Rev: 4A
Date: Sunday, March 28, 2010	Sheet 31 of 40	

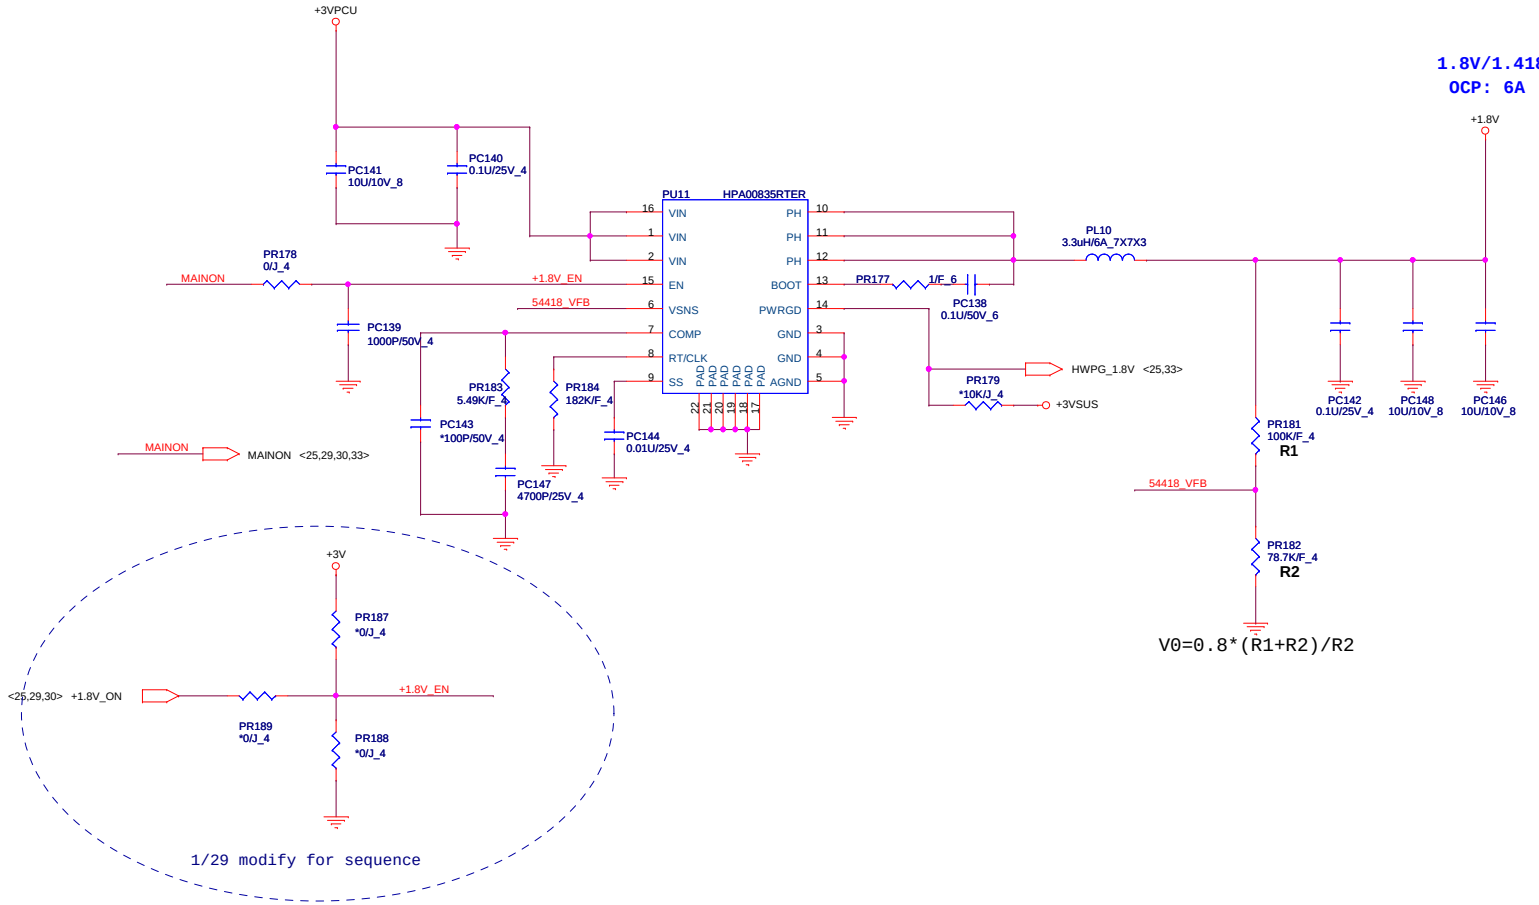

Quanta Computer Inc.		
PROJECT : ZH9		
Size	Document Number: +1.8V(TPS54418)	Rev: 4A
Date: Sunday, March 28, 2010	Sheet 32 of 40	

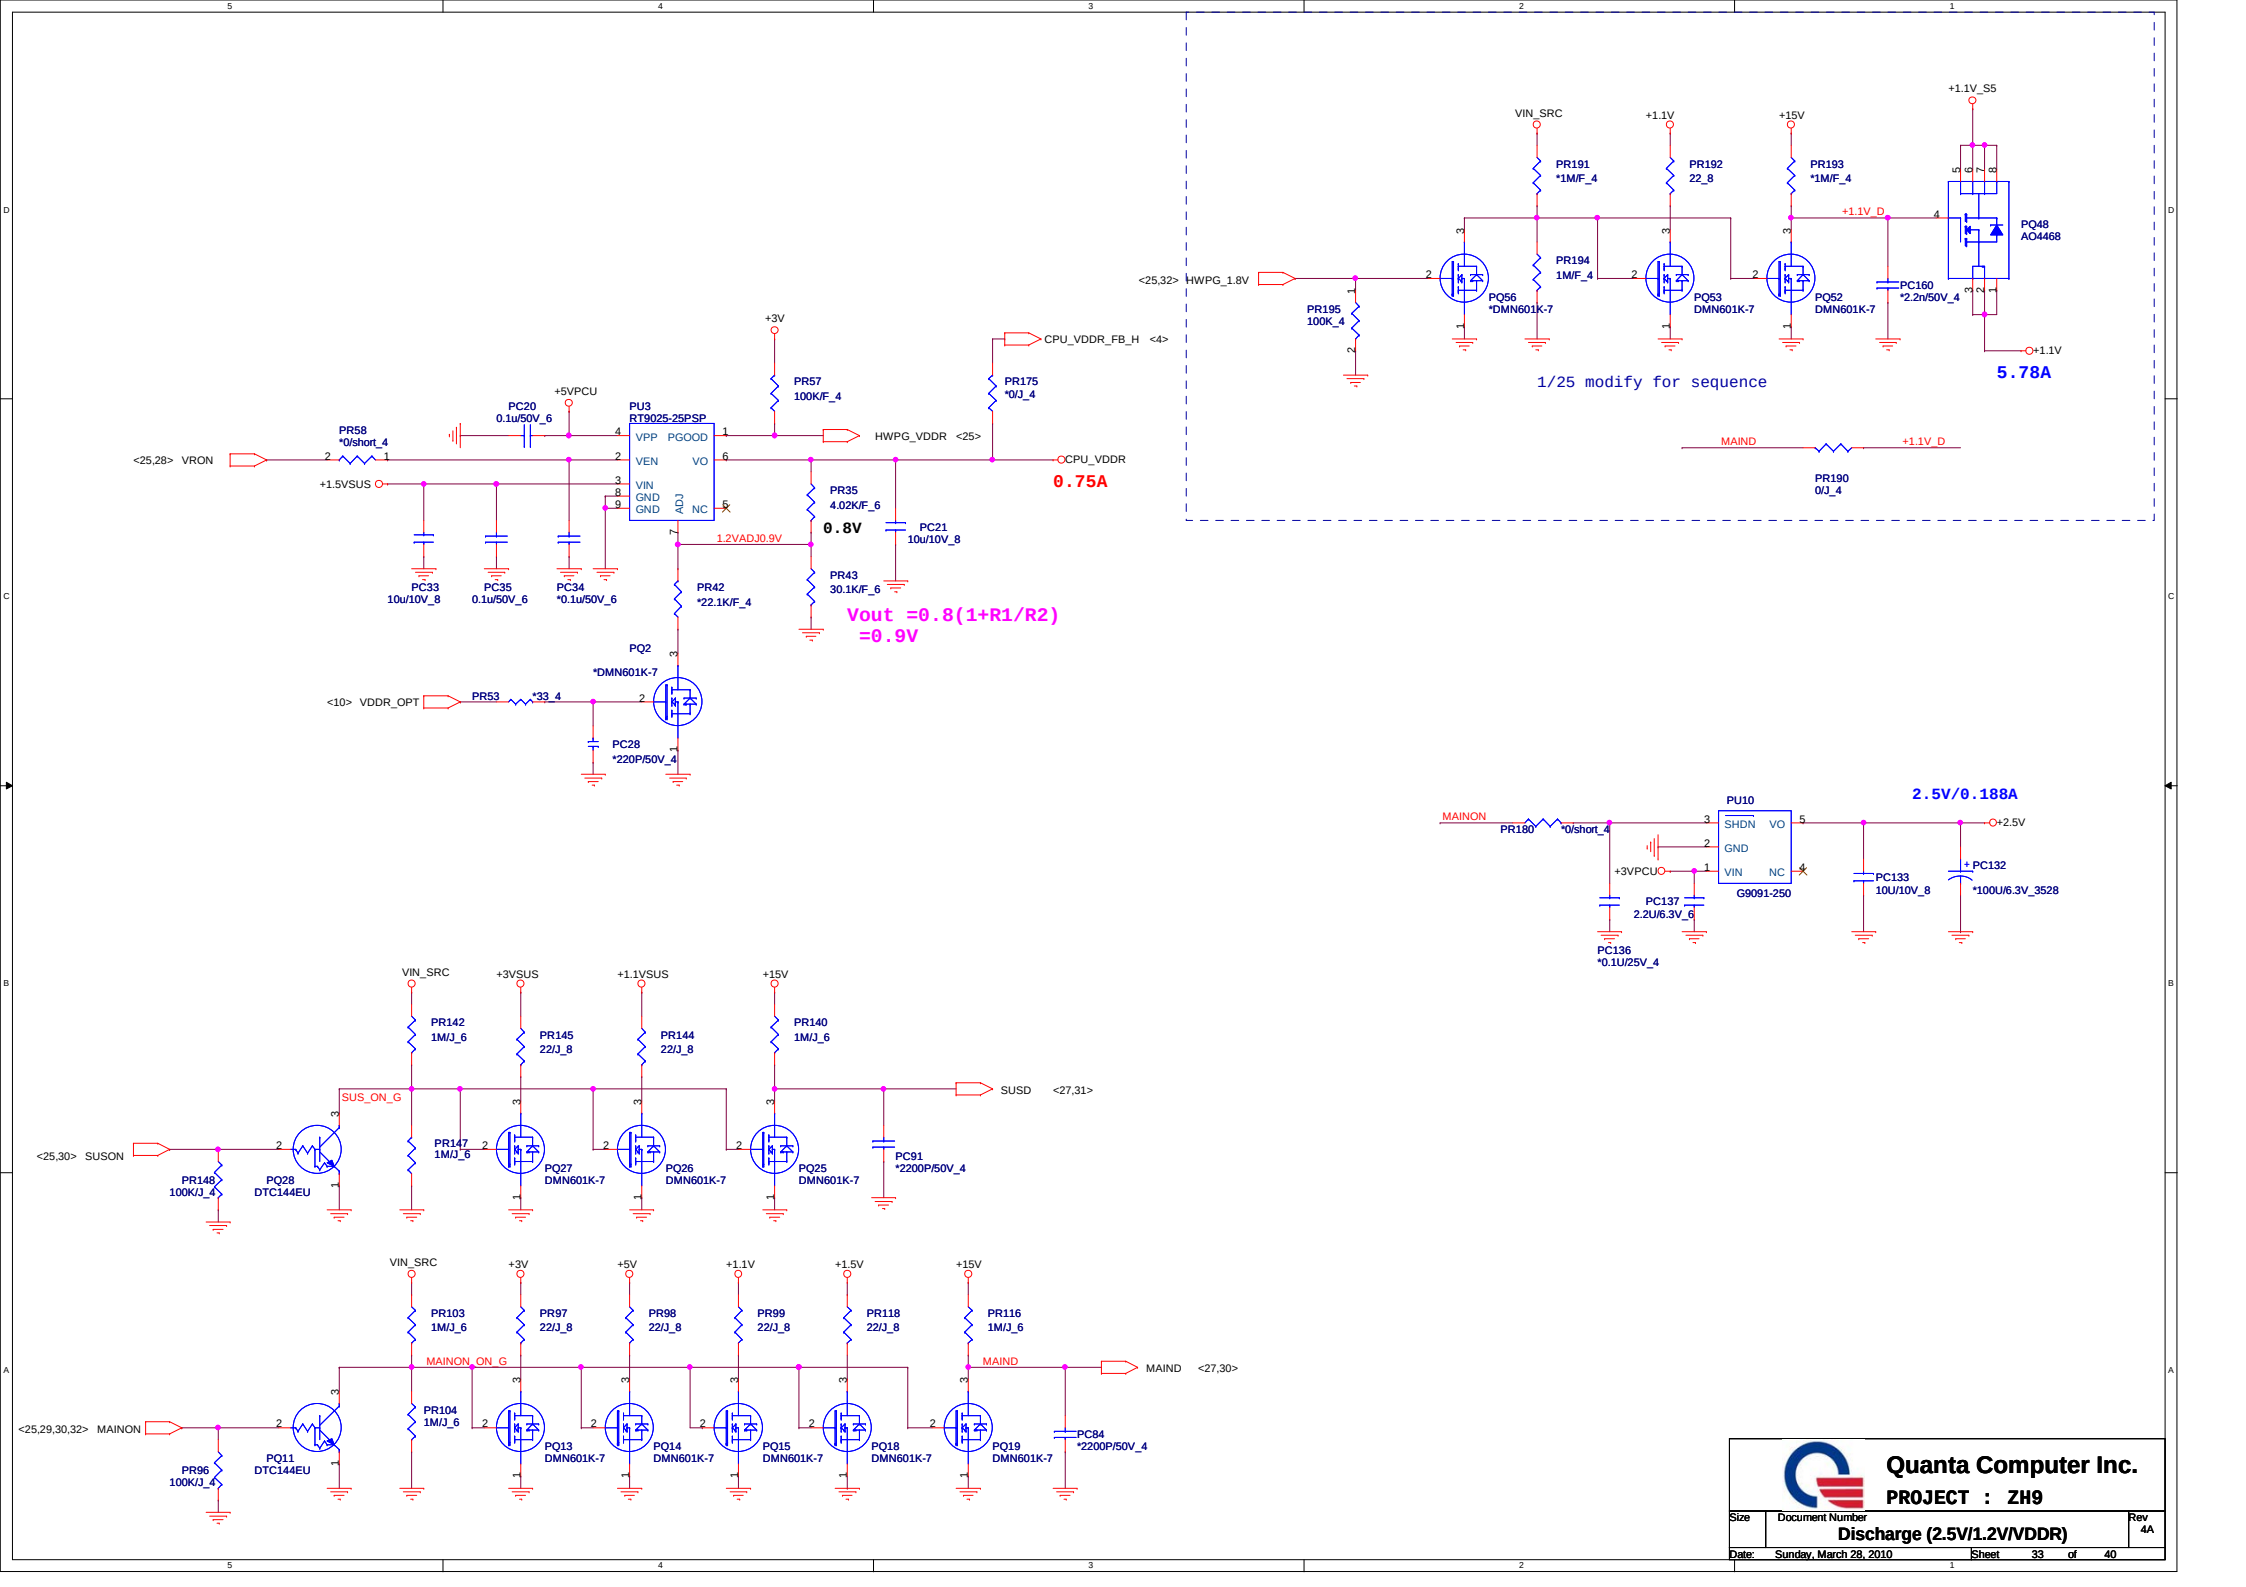
+3V
PR57
100K/F_4
CPU_VDDR_FB_H <4>
PR175
*0/J_4
+5VPCU
PC20
0.1u/50V_6
PU3
RT9025-25PSP
VPP PGOOD
VEN VO
VIN
GND
GND ADJ NC
HWPG_VDDR <25>
PR58
*0/short_4
<25,28> VRON
CPU_VDDR
0.75A
+1.5VSUS
PR35
4.02K/F_6
0.8V
PC21
10u/10V_8
1.2VADJ0.9V
PR43
30.1K/F_6
PC33
10u/10V_8
PC35
0.1u/50V_6
PC34
*0.1u/50V_6
PR42
*22.1K/F_4
Vout =0.8(1+R1/R2)
=0.9V
PQ2
*DMN601K-7
<10> VDDR_OPT
PR53
*33_4
PC28
*220P/50V_4
VIN_SRC
+1.1V
+15V
PR191
*1M/F_4
PR192
22_8
PR193
*1M/F_4
+1.1V_S5
+1.1V_D
PQ48
AO4468
<25,32> HWPG_1.8V
PR194
1M/F_4
PR195
100K_4
PQ56
*DMN601K-7
PQ53
DMN601K-7
PQ52
DMN601K-7
PC160
*2.2n/50V_4
+1.1V
1/25 modify for sequence
5.78A
MAIND
+1.1V_D
PR190
0/J_4
MAINON
PR180
*0/short_4
PU10
SHDN VO
GND
VIN NC
G9091-250
+3VPCU
2.5V/0.188A
+2.5V
PC133
10U/10V_8
PC132
*100U/6.3V_3528
PC137
2.2U/6.3V_6
PC136
*0.1U/25V_4
VIN_SRC
+3VSUS
+1.1VSUS
+15V
PR142
1M/J_6
PR145
22/J_8
PR144
22/J_8
PR140
1M/J_6
SUS_ON_G
SUSD <27,31>
<25,30> SUSON
PR148
100K/J_4
PQ28
DTC144EU
PR147
1M/J_6
PQ27
DMN601K-7
PQ26
DMN601K-7
PQ25
DMN601K-7
PC91
*2200P/50V_4
VIN_SRC
+3V
+5V
+1.1V
+1.5V
+15V
PR103
1M/J_6
PR97
22/J_8
PR98
22/J_8
PR99
22/J_8
PR118
22/J_8
PR116
1M/J_6
MAINON_ON_G
MAIND
MAIND <27,30>
<25,29,30,32> MAINON
PR104
1M/J_6
PR96
100K/J_4
PQ11
DTC144EU
PQ13
DMN601K-7
PQ14
DMN601K-7
PQ15
DMN601K-7
PQ18
DMN601K-7
PQ19
DMN601K-7
PC84
*2200P/50V_4
Quanta Computer Inc.
PROJECT : ZH9
Size
Document Number
Discharge (2.5V/1.2V/VDDR)
Rev
4A
Date: Sunday, March 28, 2010
Sheet 33 of 40

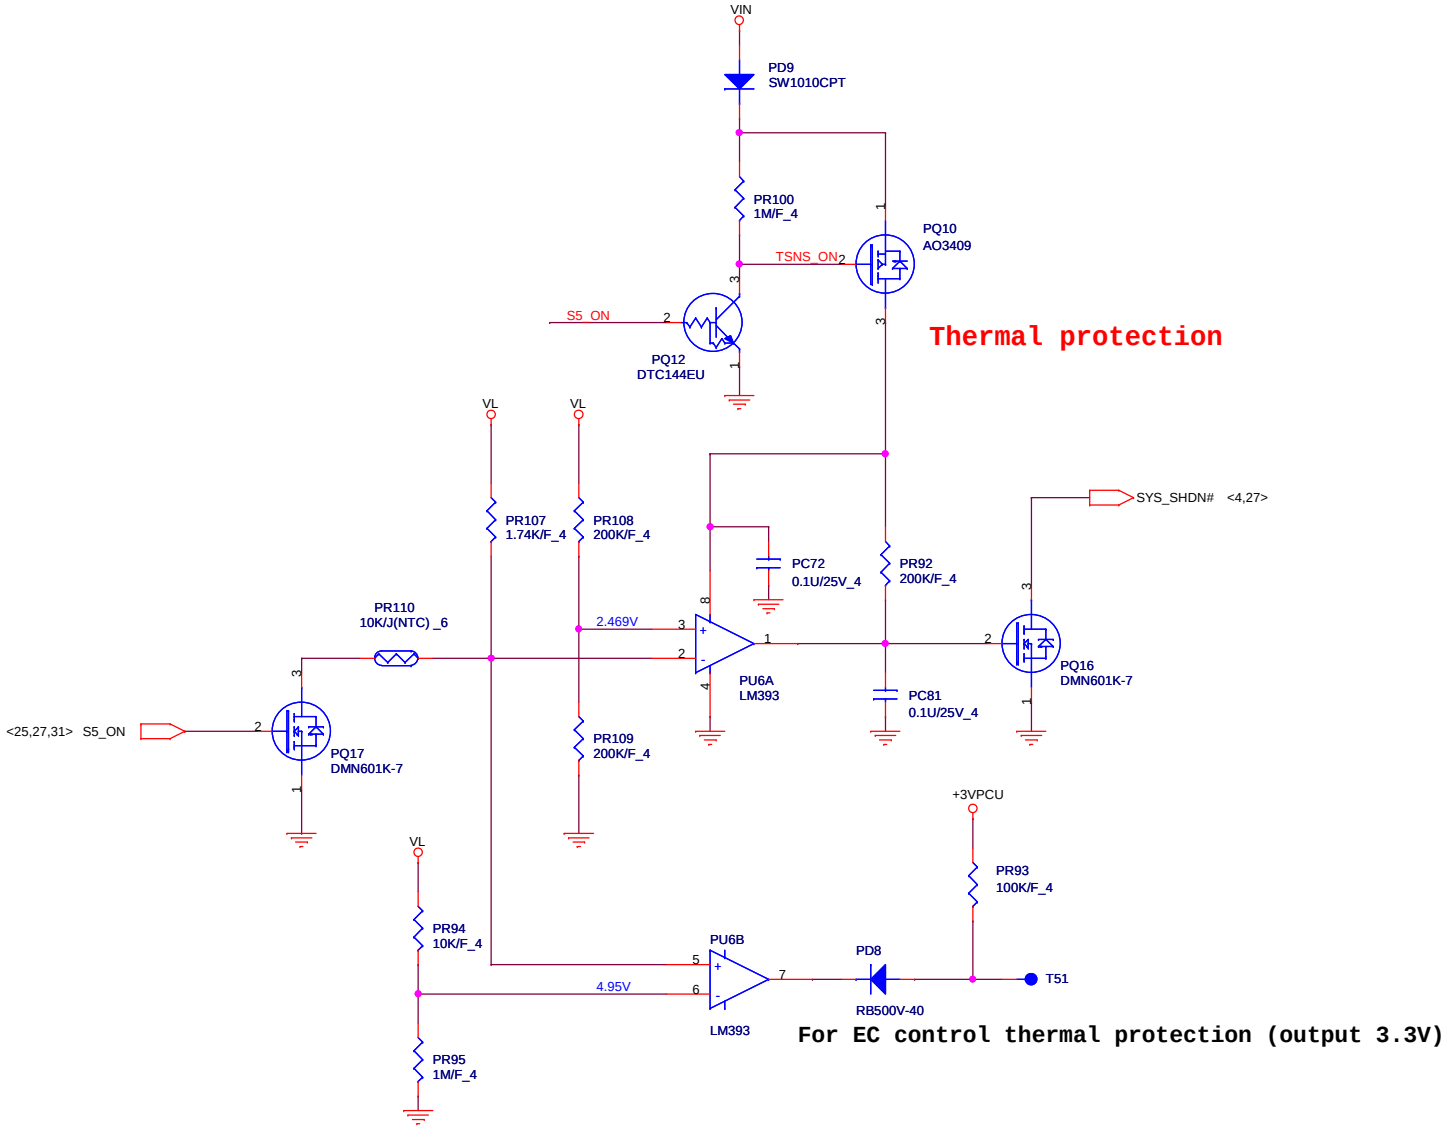

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	Thermal protect	4A
Date: Sunday, March 28, 2010	Sheet 34 of 40	

INTERNAL CLOCK MODE

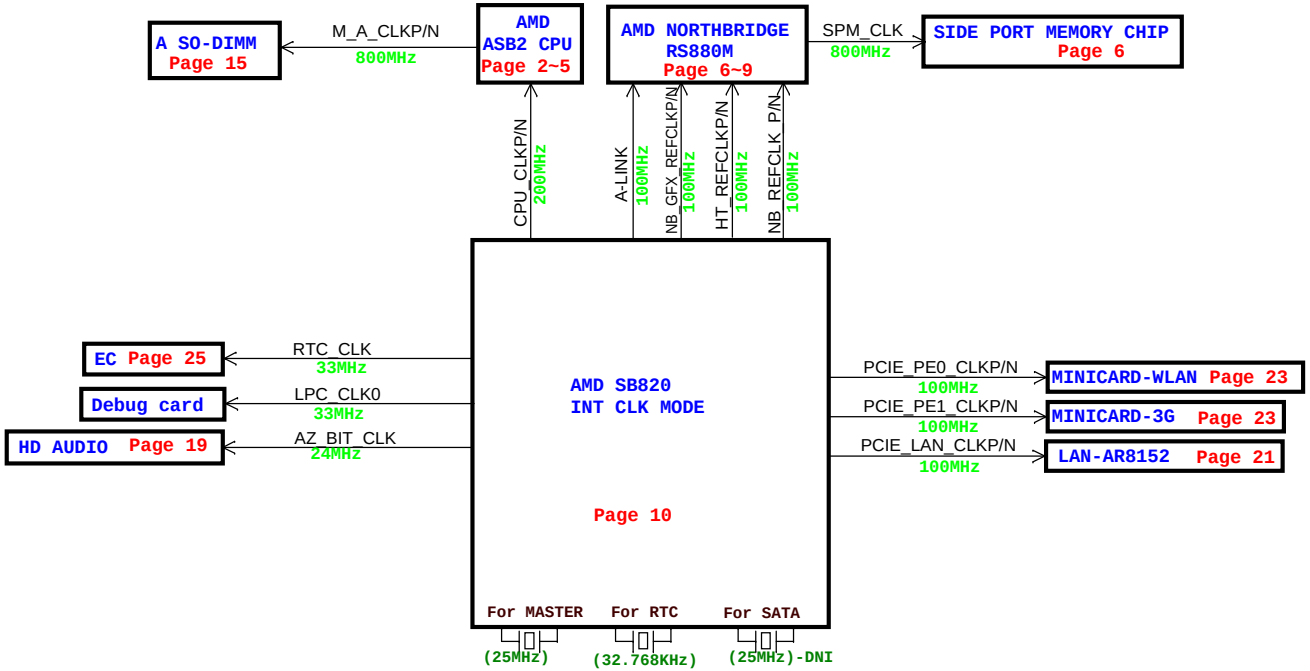

Quanta Computer Inc.

PROJECT : ZH9

Size	Document Number	Rev
	Clock Distribution Diagram	4A

Date: Sunday, March 28, 2010 Sheet 35 of 40

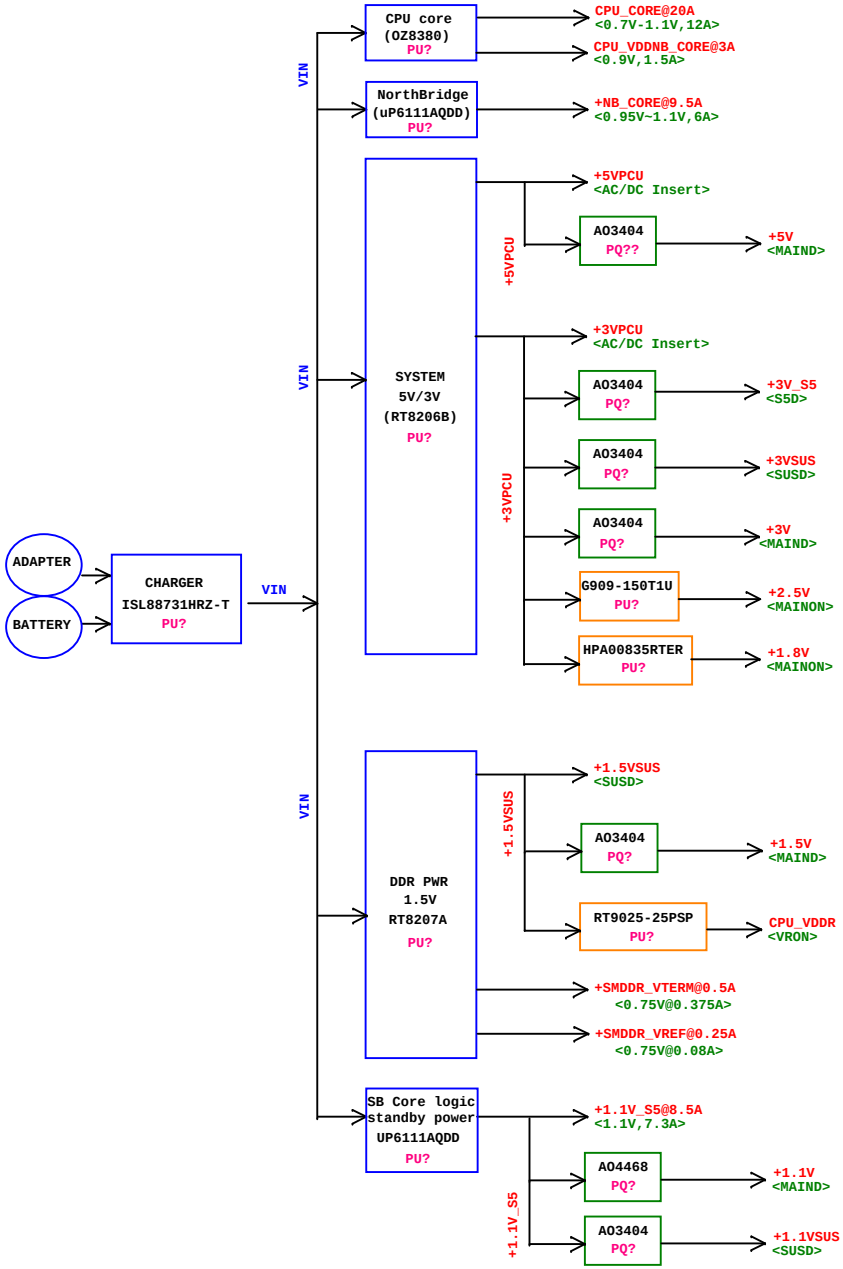

POWER	Distribution
VIN	LCD Backlight, CPU_CORE,NB_CORE, +5VPCU, +3VPCU, +1.5VSUS, +1.1V_S5
CPU_CORE	CPU
CPU_VDDNB_CORE	power supply for on-die NorthBridge
NB_CORE	NorthBridge power supply
+5VPCU	USB Connecter
+5V	CRT,Touch Pad ,Audio codec,SATA
+1.8V	NB & SB power supply
+3VPCU	RTC, Hall Sensor, System LED, EC, BIOS, Acer ID EEPROM, +3V_S5, +3VSUS, +3V
+3V_S5	SouthBridge,LAN , LAN EEPROM , RJ45 LED
+3VSUS	3G
+3V	CLK_GEN, CPU, NB,SB, LCD power switch,CCD, DMIC, BT, System LED, Codec, WLAN/Wimax, Card reader, EC
+2.5V	CPU,Discharge
+1.5VSUS	CPU,DDR,Discharge
+1.5V	CPU,DDR,NB
+SMDDR_VTERM	DDR
+SMDDR_VREF	CPU, DDR
+1.1V_S5	NorthBridge,Discharge
+1.1VSUS	Southbridge
+1.1V	CLK_GEN,CPU,NB,SB
CPU_VDDR	CPU

BOM Structure	
Fun.	Description
SPM@	w/ Sideport RAM
3G@	w/ 3G module
BT@	w/ BT module
HDM@	w/ HDMI
BOM@	BOM Control

BOM@		
Function		Description
CPU	CPU V105	U16: AJ00105VT00
	CPU K125	U16: AJ0K125VT02
	CPU K325	U16: AJ0K325VT02
	CPU K625	U16: AJ0K625VT03
w/ Sideport	w/ Sideport	L45,L46: Stuff(CX8PG221003) R142: Non-stuff C214: Stuff(CH4102K1B03) C416: Stuff(CH5102K9B06) Check U7,R295,R296,R283,R284
	w/ SAM Sideport	U7: AKD5LGGT506 ; R295,R284: Stuff ; R296,R283: Non-stuff
	w/ Hynix Sideport	U7: AKD5LZGTW04 ; R295,R283: Stuff ; R296,R284: Non-stuff
	w/ ATI Sideport	U7: AKD5LGGT700 ; R296,R284: Stuff ; R295,R283: Non-stuff
w/o Sideport	w/o Sideport	L45,L46: CS00003J951(0ohm) R142: Stuff(CS23002JB13) C214,C416: CS00002JB38(0ohm) U7,R295,R296,R283,R284: Non-stuff

Quanta Computer Inc.
PROJECT : ZH9
Size: Document Number: Power Tree Rev: 4A
Date: Sunday, March 28, 2010 Sheet 36 of 40

Nile Power On Sequence

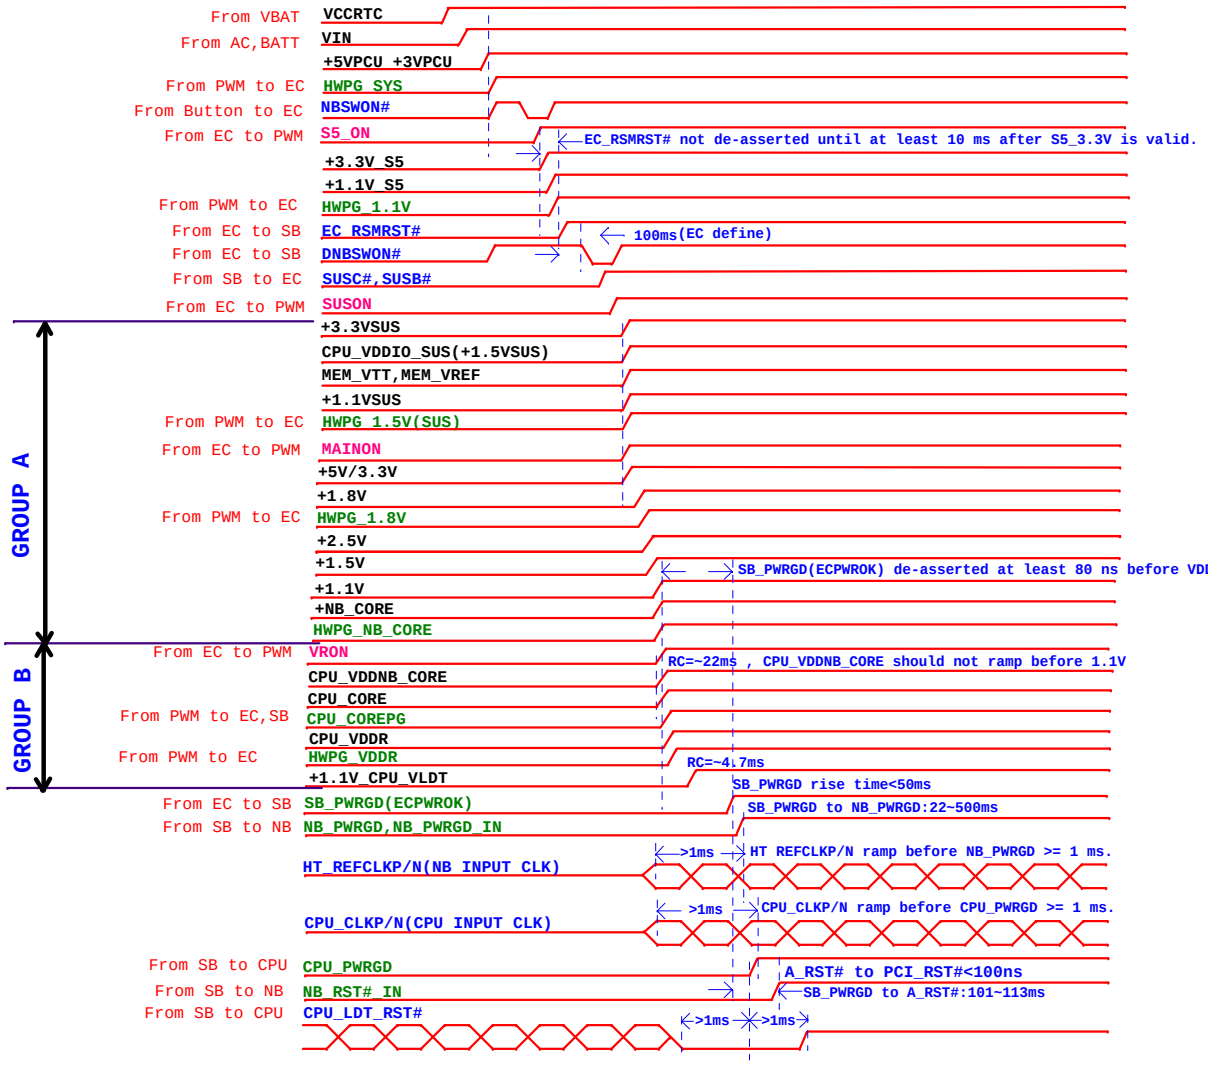

Power on sequence required:

SB820:
1. EC_RSMRST# ramp up time (10% to 90%) <= 50 ms
2. SB_PWRGD(ECPWROK) rise time <= 50 ms
3. SB_PWRGD(ECPWROK) fail time <= 1 ms
4. SB_PWRGD(ECPWROK) de-asserted at least 1 ns before EC_RSMRST# is asserted when entering G3 state.
5. VBAT will be valid at least 5 seconds before S5_3.3V and S5_1.1V are ramped up to allow start time for internal RTC.
6. 50us<=all power rails rise time except +3.3V_S5<=40ms
7. 100us<=+3.3V_S5 rise time<=40ms
8. +1.8V_S0 rails cannot ramp before the +3.3V_S0 rails.
9. +1.1V_S0 rails cannot ramp before the +1.8V_S0 rails.
10. +1.1V_S0 rails cannot ramp before the +3.3V_S0 rails.
11. +1.1V_S5 rails cannot ramp before the +3.3V_S5 rails.
12. +3V_S5 ramp down time > 300 µs.

RS880:
1. +1.1V valid before NB_PWRGD HIGH >= 1 ms
2. +1.8V_NB_IOPLLVDD18c(+1.8V) cannot ramp before the 3.3-V rails
3. +1.5V_SPM_VDDQ(+1.5V)cannot ramp before the 3.3-V rails
4. +1.8V_NB_VDDLTP18(+1.8V)cannot ramp before the 3.3-V rails
5. +1.8V_NB_PLLVDD18(1.8V)cannot ramp before the 3.3-V rails
6. 3.3-V rails cannot exceed the 1.8/1.5-V Sideport or 1.8-V Display and PLL rails by > 2.1 V.
7. IOPLLVDD/PLLVDD(+1.1V) cannot ramp up before the 1.8/1.5-V Sideport or 1.8-V Display and PLL rails.
8. VDDC(+NB_CORE) rail cannot ramp before the 1.1-V PLL rails.

Notice:
1. CPU_LDT_RST# msut be asserted a minimum of 1ms prior to the assertion of CPU_PWRGD
2. CPU_CLKP/N must be within specification a minimum of 1ms prior to the assertion of CPU_PWRGD
3. CPU_PWRGD remains deasserted at least 1ms after both CPU_CLKP/N and all voltages to the processor are within specification for operation
4. all NB power rails(1.8V/1.2V/1.1V) valid before NB_PWRGD at least 1ms
5. stable input clocks from CLKGEN(HT_REFCLKP/N) to NB before NB_PWRGD at least 1ms

SB SMBUS Table

	CLK GEN	RAM	Mini Card (WLAN)
(SB_DA0)/(SB_CL0) (+3V)	V	V	V
Power Plane	+3V	+3V	+3V
MOS CKT (Level shift)	X	X	X*

*Reserve: There is not SMBUS function in AVL

EC SMBUS Table

	Battery	CPU thermal Sensor
EC775 SDA1 / SCL1 (+3VPCU)	V	
EC775 SDA2 / SCL2 (+3V)		V
EC775 SDA3 / SCL3 ()		
Power Plane	+3VPCU	+3V
MOS CKT (Level shift)	X	X

Quanta Computer Inc.
PROJECT : ZH9
Size | Document Number | Rev 4A
POWER SEQUENCE
Date: Sunday, March 28, 2010 | Sheet 37 of 40

SLP_S3#(SUSB#):
S3 Sleep Power plane control Assertion of SLP_S3# shuts off power to non-critical components when system transitions to S3, S4, or S5 states.

SLP_S5#(SUSC#):
S5 Sleep Power plane control - Assertion of SLP_S5# shuts power off to non-critical components when system transitions to S4 or S5 state.

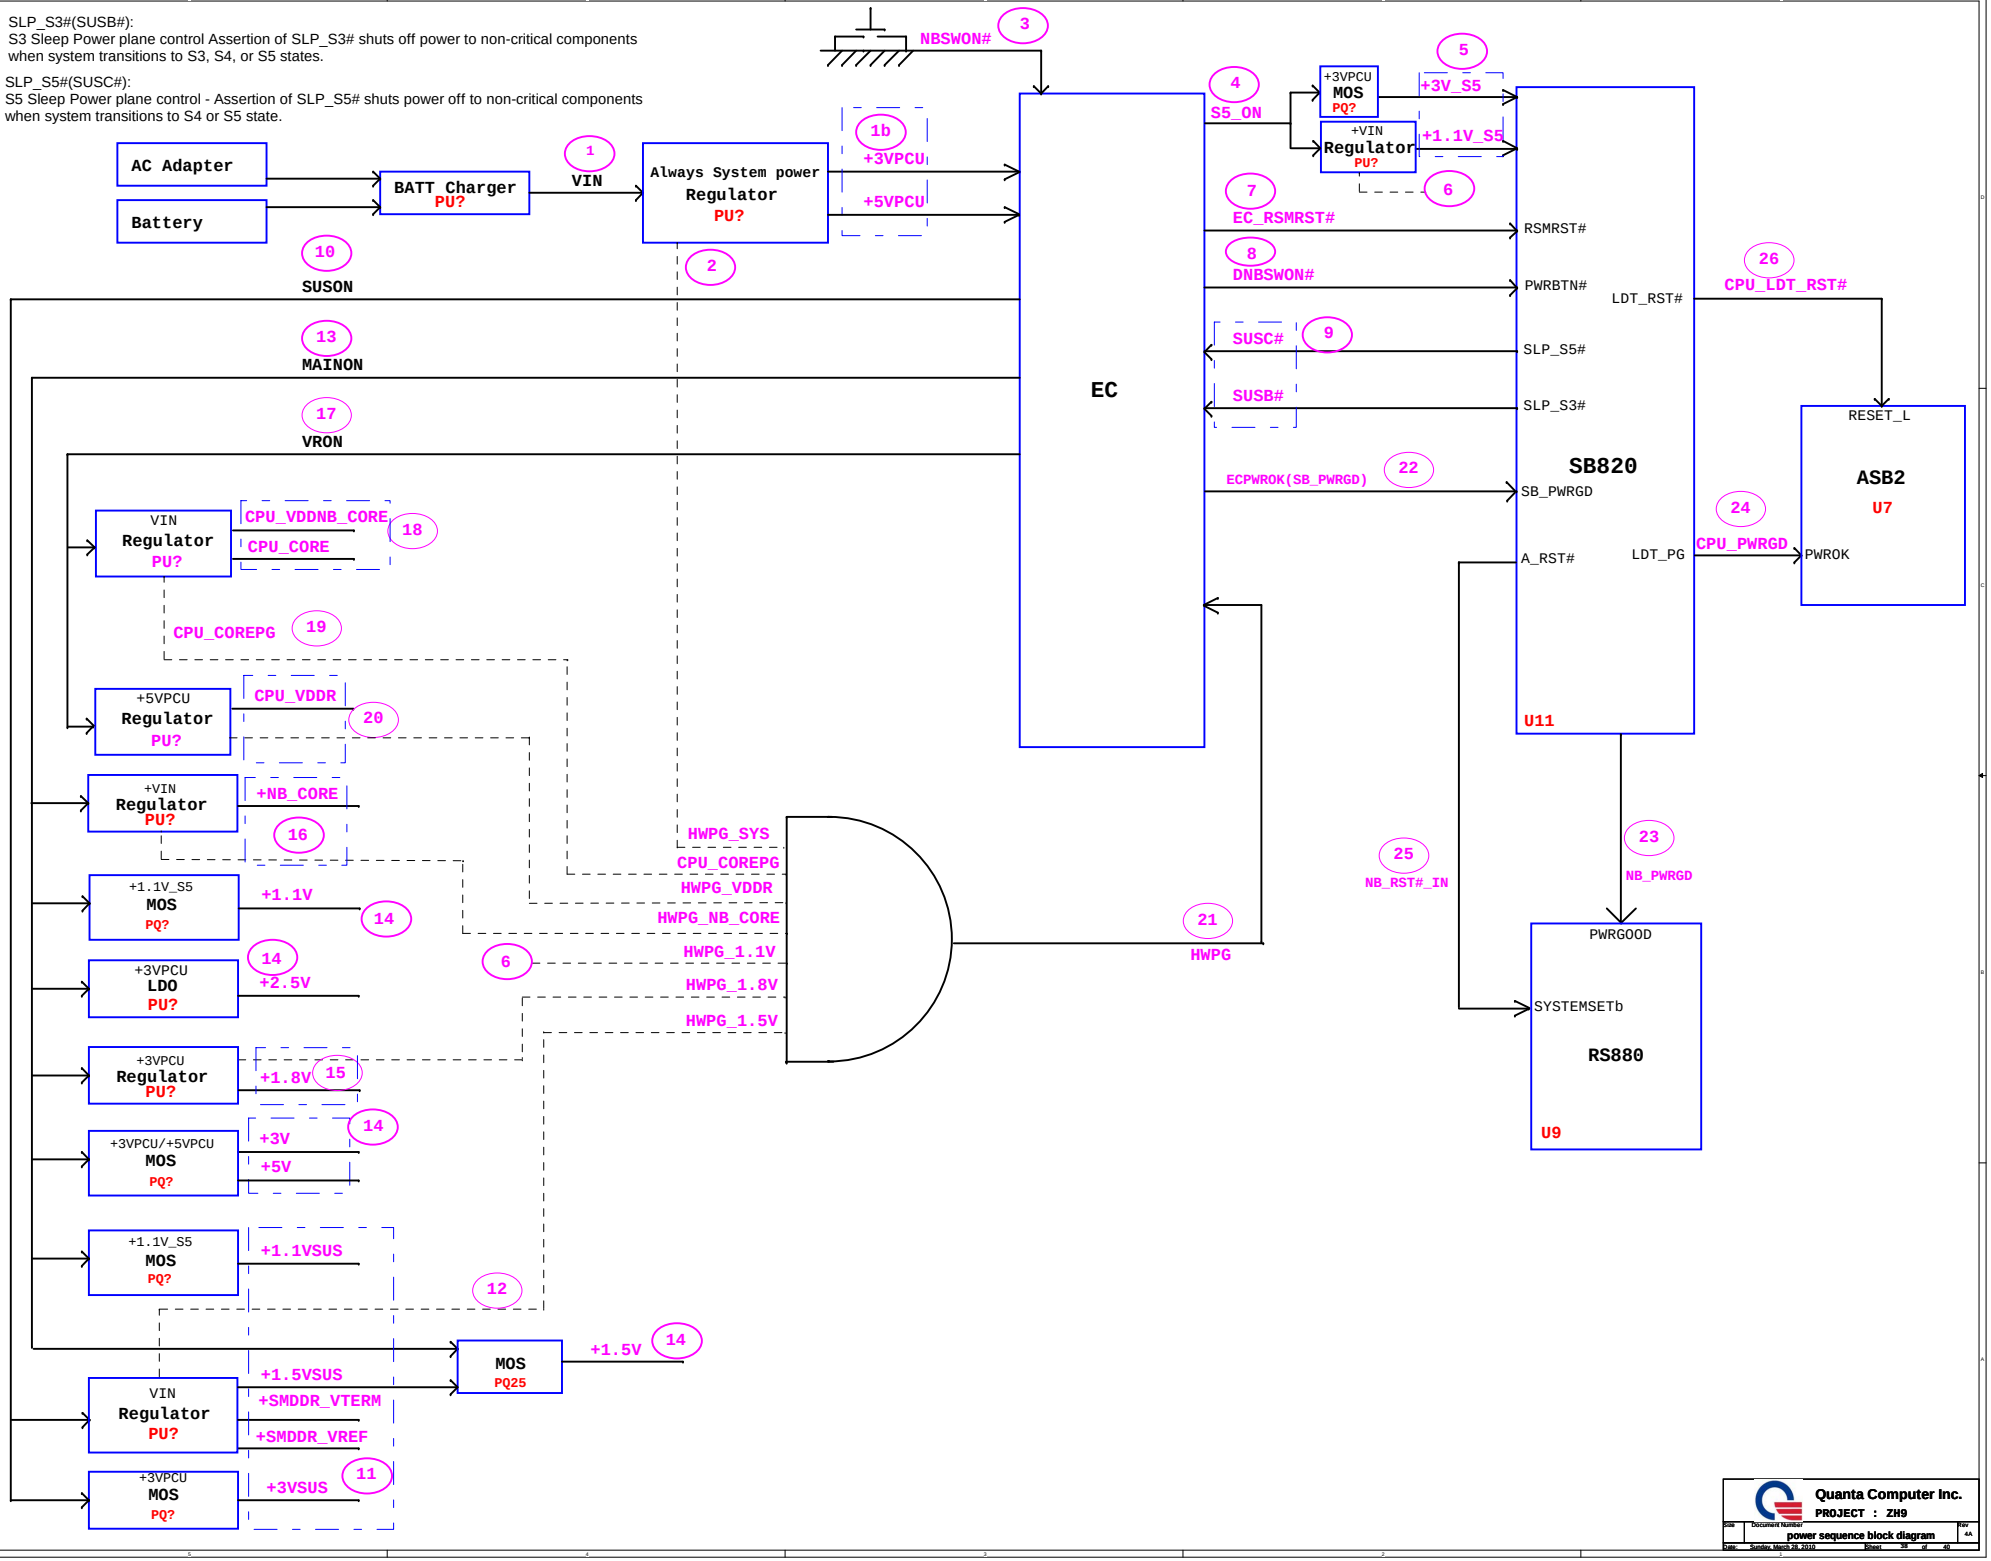

Quanta Computer Inc.
PROJECT : ZH9
power sequence block diagram