ELITEGROUP COMPUTER SYSTEMS

Project Name : F50IXX

Platform : Montevina Penryn(CPU)+Cantiga(NB)+ICH9M(SB)+NB9P/M

PAGE CONTENT

Schematic Version Change History

Release Date	Version	PCB P/N	PCBA P/N	Note
2007/10/19	Rev.A	37GF50000-A0	82GF50000-A0	Initial
2007/12/21	Rev.B	37GF50000-B0	82GF50000-B0	UPDATE
2008/3/7	Rev.C	37GF50000-C0	82GF50000-C0	UPDATE

Component Identify Color By Project

- F50II0 only
- F50IN0 only
- F50IN5 only
- F50II0/F50IN5
- F50II0/IN0
- F50IN0/IN5
- Depend on project (check table)
- Reserved (verify at A phase)
- All project

SMT Process Identify Mark

* DIP component

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | INDEX | Rev: C

Date: Tuesday, April 22, 2008 | Sheet 1 of 50

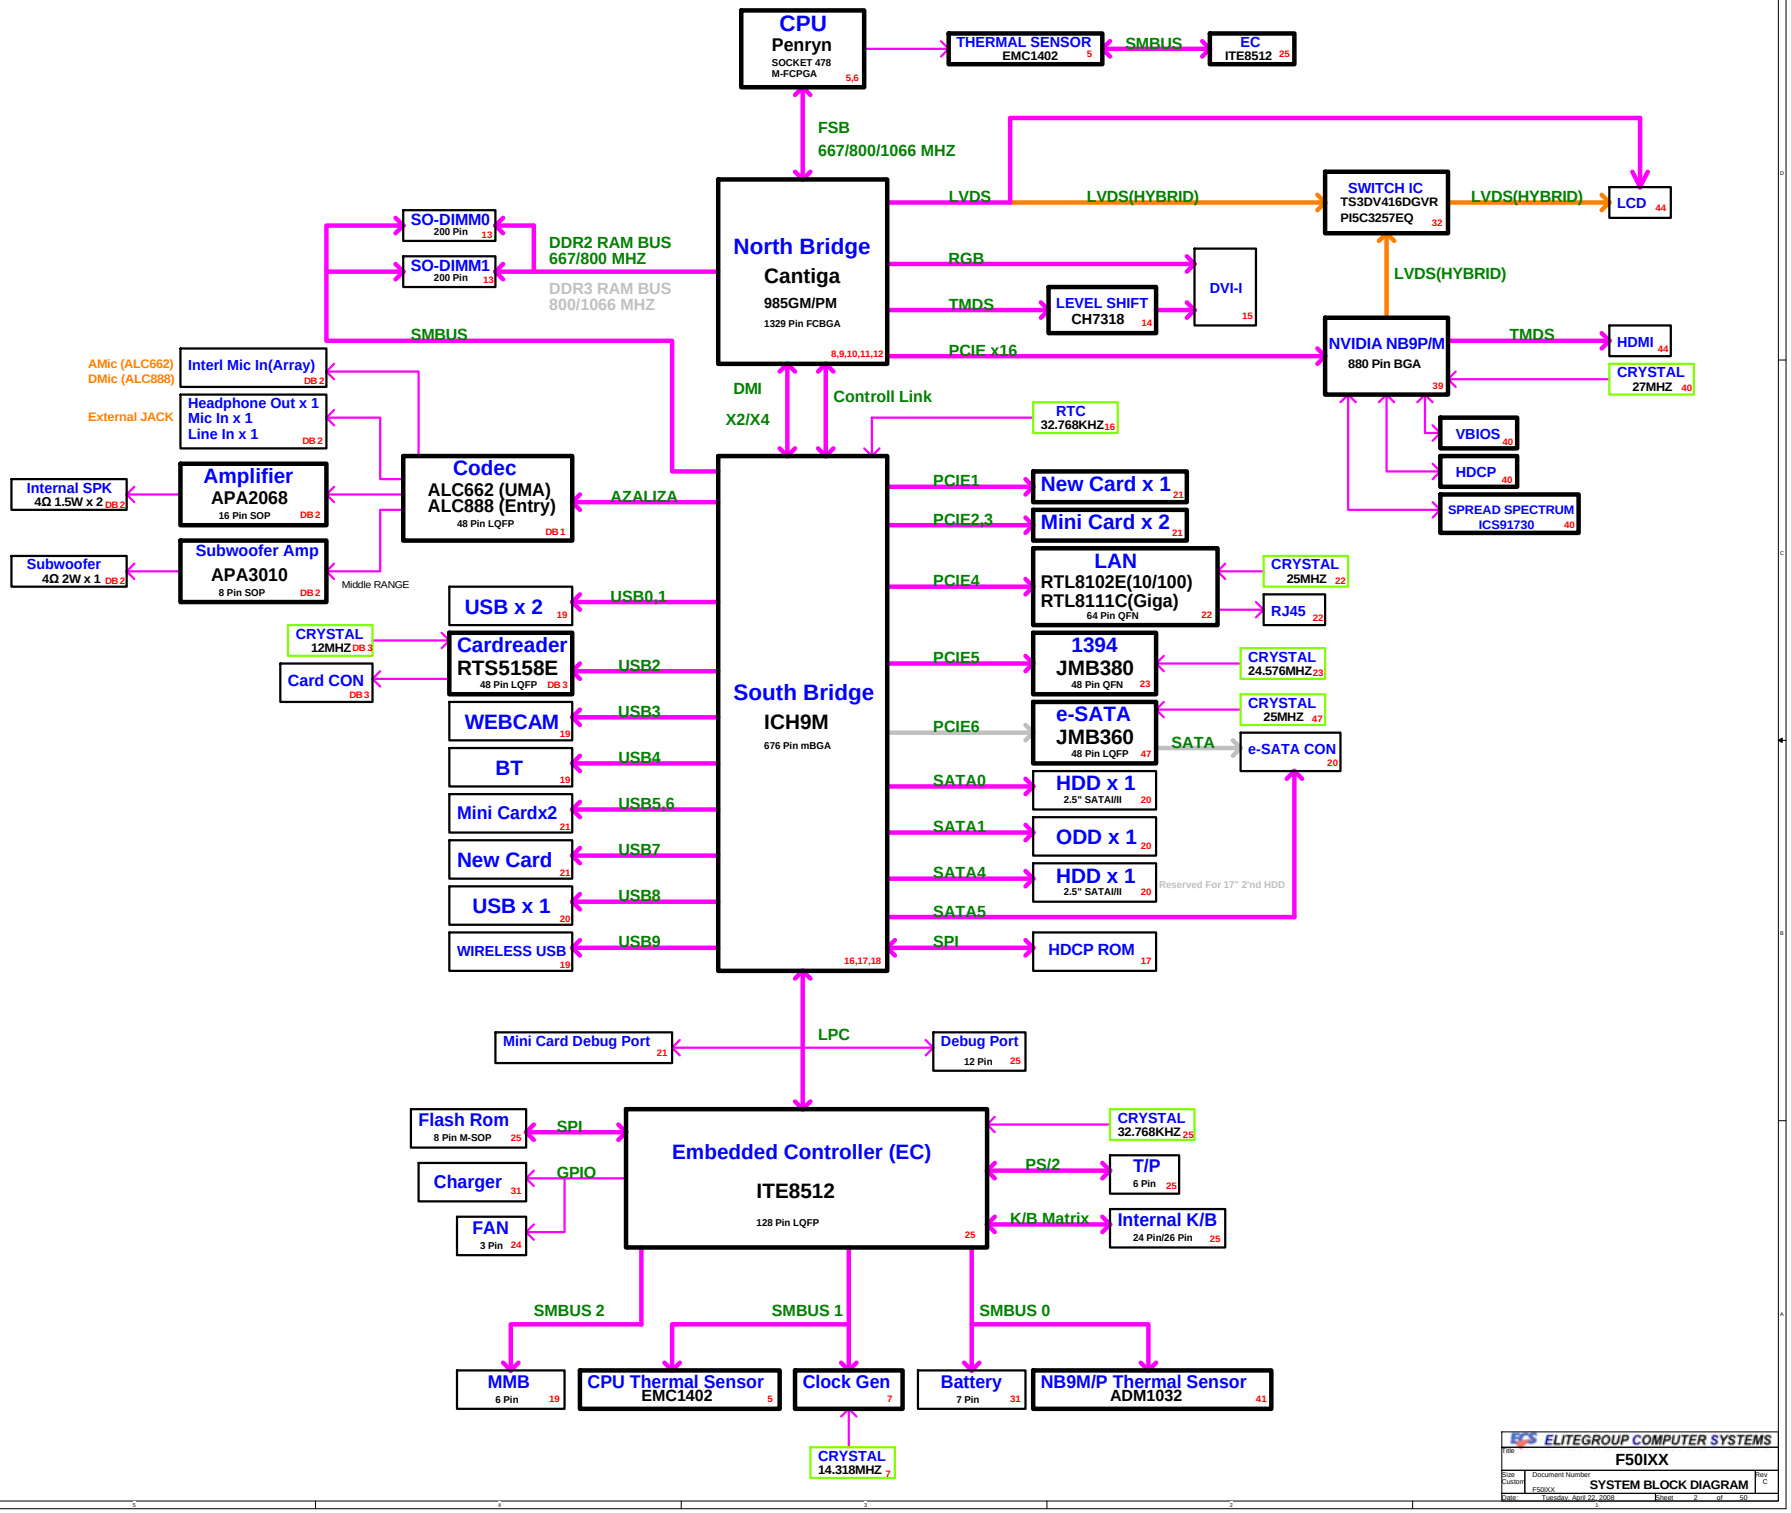
CPU
Penryn
SOCKET 478
M-FCPGA
5,6
THERMAL SENSOR
EMC1402
5
SMBUS
EC
ITE8512
25
FSB
667/800/1066 MHZ
North Bridge
Cantiga
985GM/PM
1329 Pin FCBGA
8,9,10,11,12
LVDS
LVDS(HYBRID)
SWITCH IC
TS3DV416DGVR
PI5C3257EQ
32
LVDS(HYBRID)
LCD
44
LVDS(HYBRID)
SO-DIMM0
200 Pin
13
SO-DIMM1
200 Pin
13
DDR2 RAM BUS
667/800 MHZ
DDR3 RAM BUS
800/1066 MHZ
RGB
DVI-I
15
TMDS
LEVEL SHIFT
CH7318
14
PCIE x16
NVIDIA NB9P/M
880 Pin BGA
39
TMDS
HDMI
44
CRYSTAL
27MHZ
40
SMBUS
AMic (ALC662)
DMic (ALC888)
Interl Mic In(Array)
DB 2
External JACK
Headphone Out x 1
Mic In x 1
Line In x 1
DB 2
DMI
X2/X4
Controll Link
RTC
32.768KHZ
16
VBIOS
40
HDCP
40
SPREAD SPECTRUM
ICS91730
40
Internal SPK
4Ω 1.5W x 2
DB 2
Amplifier
APA2068
16 Pin SOP
DB 2
Codec
ALC662 (UMA)
ALC888 (Entry)
48 Pin LQFP
DB 1
AZALIZA
Subwoofer
4Ω 2W x 1
DB 2
Subwoofer Amp
APA3010
8 Pin SOP
DB 2
Middle RANGE
PCIE1
New Card x 1
21
PCIE2,3
Mini Card x 2
21
PCIE4
LAN
RTL8102E(10/100)
RTL8111C(Giga)
64 Pin QFN
22
CRYSTAL
25MHZ
22
RJ45
22
USB x 2
19
USB0,1
CRYSTAL
12MHZ
DB 3
Cardreader
RTS5158E
48 Pin LQFP
DB 3
USB2
Card CON
DB 3
PCIE5
1394
JMB380
48 Pin QFN
23
CRYSTAL
24.576MHZ
23
WEBCAM
19
USB3
South Bridge
ICH9M
676 Pin mBGA
PCIE6
e-SATA
JMB360
48 Pin LQFP
47
CRYSTAL
25MHZ
47
SATA
e-SATA CON
20
BT
19
USB4
SATA0
HDD x 1
2.5" SATAII
20
Mini Cardx2
21
USB5,6
SATA1
ODD x 1
20
New Card
21
USB7
SATA4
HDD x 1
2.5" SATAII
20
Reserved For 17" 2'nd HDD
USB x 1
20
USB8
SATA5
WIRELESS USB
19
USB9
SPI
HDCP ROM
17
16,17,18
LPC
Mini Card Debug Port
21
Debug Port
12 Pin
25
Flash Rom
8 Pin M-SOP
25
SPI
Embedded Controller (EC)
ITE8512
128 Pin LQFP
25
CRYSTAL
32.768KHZ
25
Charger
31
GPIO
PS/2
T/P
6 Pin
25
FAN
3 Pin
24
K/B Matrix
Internal K/B
24 Pin/26 Pin
25
SMBUS 2
SMBUS 1
SMBUS 0
MMB
6 Pin
19
CPU Thermal Sensor
EMC1402
5
Clock Gen
7
Battery
7 Pin
31
NB9M/P Thermal Sensor
ADM1032
41
CRYSTAL
14.318MHZ
7
ELITEGROUP COMPUTER SYSTEMS
F50IXX
SYSTEM BLOCK DIAGRAM
Size
Custom
Document Number
F50IXX
Rev
C
Date:
Tuesday, April 22, 2008
Sheet
2
of
50

POWER BLOCK DIAGRAM

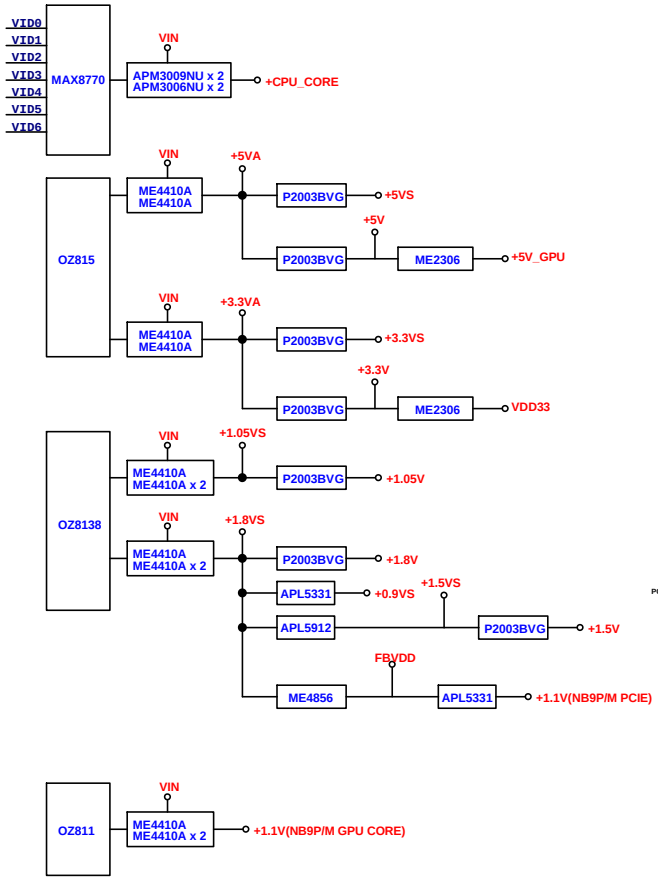

System Poewr On Sequence (spec)

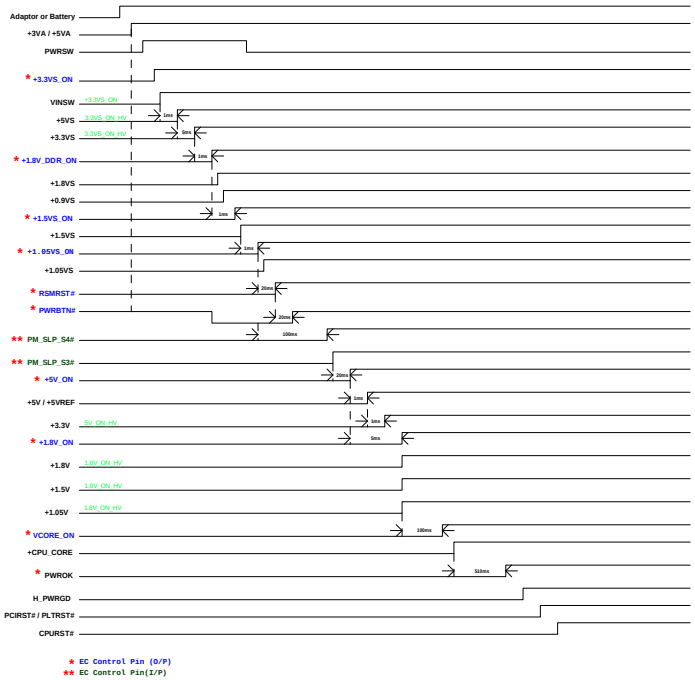

F50IN0 Power On Sequence B phase(real)

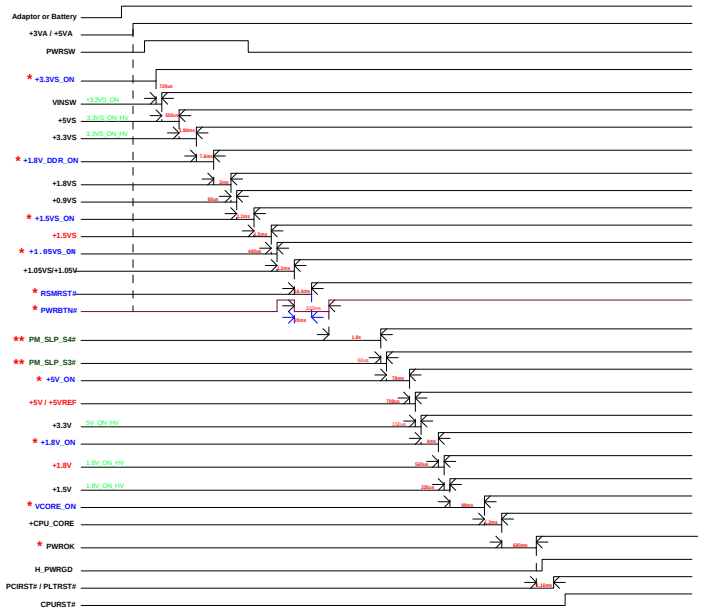

NB9P/M Poewr ON/OFF Sequence

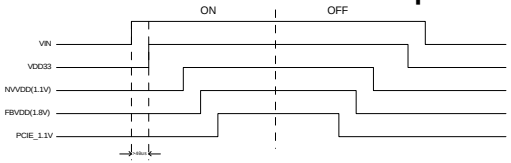

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX		
Size	Document Number	POWER DIAGRAM & SEQUENCE	Rev C
Date	Tuesday, April 07, 2009	Sheet	of

ICH9M GPIO	
GPIO0	PM_BM_BUSY#
GPIO1	EC_EXTSMI#
GPIO2	INT_PIRQE#
GPIO3	INT_PIRQF#
GPIO4	INT_PIRQG#
GPIO5	INT_PIRQH#
GPIO6	BIOS_REC
GPIO7	***N.C***(TACH3)
GPIO8	***N.C***
GPIO9	***N.C***(WOL_EN)
GPIO10	***N.C***(ALERT#)
GPIO11	SMB_ALERT#
GPIO12	LAN_PHYPC
GPIO13	***N.C***(GLAN_DOCK#)
GPIO14	***N.C***(NETDETECT)
GPIO15	PM_STPPCI#
GPIO17	***N.C***(TACH0)
GPIO18	***N.C***
GPIO19	SATA1GP
GPIO21	SATA0GP
GPIO22	***N.C***(SCLOCK)
GPIO23	LDRQ1#
GPIO24	CRB_SV_DET
GPIO25	PM_STPCPU#
GPIO26	PM_SLP_S4_STATE#
GPIO27	QRT_STATE0
GPIO28	QRT_STATE1
GPIO29	USB_OC#5
GPIO30	USB_OC#6
GPIO31	USB_OC#7
GPIO32	PM_CLKRUN#
GPIO33	HDA_DOCK_EN
GPIO34	***N.C***(HDA_DOCK_RST)
GPIO35	CLK_SATA_OE#
GPIO36	SATA2GP
GPIO37	SATA3GP
GPIO38	ODD_DET
GPIO39	ICH_GPIO39
GPIO40	USB_OC#1
GPIO41	USB_OC#2
GPIO42	USB_OC#3
GPIO43	USB_OC#4
GPIO48	MFG_MODE
GPIO49	H_PWRGD
GPIO50	PCI_REQ#1
GPIO51	PCI_GNT#1
GPIO52	PCI_REQ#2
GPIO53	PCI_GNT#2
GPIO54	PCI_REQ#3
GPIO55	PCI_GNT#3

ITE8512E GPIO	
GPA0	PM_RSMRST#
GPA1	SUSPEND_LED
GPA2	SILENT_LED
GPA3	RF_LED
GPA4	CAPS_LED
GPA5	NUM_LED
GPA6	SCROLL/3G_LED
GPA7	EXTTS#0
GPB0	PM_SLP_S4#
GPB1	PM_SLP_S3#
GPB2	CMI_TX
GPB3	SMB_CLK0
GPB4	SMB_DAT0
GPB5	H_A20GATE
GPB6	H_RCIN#
GPB7	QRT_STATE
GPC0	CMI_RX
GPC1	SMB_CLK1
GPC2	SMB_DAT1
GPC3	KEY_OUT16
GPC4	RF_SW#
GPC5	KEY_OUT17
GPC6	BTL_BEEP
GPC7	SILENT#
GPD0	EC_PREST#
GPD1	PWRBTN#
GPD2	MUTE
GPD3	EC_EXTSMI#
GPD4	***N.C***
GPD5	SMP1_EN#
GPD6	CHG_ON
GPD7	LCDSW
GPE0	PWRSW
GPE1	SET_V
GPE2	PWROK
GPE3	BT_ON
GPE4	LID#
GPE5	CPPE#
GPE6	FAN_SPD#
GPE7	PCI_RST#
GPF0	EC_CPU_200MHz
GPF1	***N.C***
GPF2	CHG_G_LED
GPF3	CHG_R_LED
GPF4	TP_CLK
GPF5	TP_DATA
GPF6	***N.C***
GPF7	***N.C***
GPG0	SB_RTCRST
GPG1	EC_WDOG OK
GPG2	FLFRAME#
GPG6	MPWORK
GPH0	+1.8V_ON
GPH1	+1.8V_DDR_ON
GPH2	VCORE_ON
GPH3	+3.3VS_ON
GPH4	+5V_ON
GPH5	+1.05VS_ON
GPH6	+1.5VS_ON

ITE8512E GPIO	
GPI0	BATT_TEMP
GPI1	ADAPTOR_I
GPI2	ADAP_IN
GPI3	BAT_CHG_I
GPI4	BAT_I
GPI5	***CPU_PWR***
GPI6	DDR2_TEMP
GPI7	VGA_TEMP
GPJ0	EC_BRGHT
GPJ1	CHG_I
GPJ2	FAN_CTRL0
GPJ3	BROWSER#
GPJ4	MAIL#
GPJ5	PM_THROTTING#

Penryn CPU				
	CPU CORE(V)	ICC(A)	W	TEMP(℃)
IMVP-6+	1.25	44.0	46.2	

Cantiga			
VCC	ICC(mA)	W	TEMP(℃)
+3.3V	262	0.87	105
+1.8VS	3178	5.73	
+1.5V	86	0.129	
+1.05	14688.52	15.43	

ICH9M			
VCC	ICC(mA)	mW	TEMP(℃)
+5V	2	10	70
+5VS	2	10	
+3.3V	347	1145.1	
+3.3VS	212	699.6	
+1.5V	1988	2982	
+1.05V	1634	1715.7	

ITE8512E			
VCC	ICC(mA)	mW	TEMP(℃)
+3.3V	100	330	70

CLOCK GENERATOR ICS9LPR365			
VCC	ICC(mA)	mW	TEMP(℃)
+3.3V	250	825	70

ALC888			
VCC	ICC(mA)	mW	TEMP(℃)
+3.3V(DVDD)	40	132	70
+5V(AVDD)	51	255	

APA2068			
VCC	ICC(mA)	mW	TEMP(℃)
+5V	20	100	85

ADM1032			
VCC	ICC	mW	TEMP(℃)
+3.3V	170uA	0.56	150

RTL8111C			
VCC	ICC(mA)	mW	TEMP(℃)
+3.3VS	103	339.9	70
+1.8VS	198	356.4	
+1.5VS	367	550.5	

JMB360			
VCC	ICC(mA)	mW	TEMP(℃)
+3.3V	TBD		70
+1.8V	TBD		

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | GPIO & Power Consumption | Rev: C

Date: Tuesday, April 22, 2008 | Sheet 4 of 50

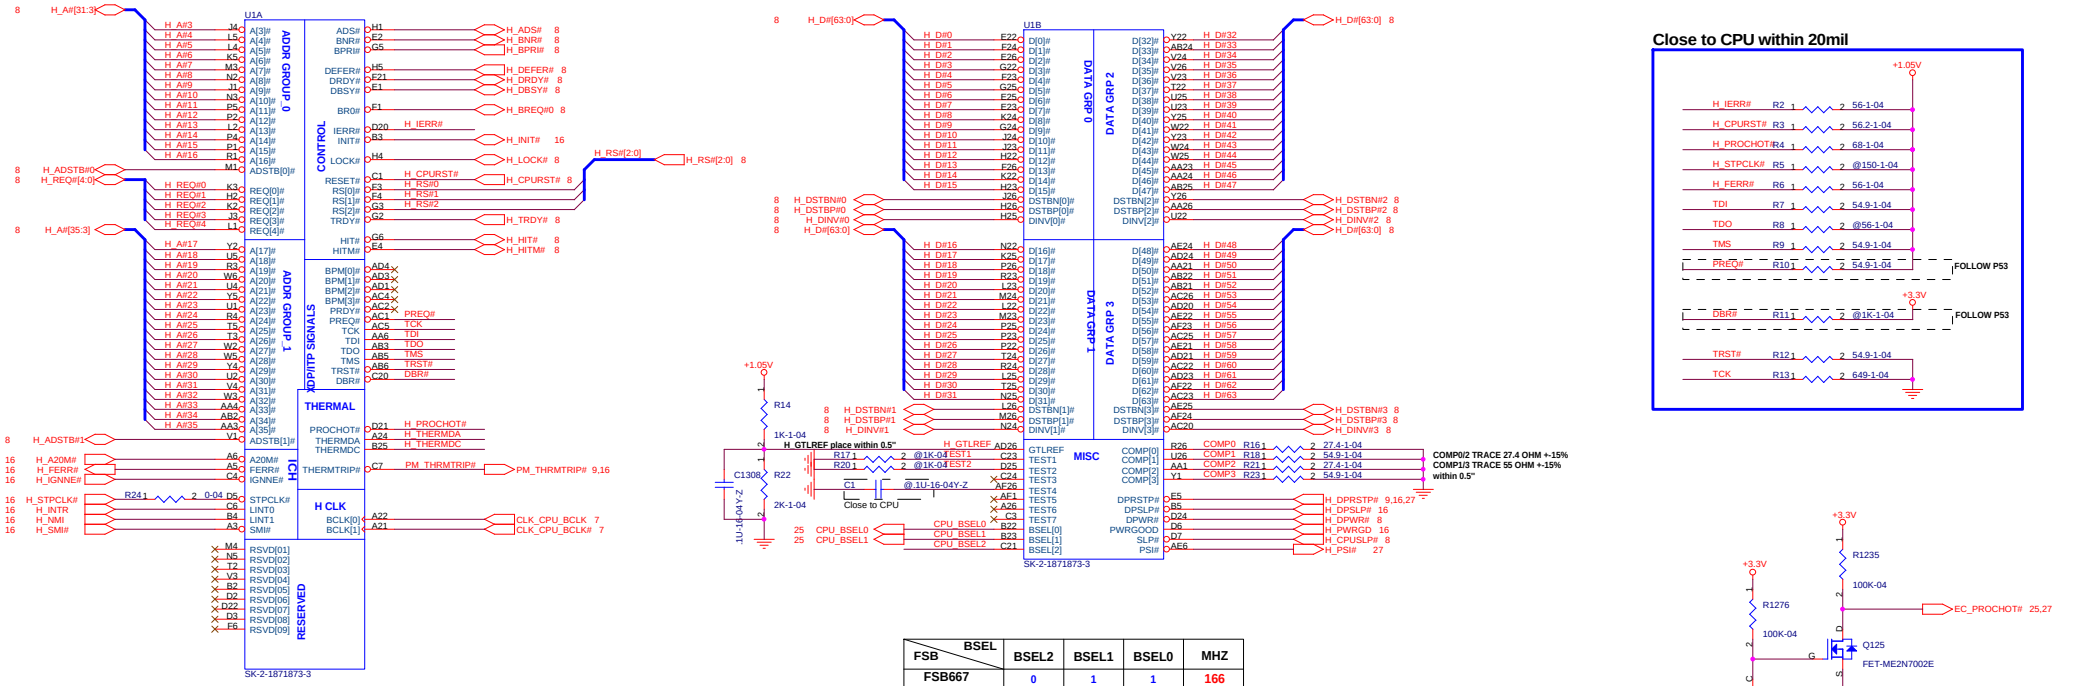

FSB \ BSEL	BSEL2	BSEL1	BSEL0	MHZ
FSB667	0	1	1	166
FSB800	0	1	0	200
FSB1066	0	0	0	266

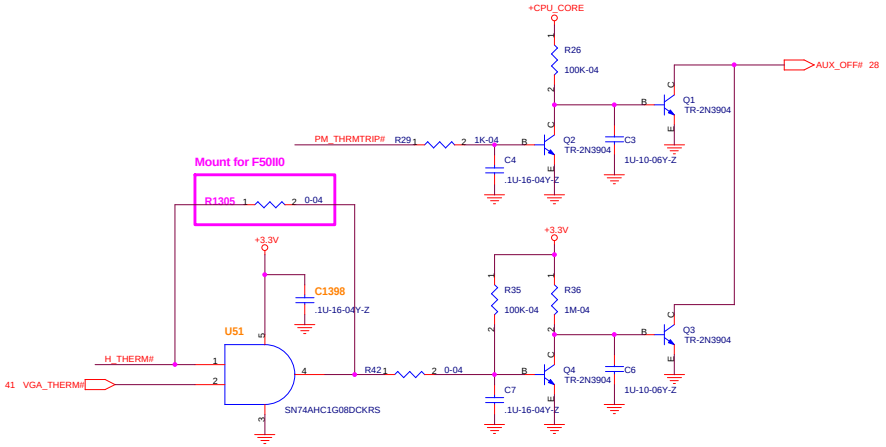

Input		Output
PIN1	PIN2	PIN4
H	H	H
L	X	L
X	L	L

	F50II0	F50IN0	F50IN5
R1305	mount	option	
U51	option	mount	

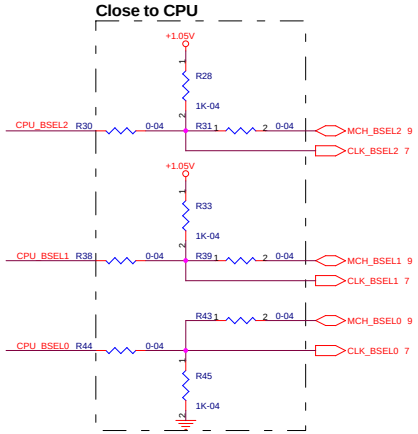

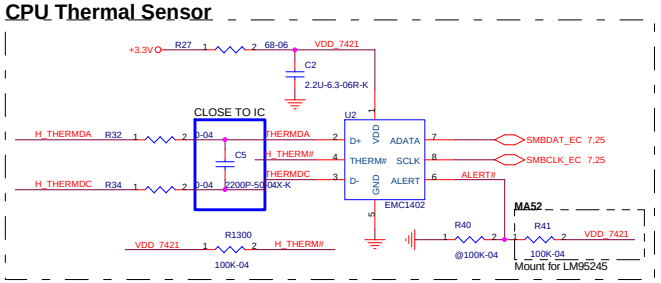

IC \ SETTING	R32	R34	R41
EMC1402	0R	0R	@100K
ADT7421	100R_1	100R_1	@100K
LM95245	0R	0R	100K

*

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: CPU Penryn 1/2	Rev: C
F50IXX		
Date: Thursday, April 24, 2008	Sheet 5 of 50	

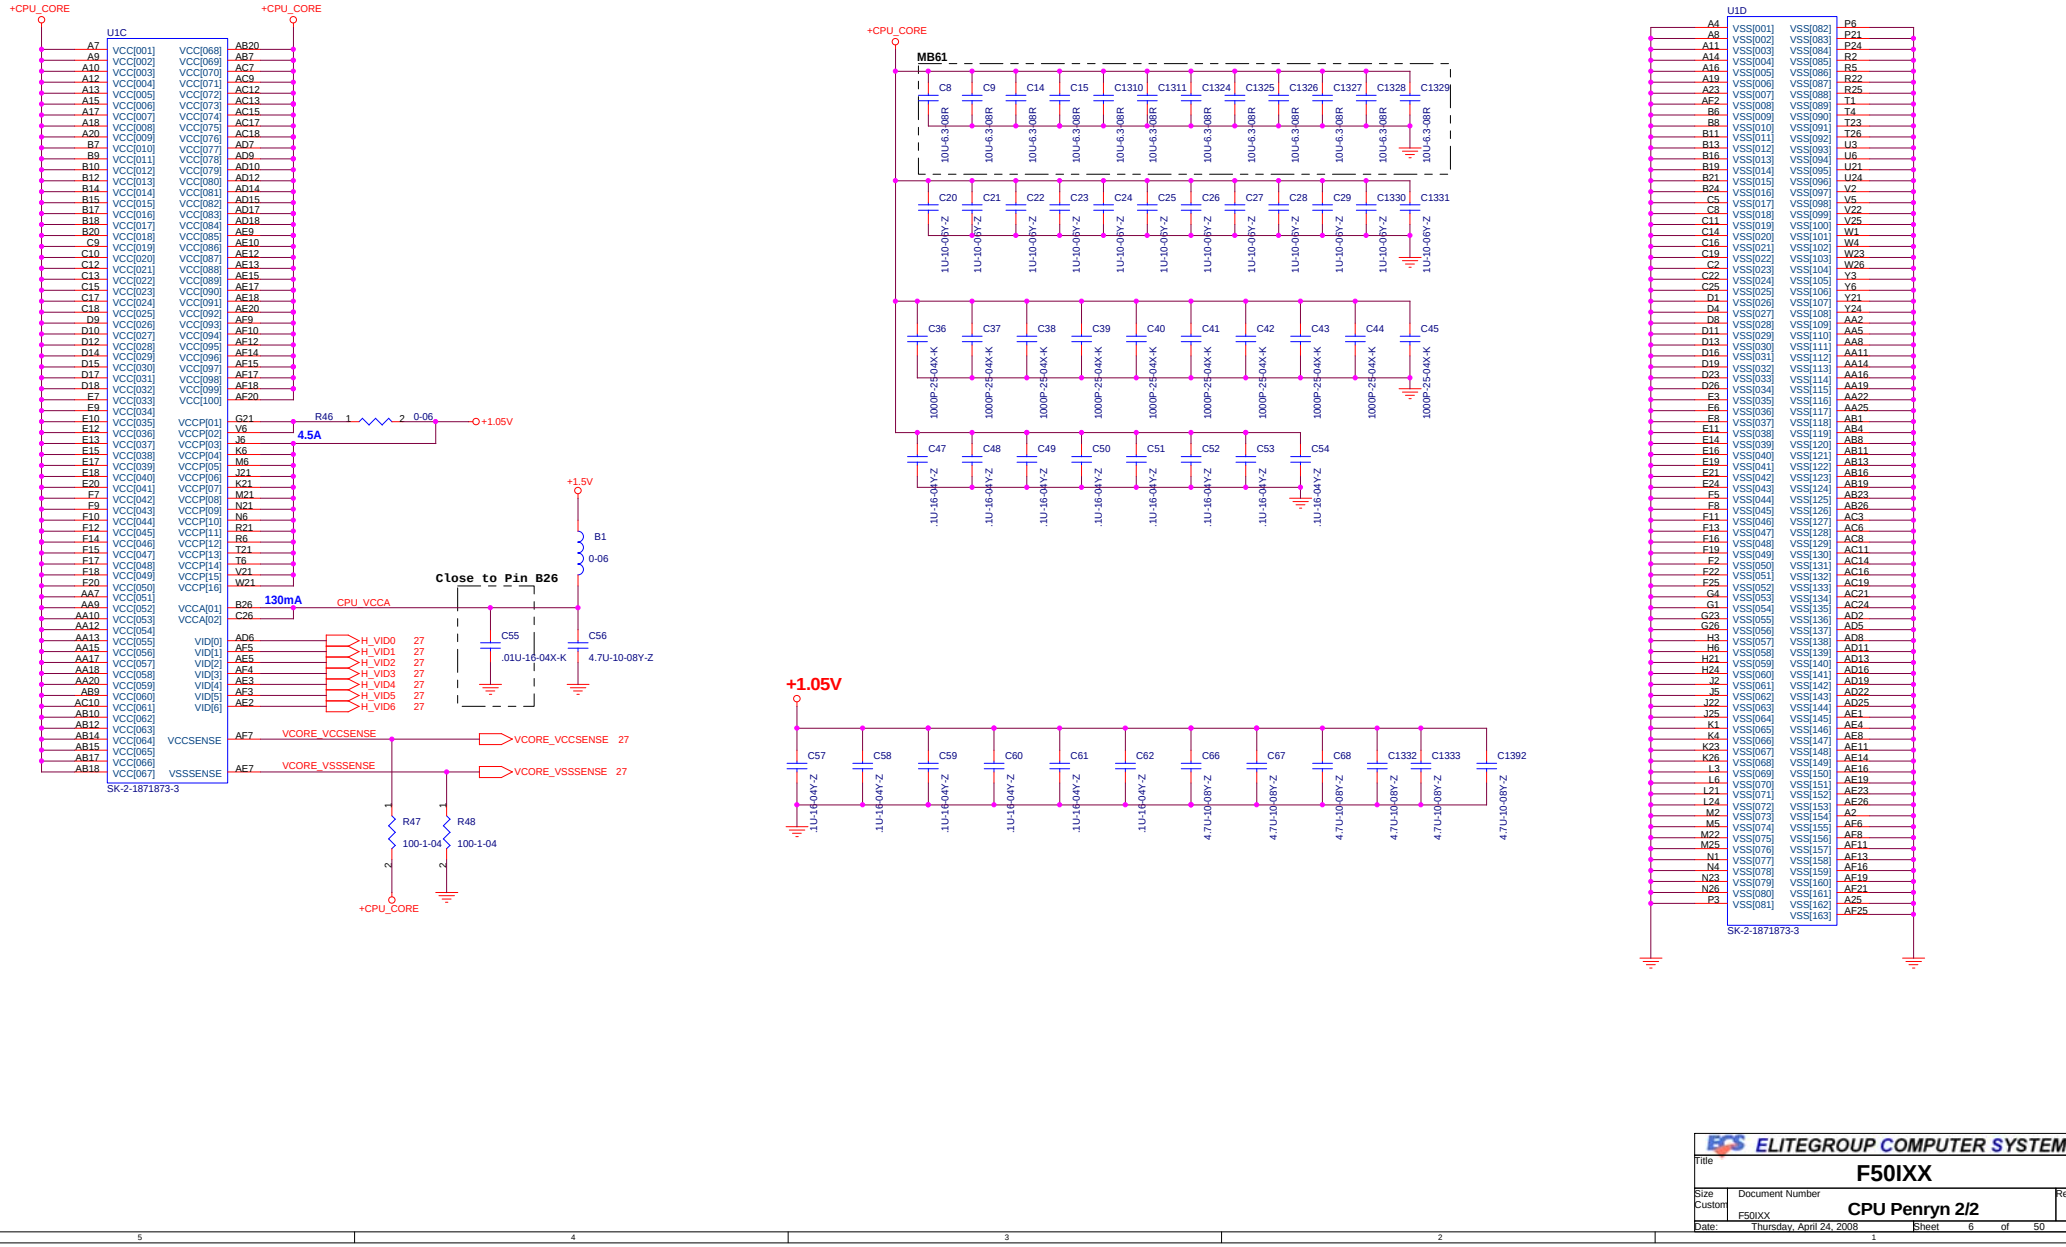

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size	Document Number	Rev
Custom	F50IXX CPU Penryn 2/2	C

Date: Thursday, April 24, 2008 Sheet 6 of 50

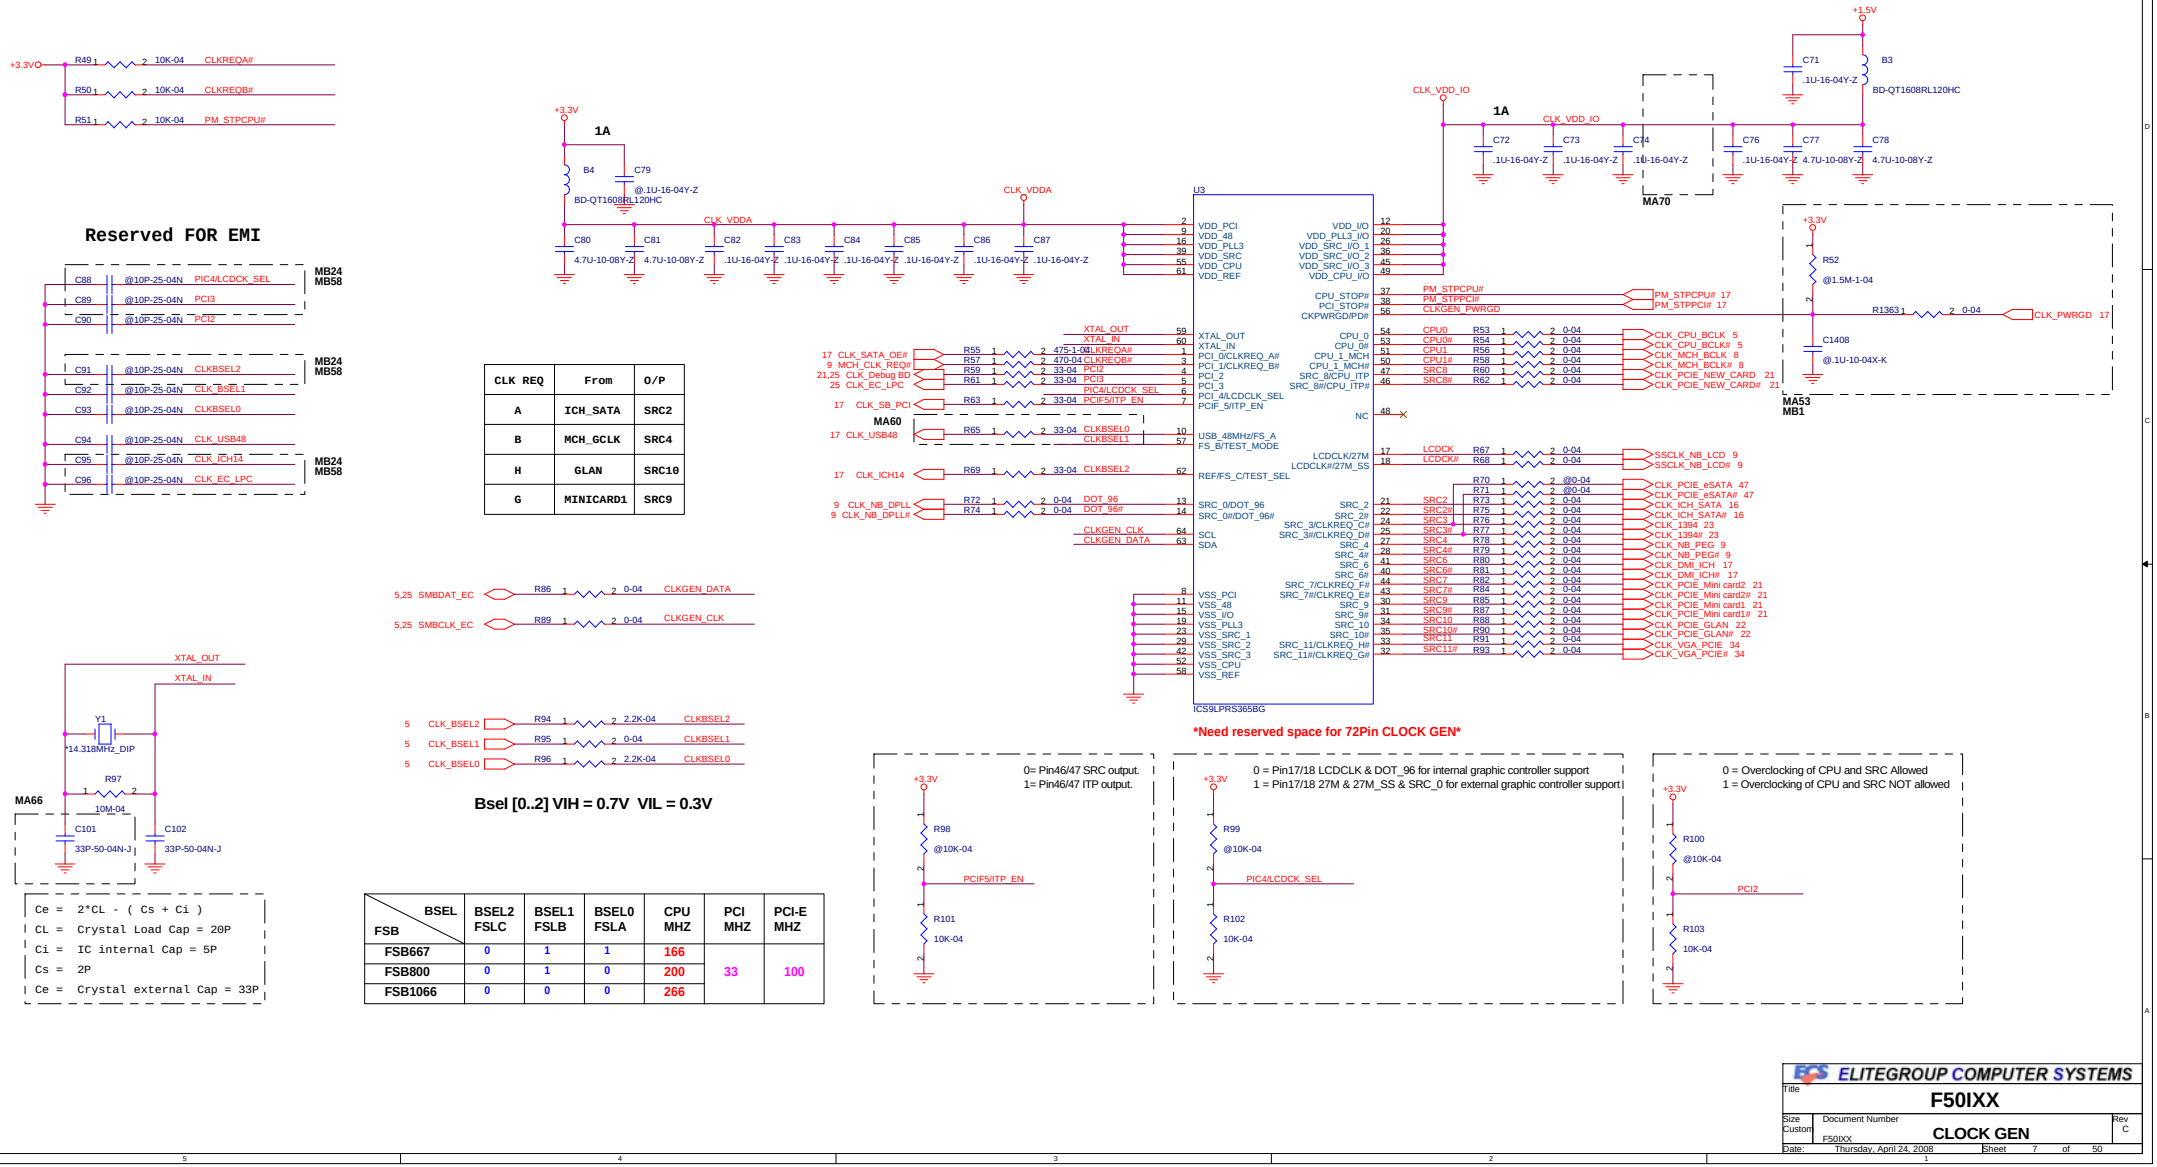
Reserved FOR EMI
CLK REQ | From | O/P
A | ICH_SATA | SRC2
B | MCH_GCLK | SRC4
H | GLAN | SRC10
G | MINICARD1 | SRC9
Bsel [0..2] VIH = 0.7V VIL = 0.3V
Need reserved space for 72Pin CLOCK GEN
0= Pin46/47 SRC output.
1= Pin46/47 ITP output.
0 = Pin17/18 LCDCLK & DOT_96 for internal graphic controller support
1 = Pin17/18 27M & 27M_SS & SRC_0 for external graphic controller support
0 = Overclocking of CPU and SRC Allowed
1 = Overclocking of CPU and SRC NOT allowed
Ce = 2*CL - (Cs + Ci)
CL = Crystal Load Cap = 20P
Ci = IC internal Cap = 5P
Cs = 2P
Ce = Crystal external Cap = 33P
FSB | BSEL2 FSLC | BSEL1 FSLB | BSEL0 FSLA | CPU MHZ | PCI MHZ | PCI-E MHZ
FSB667 | 0 | 1 | 1 | 166 | 33 | 100
FSB800 | 0 | 1 | 0 | 200
FSB1066 | 0 | 0 | 0 | 266
ELITEGROUP COMPUTER SYSTEMS
F50IXX
CLOCK GEN
Date: Thursday, April 24, 2008
Sheet 7 of 50

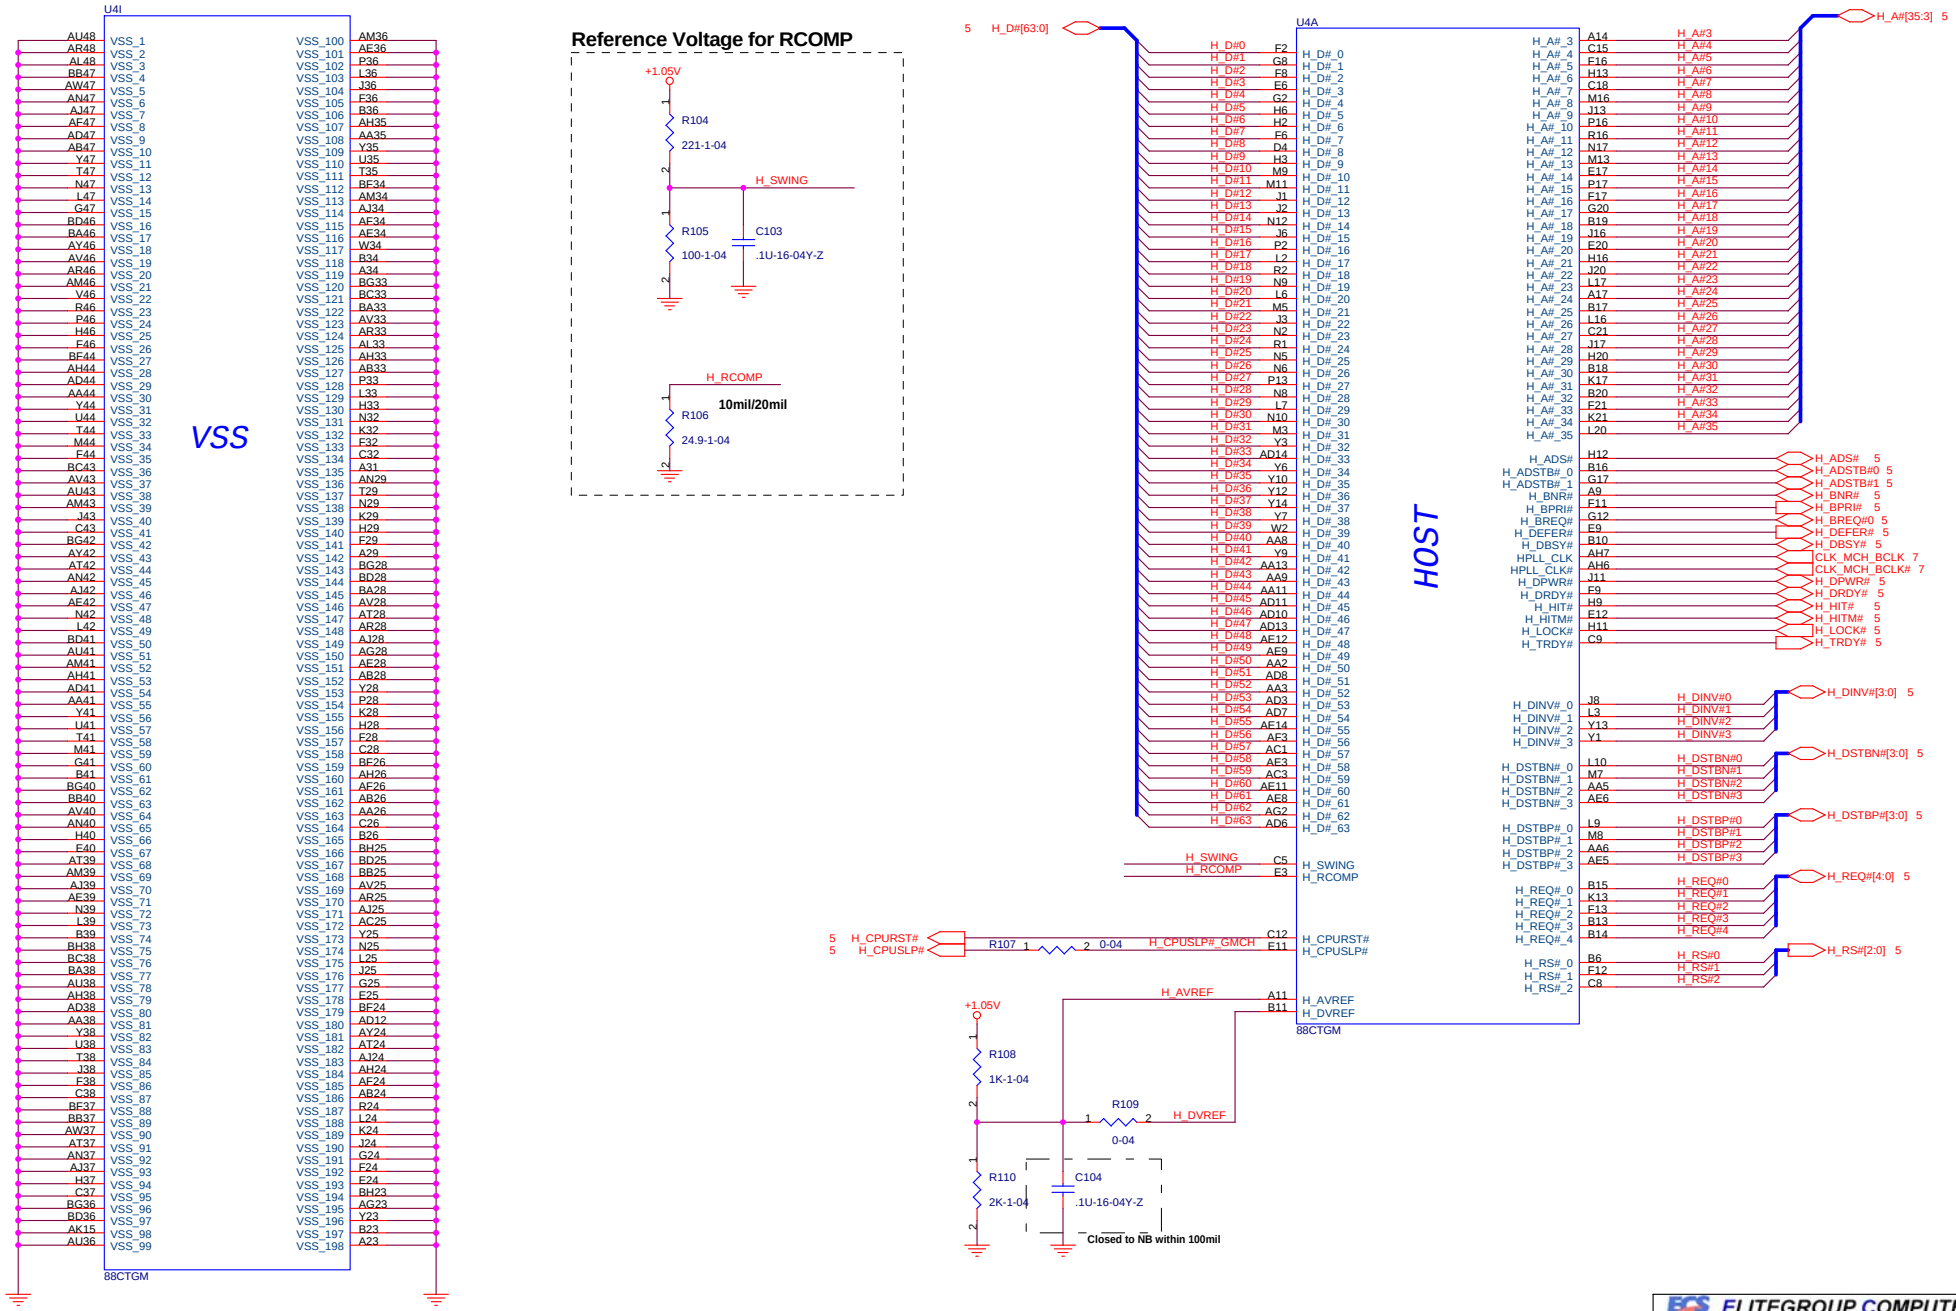

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | NB HOST/VSS | Rev: C

Date: Thursday, April 24, 2008 | Sheet 8 of 50

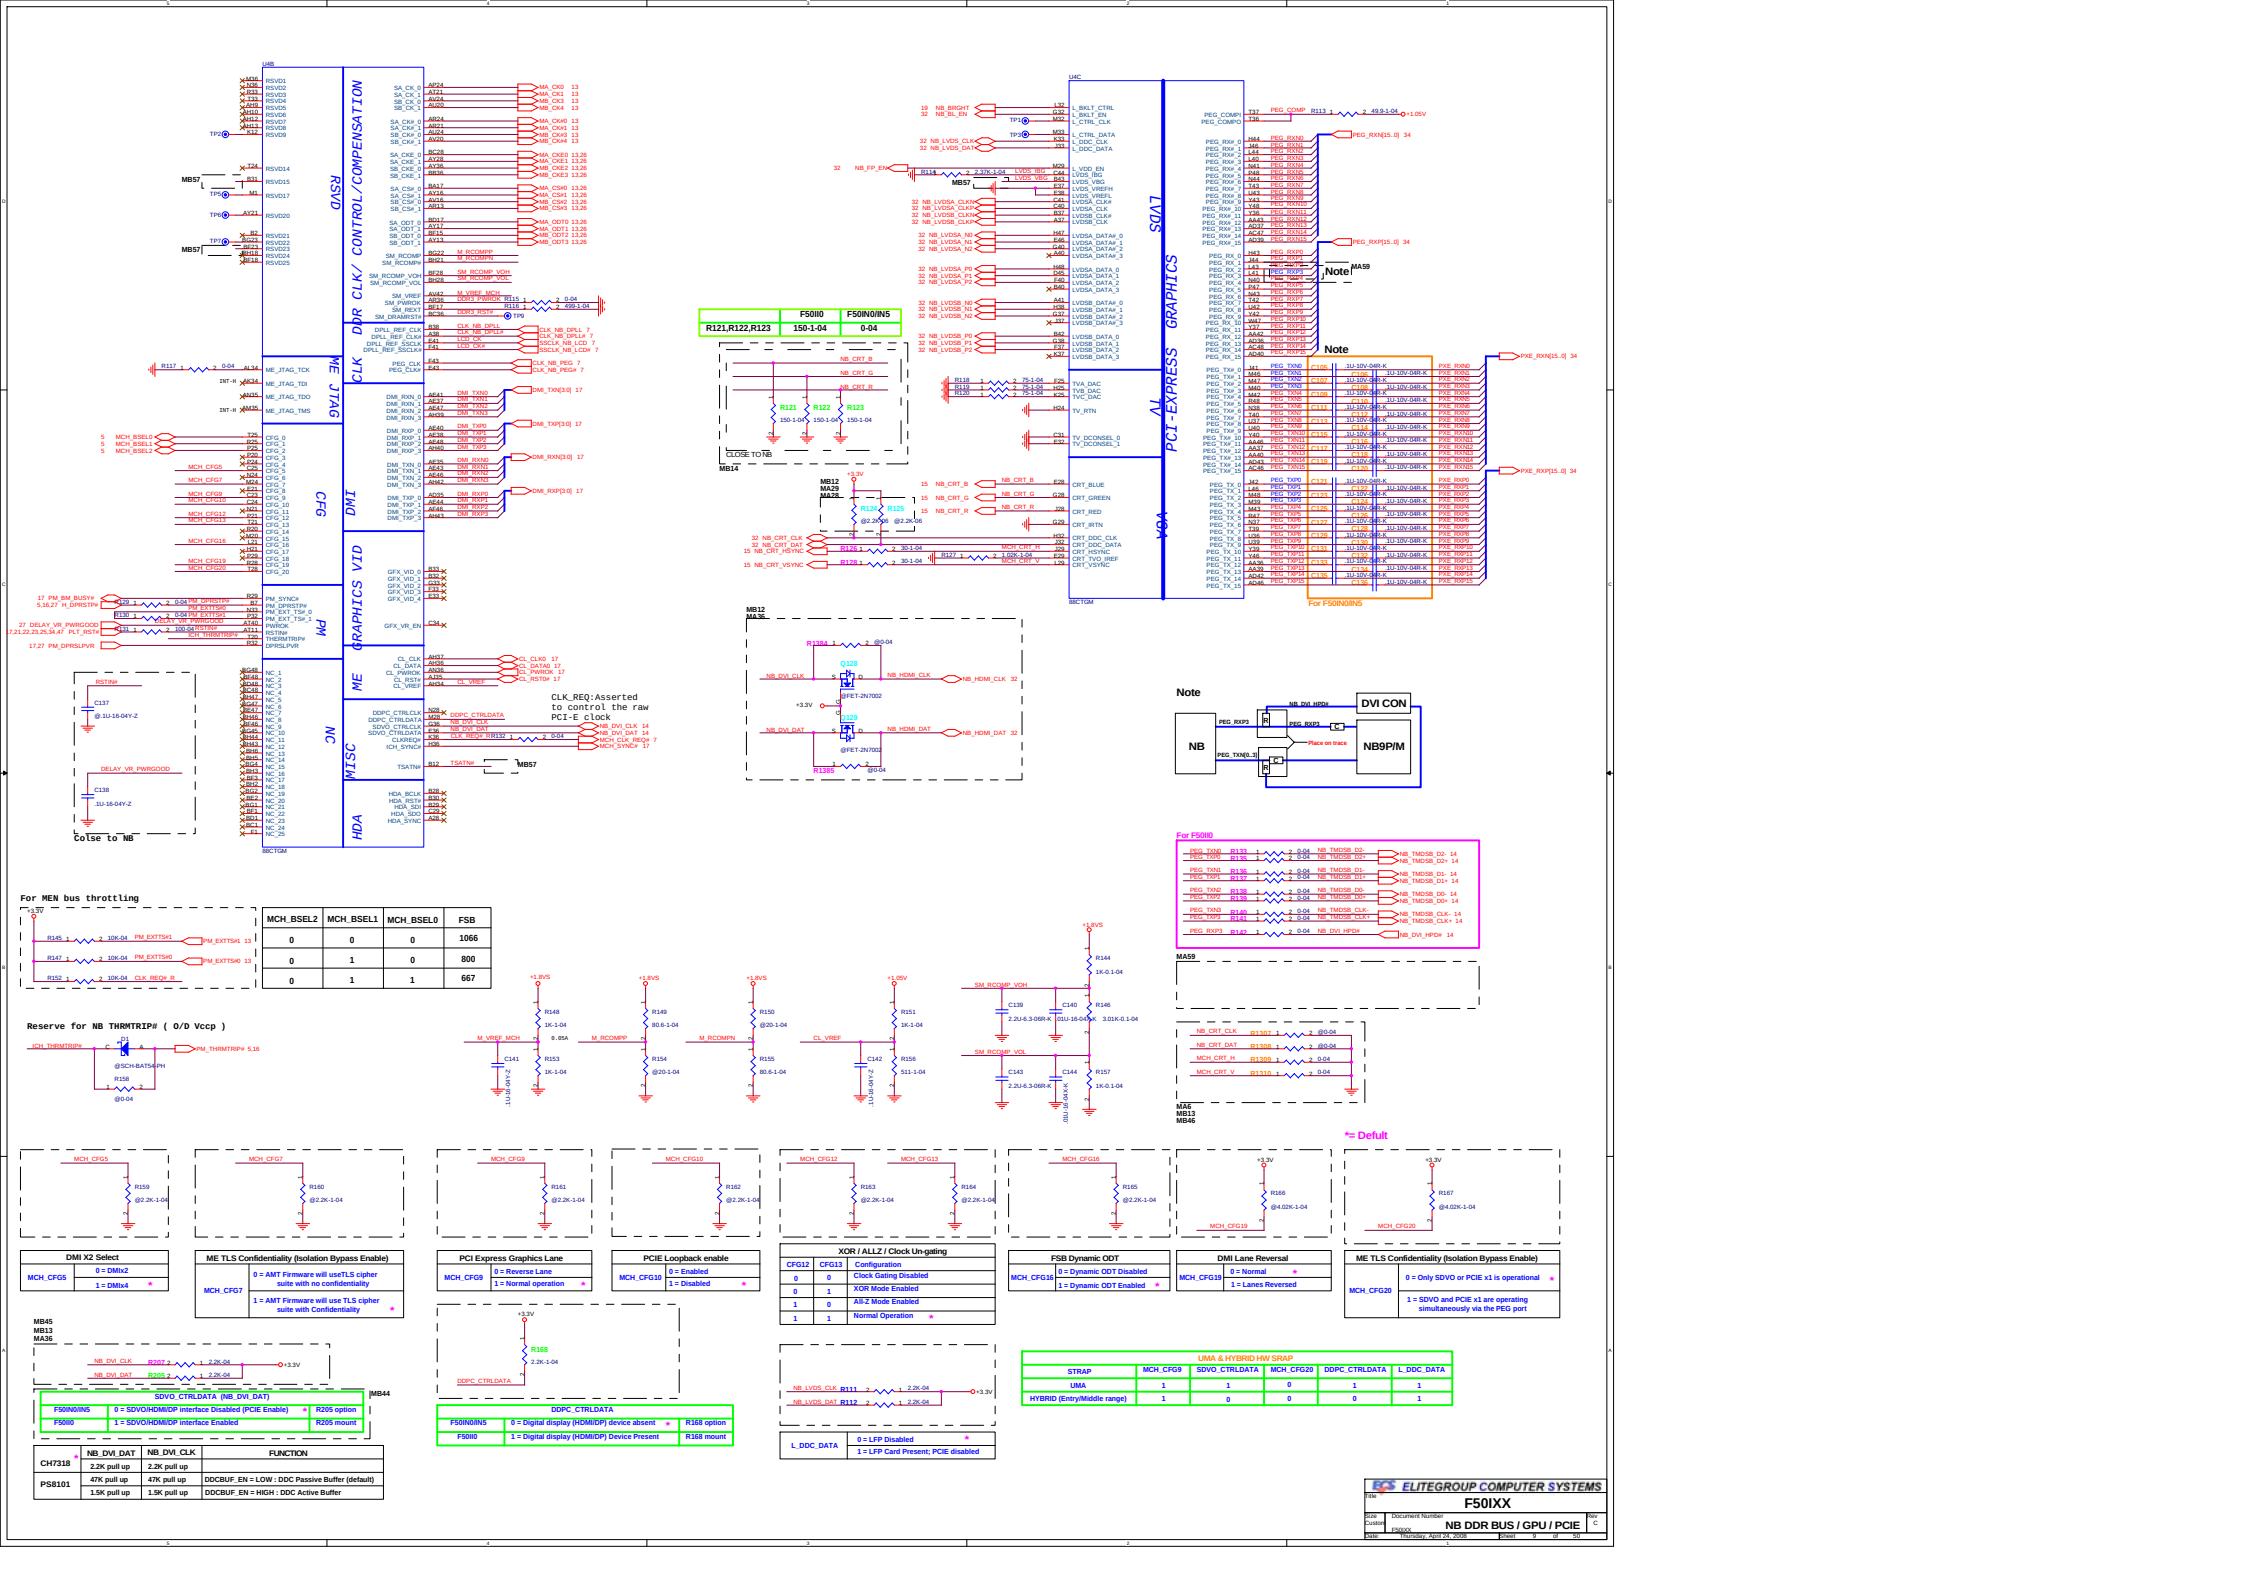

	F50II0	F50II0/II5
R121,R122,R123	150-1-04	0-04

MCH_BSEL2	MCH_BSEL1	MCH_BSEL0	FSB
0	0	0	1066
0	1	0	800
0	1	1	667

DMI X2 Select	
MCH_CFG5	0 = DMIx2
	1 = DMIx4 *

ME TLS Confidentiality (Isolation Bypass Enable)	
MCH_CFG7	0 = AMT Firmware will use/TLS cipher suite with no confidentiality
	1 = AMT Firmware will use TLS cipher suite with Confidentiality *

PCI Express Graphics Lane	
MCH_CFG9	0 = Reverse Lane
	1 = Normal operation *

PCIE Loopback enable	
MCH_CFG10	0 = Enabled
	1 = Disabled *

XOR / ALLZ / Clock Un-gating	
CFG12	CFG13	Configuration
0	0	Clock Gating Disabled
0	1	XOR Mode Enabled
1	0	All-Z Mode Enabled
1	1	Normal Operation *

FSB Dynamic ODT	
MCH_CFG16	0 = Dynamic ODT Disabled
	1 = Dynamic ODT Enabled *

DMI Lane Reversal	
MCH_CFG19	0 = Normal *
	1 = Lanes Reversed

ME TLS Confidentiality (Isolation Bypass Enable)	
MCH_CFG20	0 = Only SDVO or PCIE x1 is operational *
	1 = SDVO and PCIE x1 are operating simultaneously via the PEG port

SDVO_CTRLDATA (NB_DVI_DAT)		
F50II0/II5	0 = SDVO/HDMI/DP interface Disabled (PCIE Enable) *	R205 option
F50II0	1 = SDVO/HDMI/DP interface Enabled	R205 mount

DDPC_CTRLDATA		
F50II0/II5	0 = Digital display (HDMI/DP) device absent *	R168 option
F50II0	1 = Digital display (HDMI/DP) Device Present	R168 mount

L_DDC_DATA	
	0 = LFP Disabled *
	1 = LFP Card Present; PCIE disabled

UMA & HYBRID HW SRAP					
STRAP	MCH_CFG9	SDVO_CTRLDATA	MCH_CFG20	DDPC_CTRLDATA	L_DDC_DATA
UMA	1	1	0	1	1
HYBRID (Entry/Middle range)	1	0	0	0	1

CH7318 *	NB_DVI_DAT	NB_DVI_CLK	FUNCTION
	2.2K pull up	2.2K pull up	
PS8101	47K pull up	47K pull up	DDCBUF_EN = LOW : DDC Passive Buffer (default)
	1.5K pull up	1.5K pull up	DDCBUF_EN = HIGH : DDC Active Buffer

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | Rev: C

Date: Thursday, April 24, 2008 | Sheet 8 of 50

NB DDR BUS / GPU / PCIE

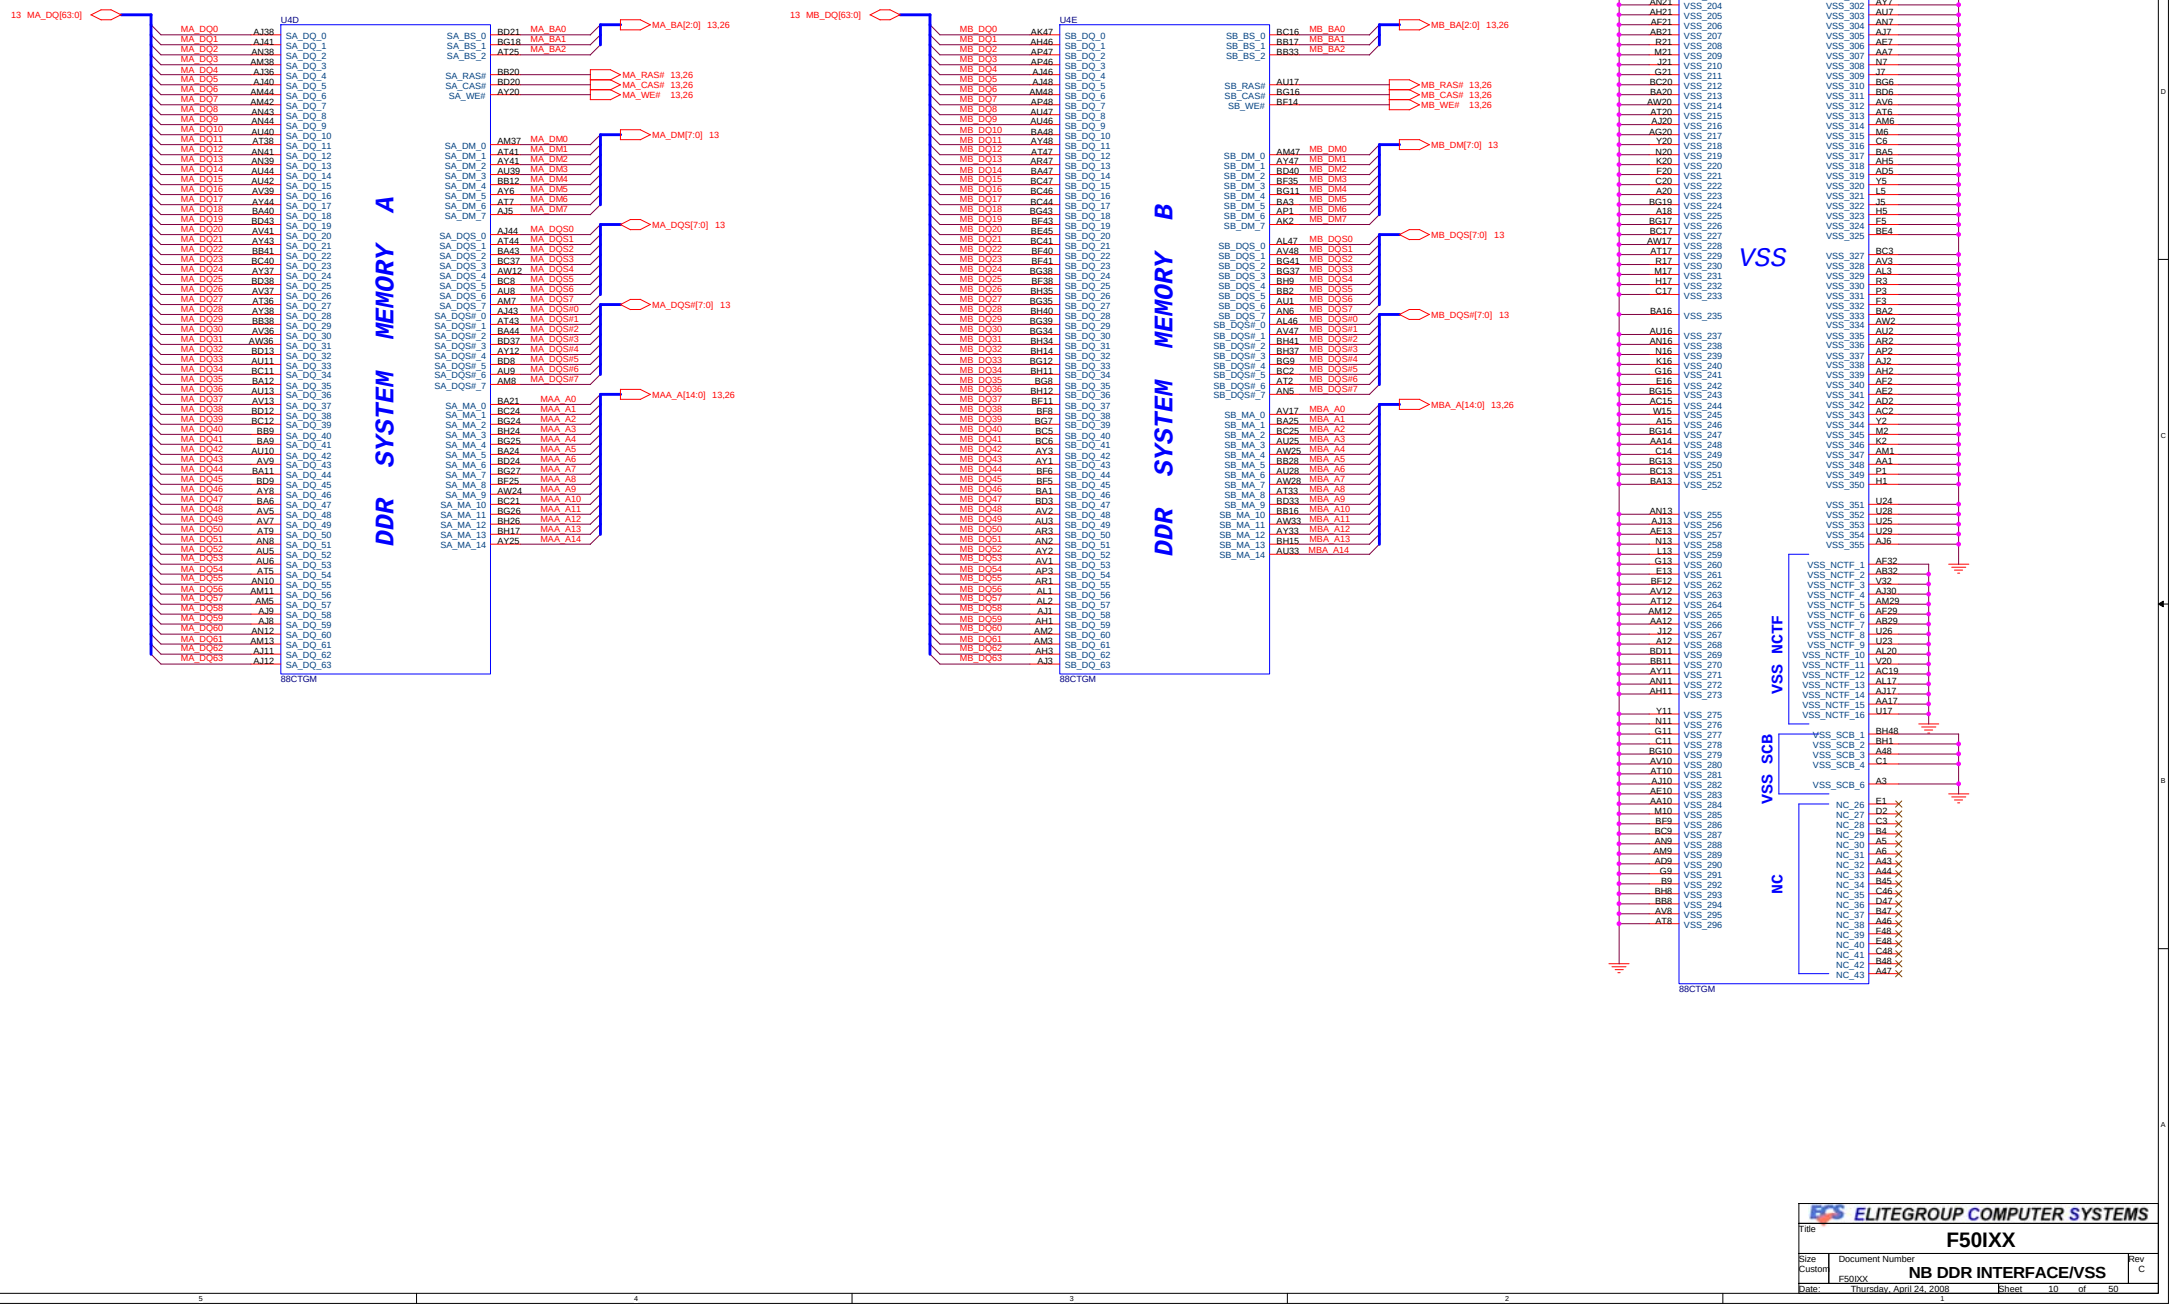

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: NB DDR INTERFACE/VSS	Rev: C
Date: Thursday, April 24, 2008	Sheet 10 of 50	F50IXX

Location	F50II0	F50IN0/IN5
C148,C158,C197,C210	.1U-16-04Y-Z	0-04

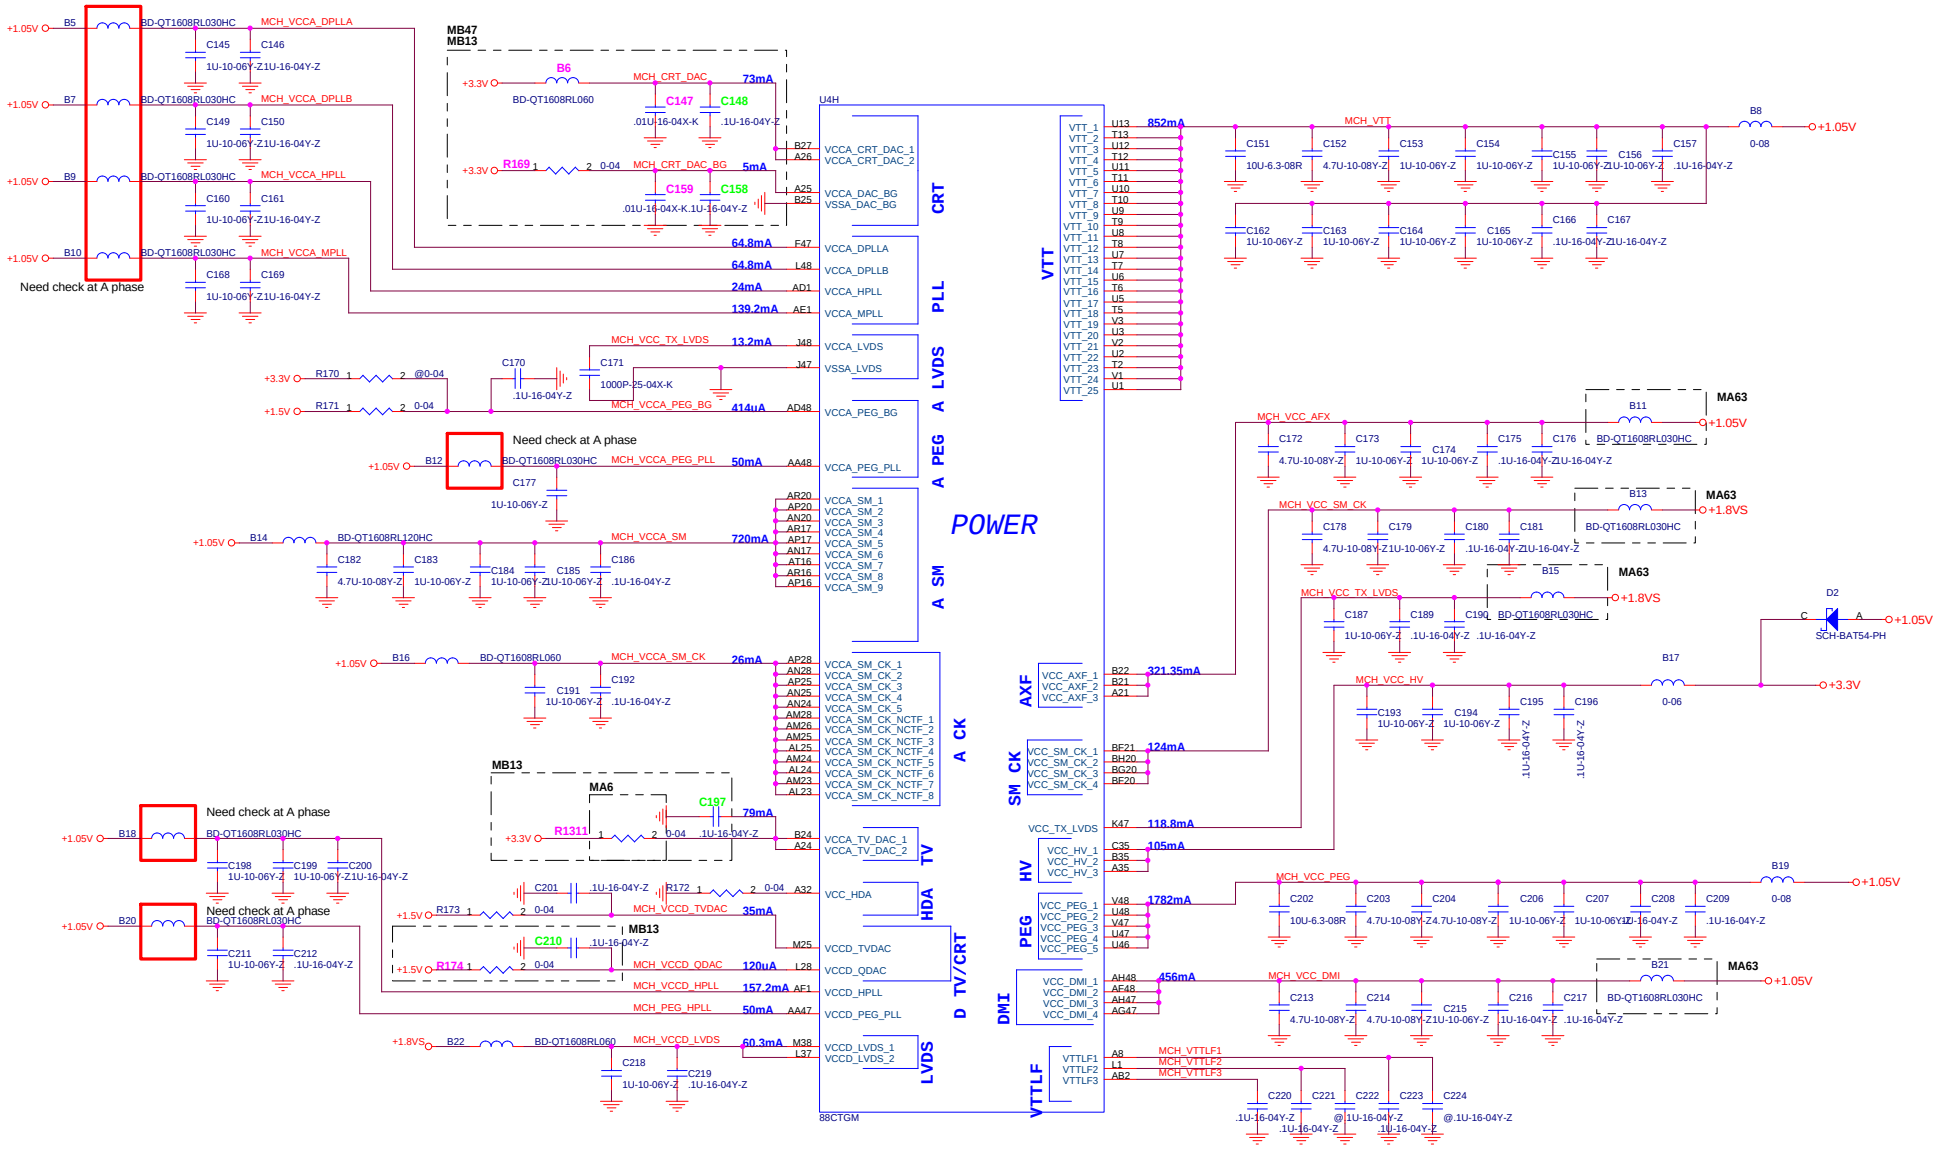

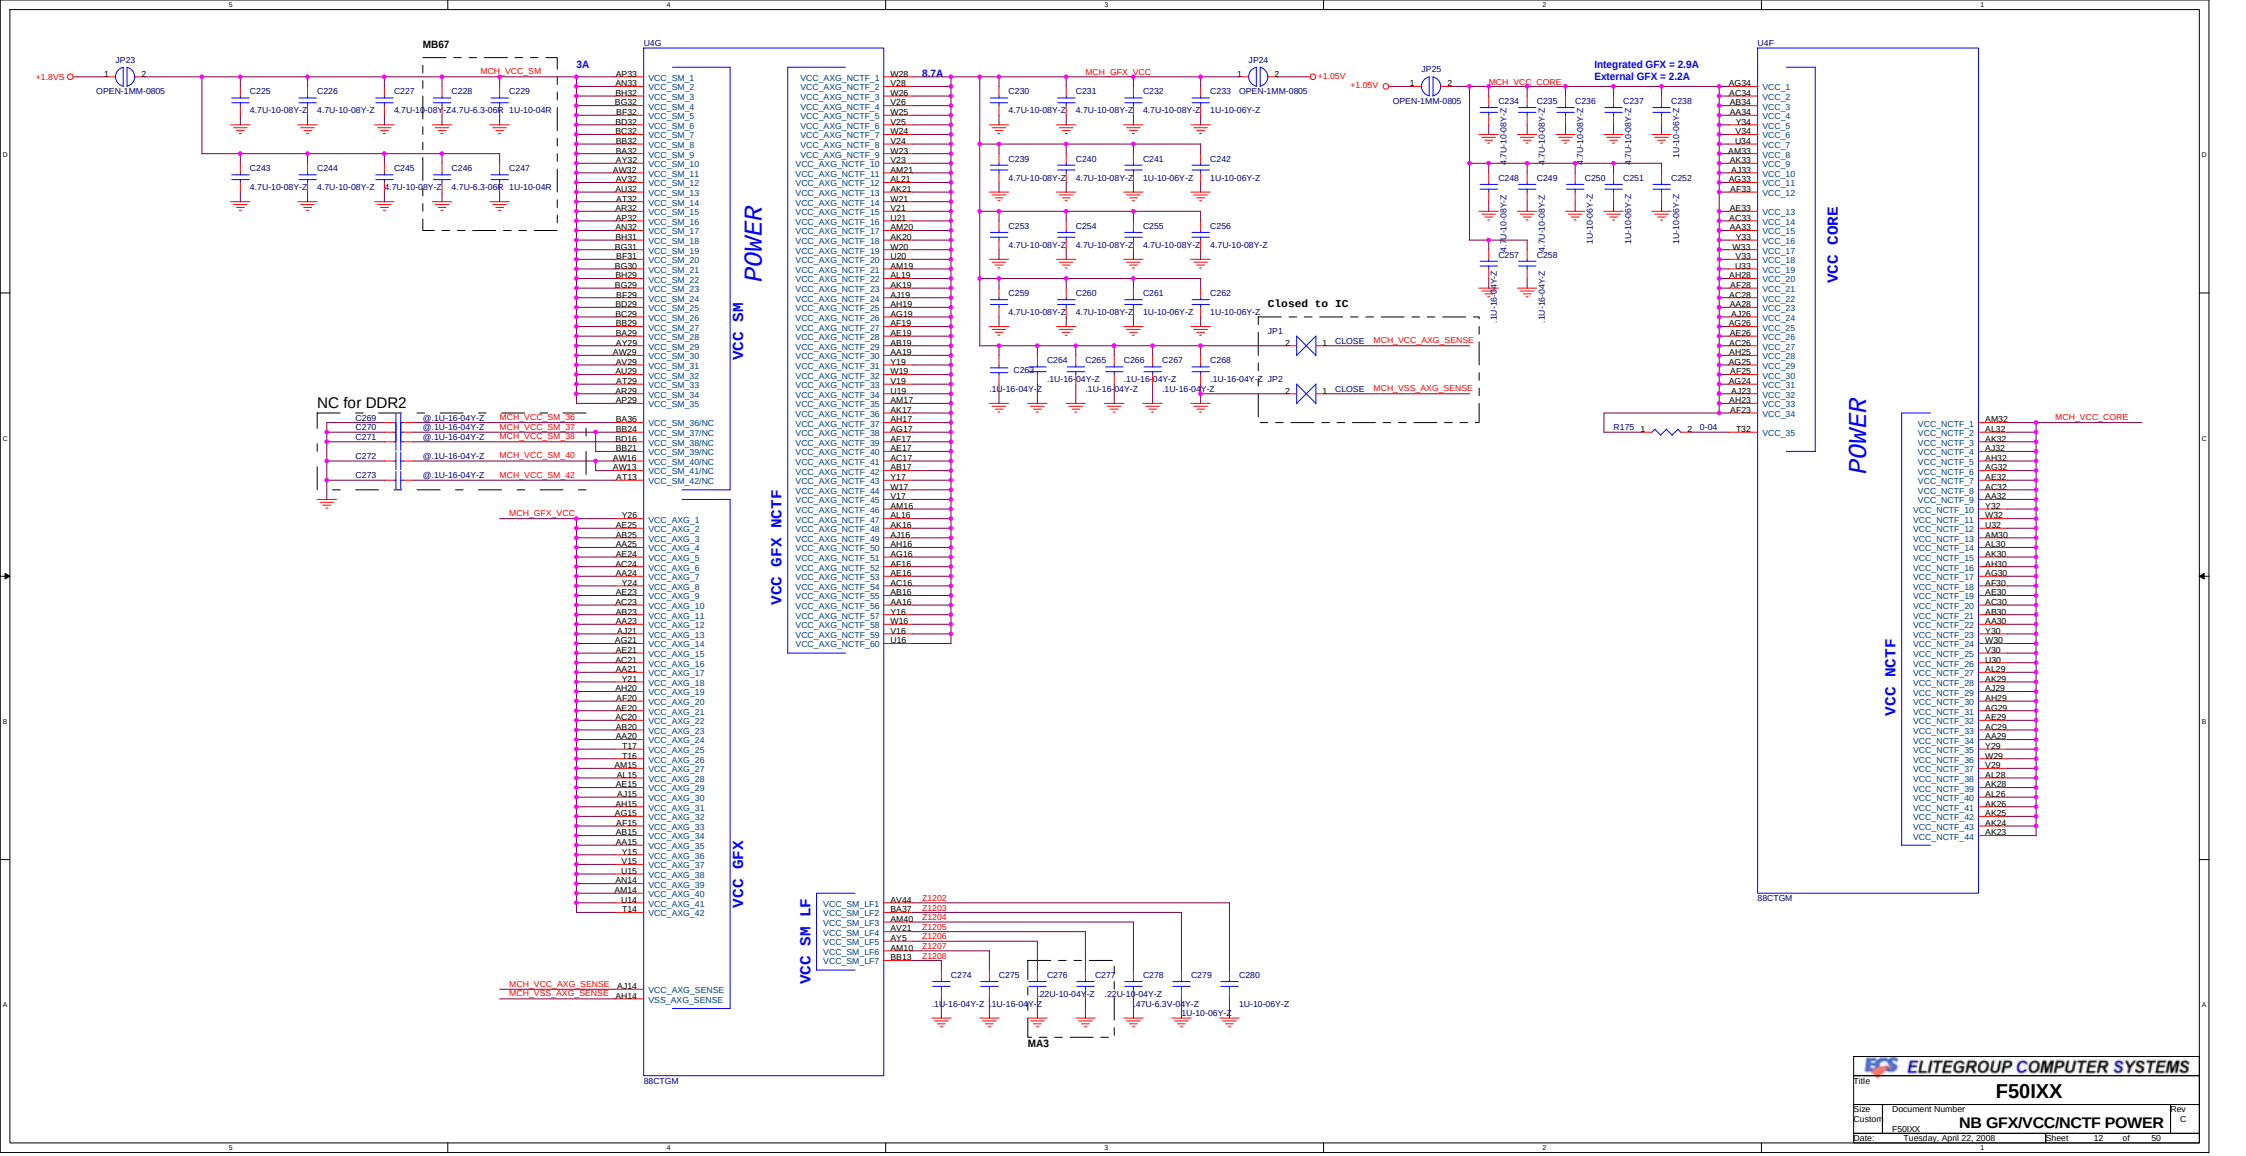

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: NB GFX/VCC/NCTF POWER (F50IXX)	Rev: C
Date: Tuesday, April 22, 2008	Sheet 12 of 50	

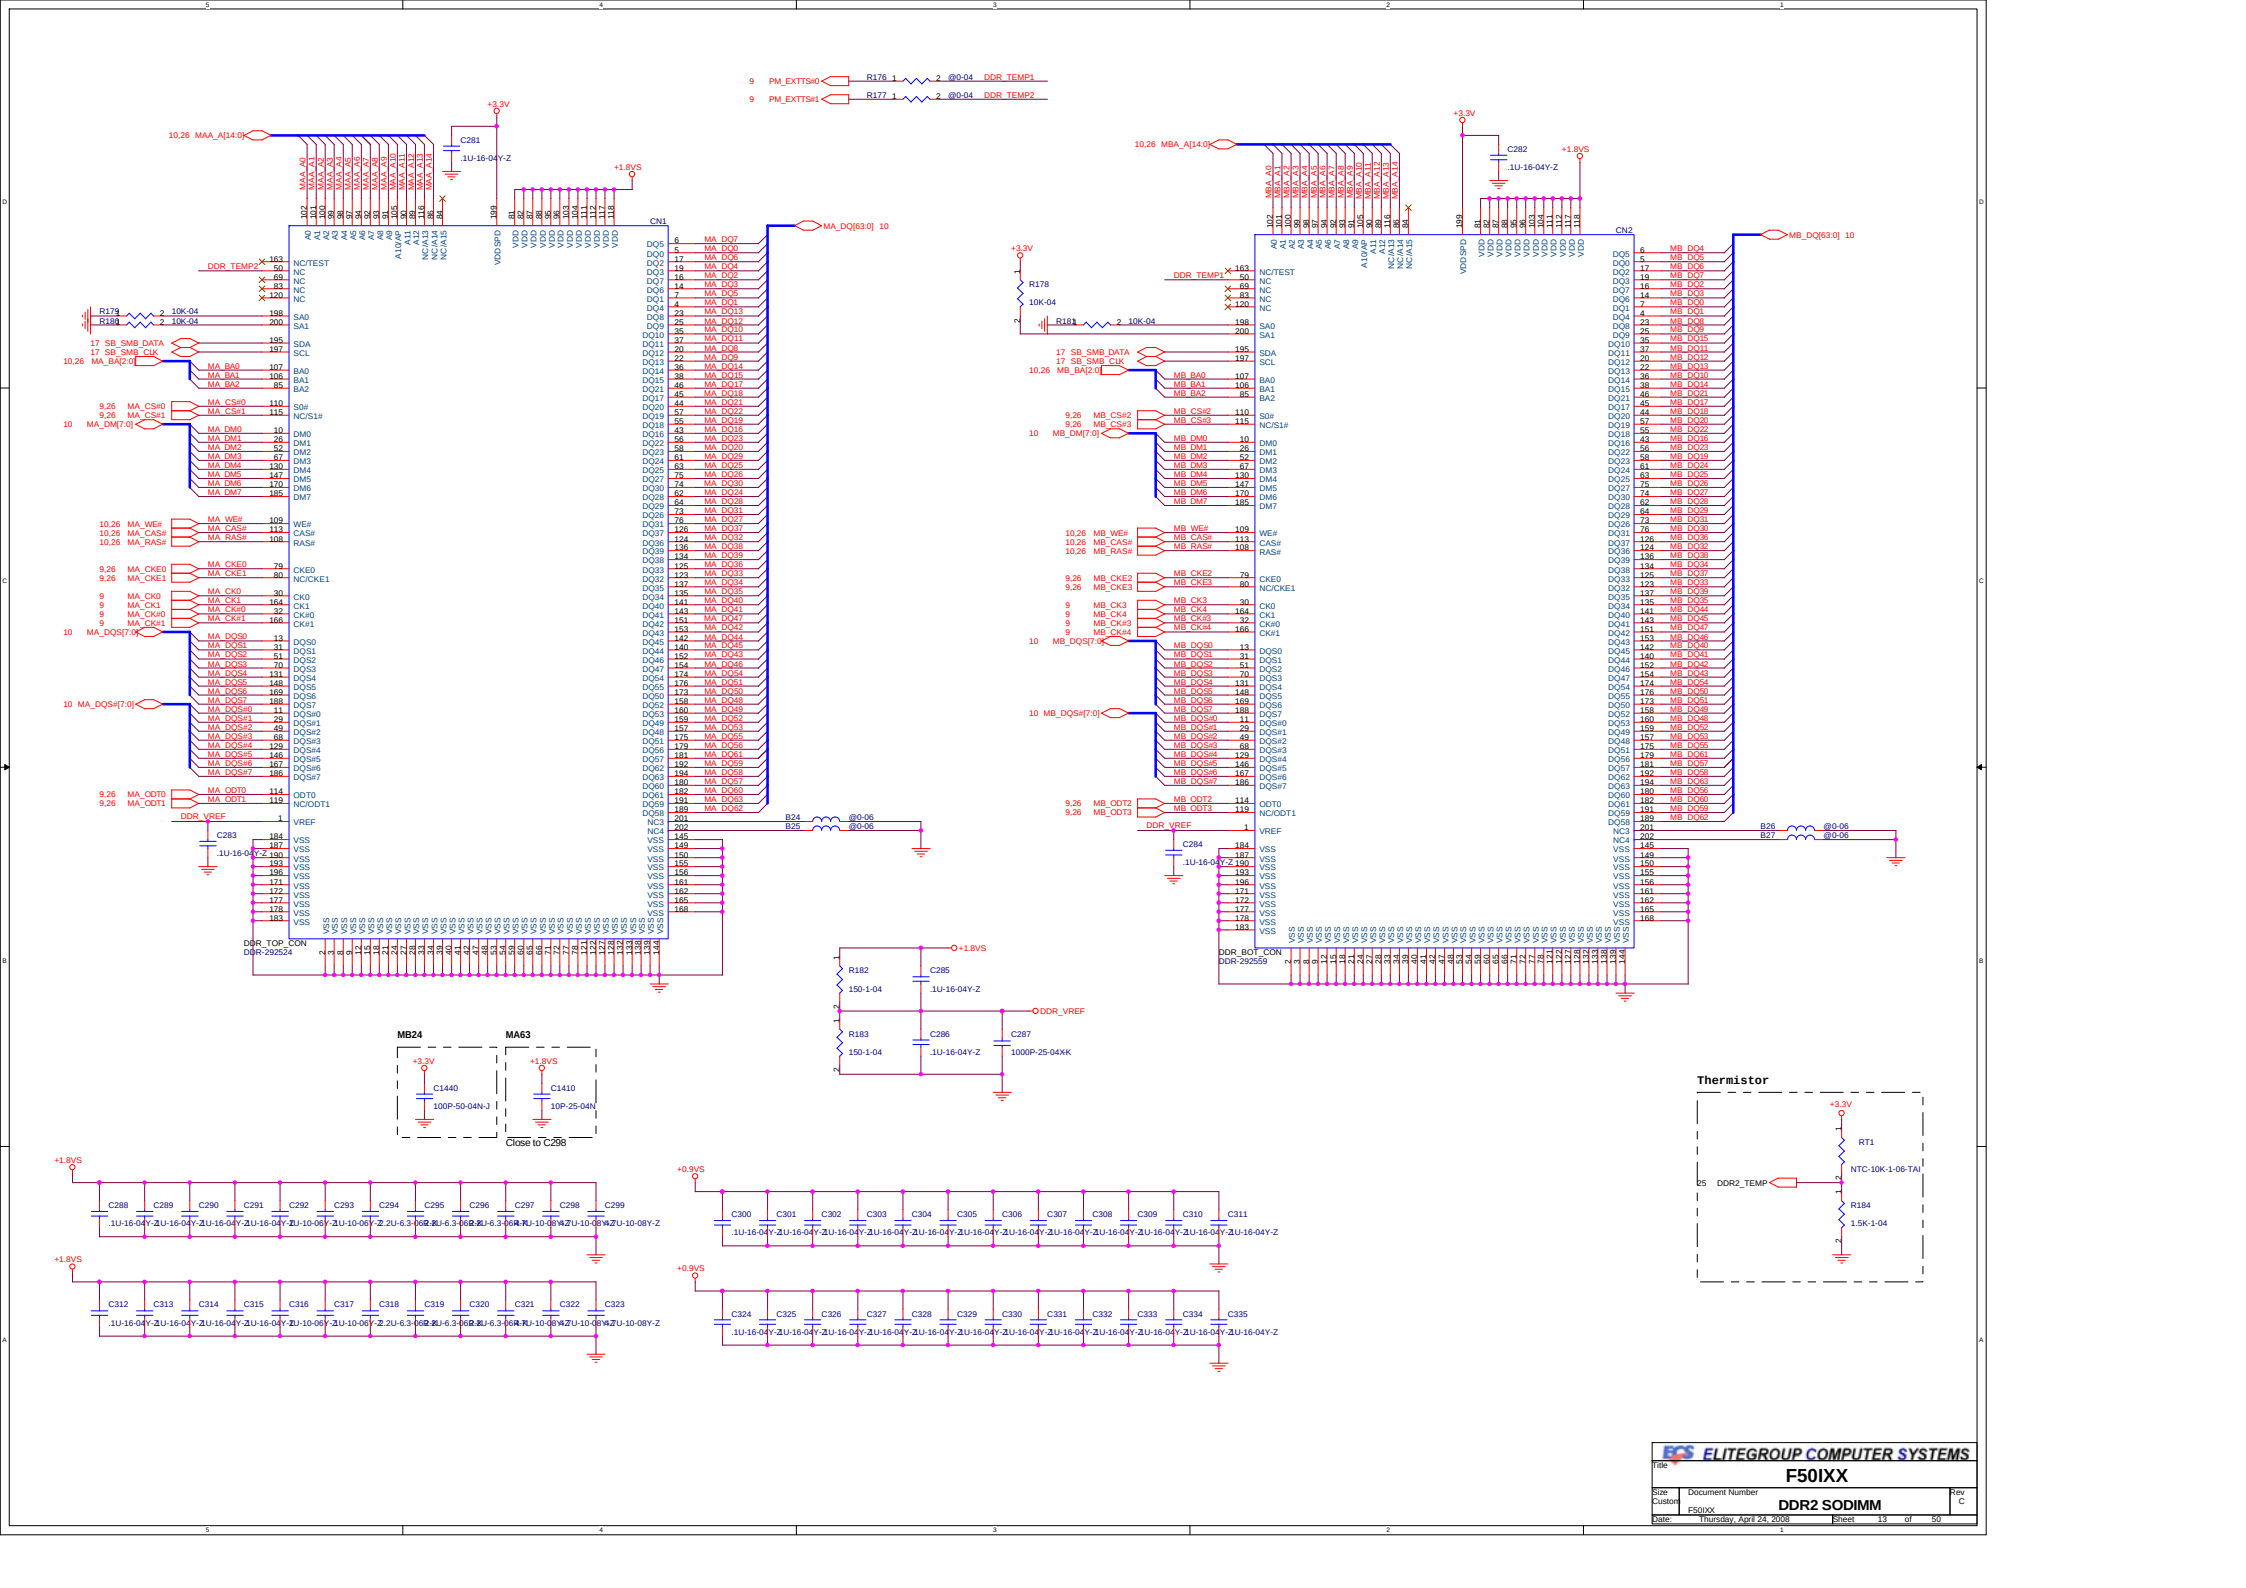

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: DDR2 SODIMM	Rev: C
	F50IXX	
Date: Thursday, April 24, 2008	Sheet 13 of 50	

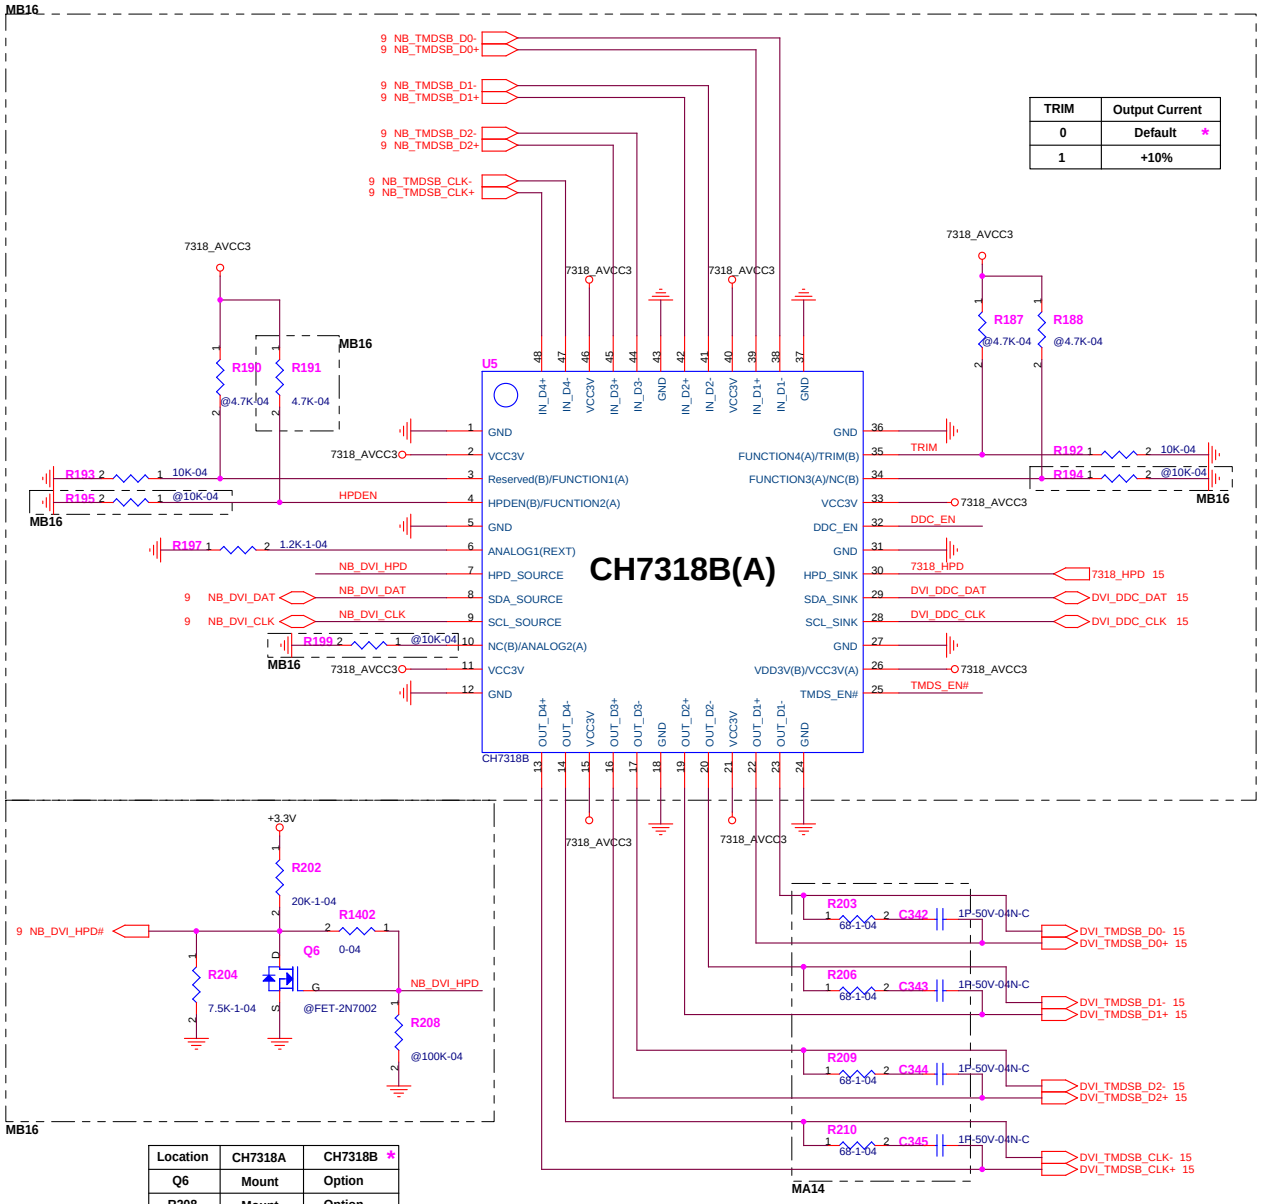

TRIM	Output Current
0	Default *
1	+10%

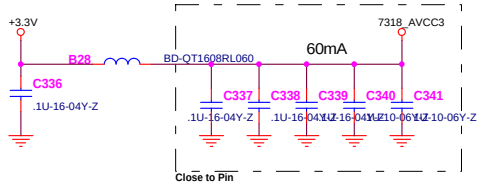

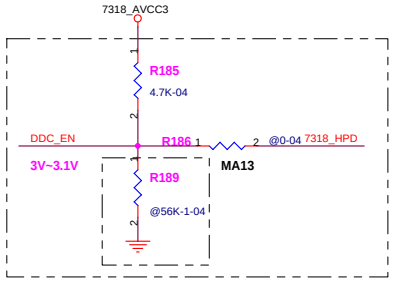

DDC EN	Passgate
L	Disable
H	Enable

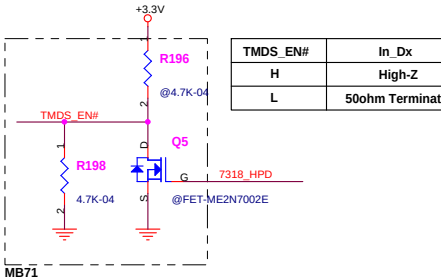

TMDS_EN#	In_Dx	TMDS_OUTx
H	High-Z	High-Z
L	50ohm Termination	Level shifting mode enabled

	NB_DVI_DAT	NB_DVI_CLK	FUNCTION
CH7318 *	2.2K pull up	2.2K pull up	
PS8101	47K pull up	47K pull up	DDCBUF_EN = LOW : DDC Passive Buffer (default)
	1.5K pull up	1.5K pull up	DDCBUF_EN = HIGH : DDC Active Buffer

Pin	CH7318B *	PS8101
3	10K pull down	4.7K pull up
4	4.7K pull up	
6	1.2K_1	499R_1
10	NC	
28	2.2K pull up	1.5K pull up
29	2.2K pull up	1.5K pull up
32	20K pull down	4.7K pull up
34	NC	4.7K pull up
35	10K pull down	4.7K pull up
13,14	Mount R210,C345	Option R210,C345
16,17	Mount R209,C344	Option R209,C344
19,20	Mount R206,C343	Option R206,C343
22,23	Mount R203,C342	Option R203,C342

Location	CH7318A	CH7318B *
Q6	Mount	Option
R208	Mount	Option
R1402	Option	Mount

HPDEN	HPD_SOURCE
0	Non-inverting output
1	Inverting output(Open drain) *

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: NB DVI LEVEL SHIFT | Rev: C

F50IXX

Date: Thursday, April 24, 2008 | Sheet 14 of 50

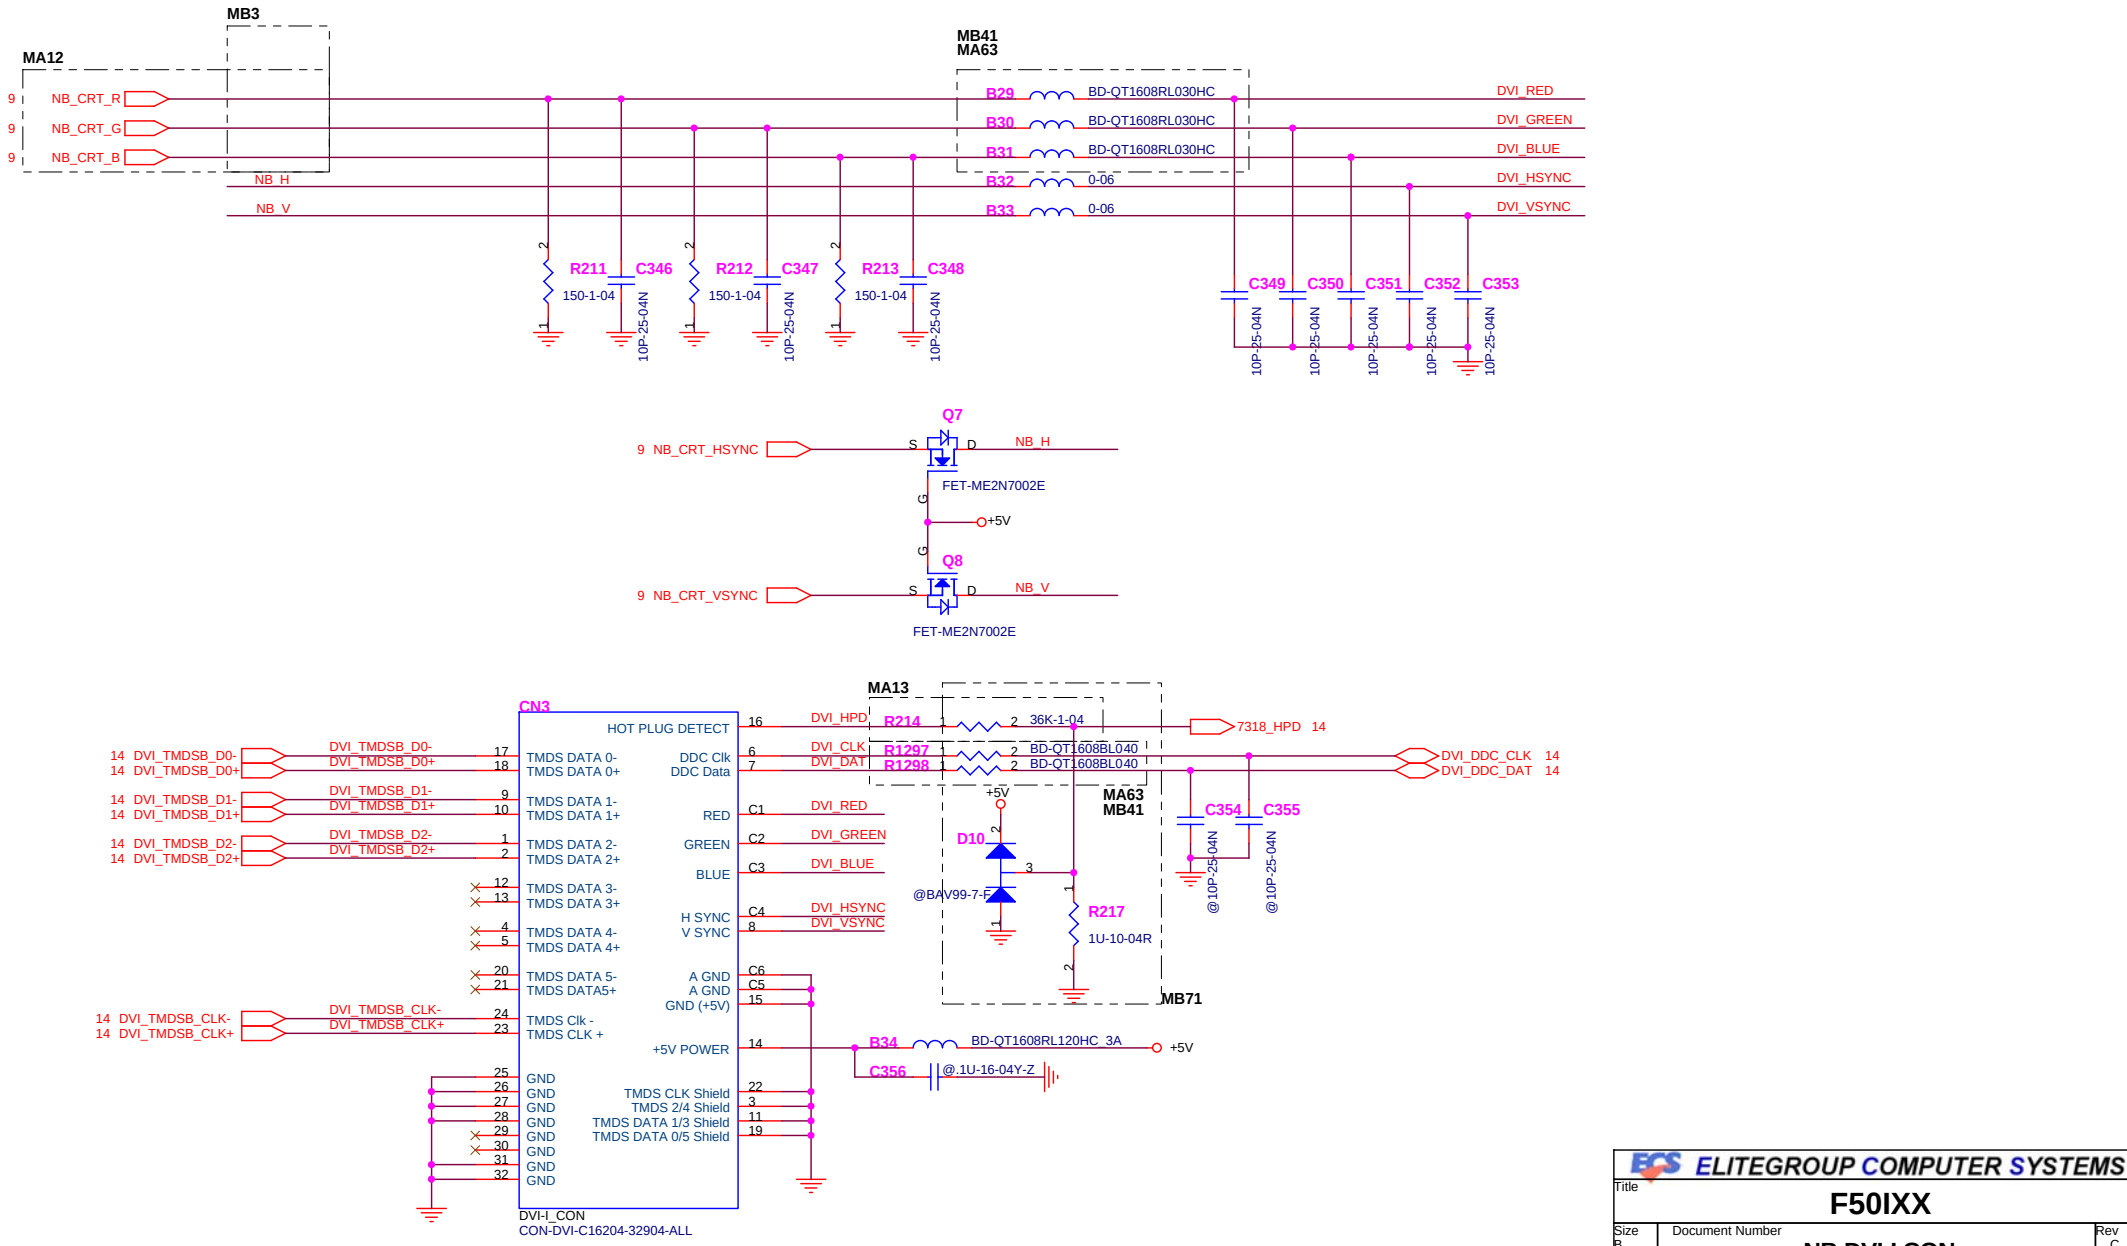

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size B	Document Number F50IXX NB DVI-I CON	Rev C
Date: Thursday, April 24, 2008	Sheet 15 of 50	

RTC Circuitry

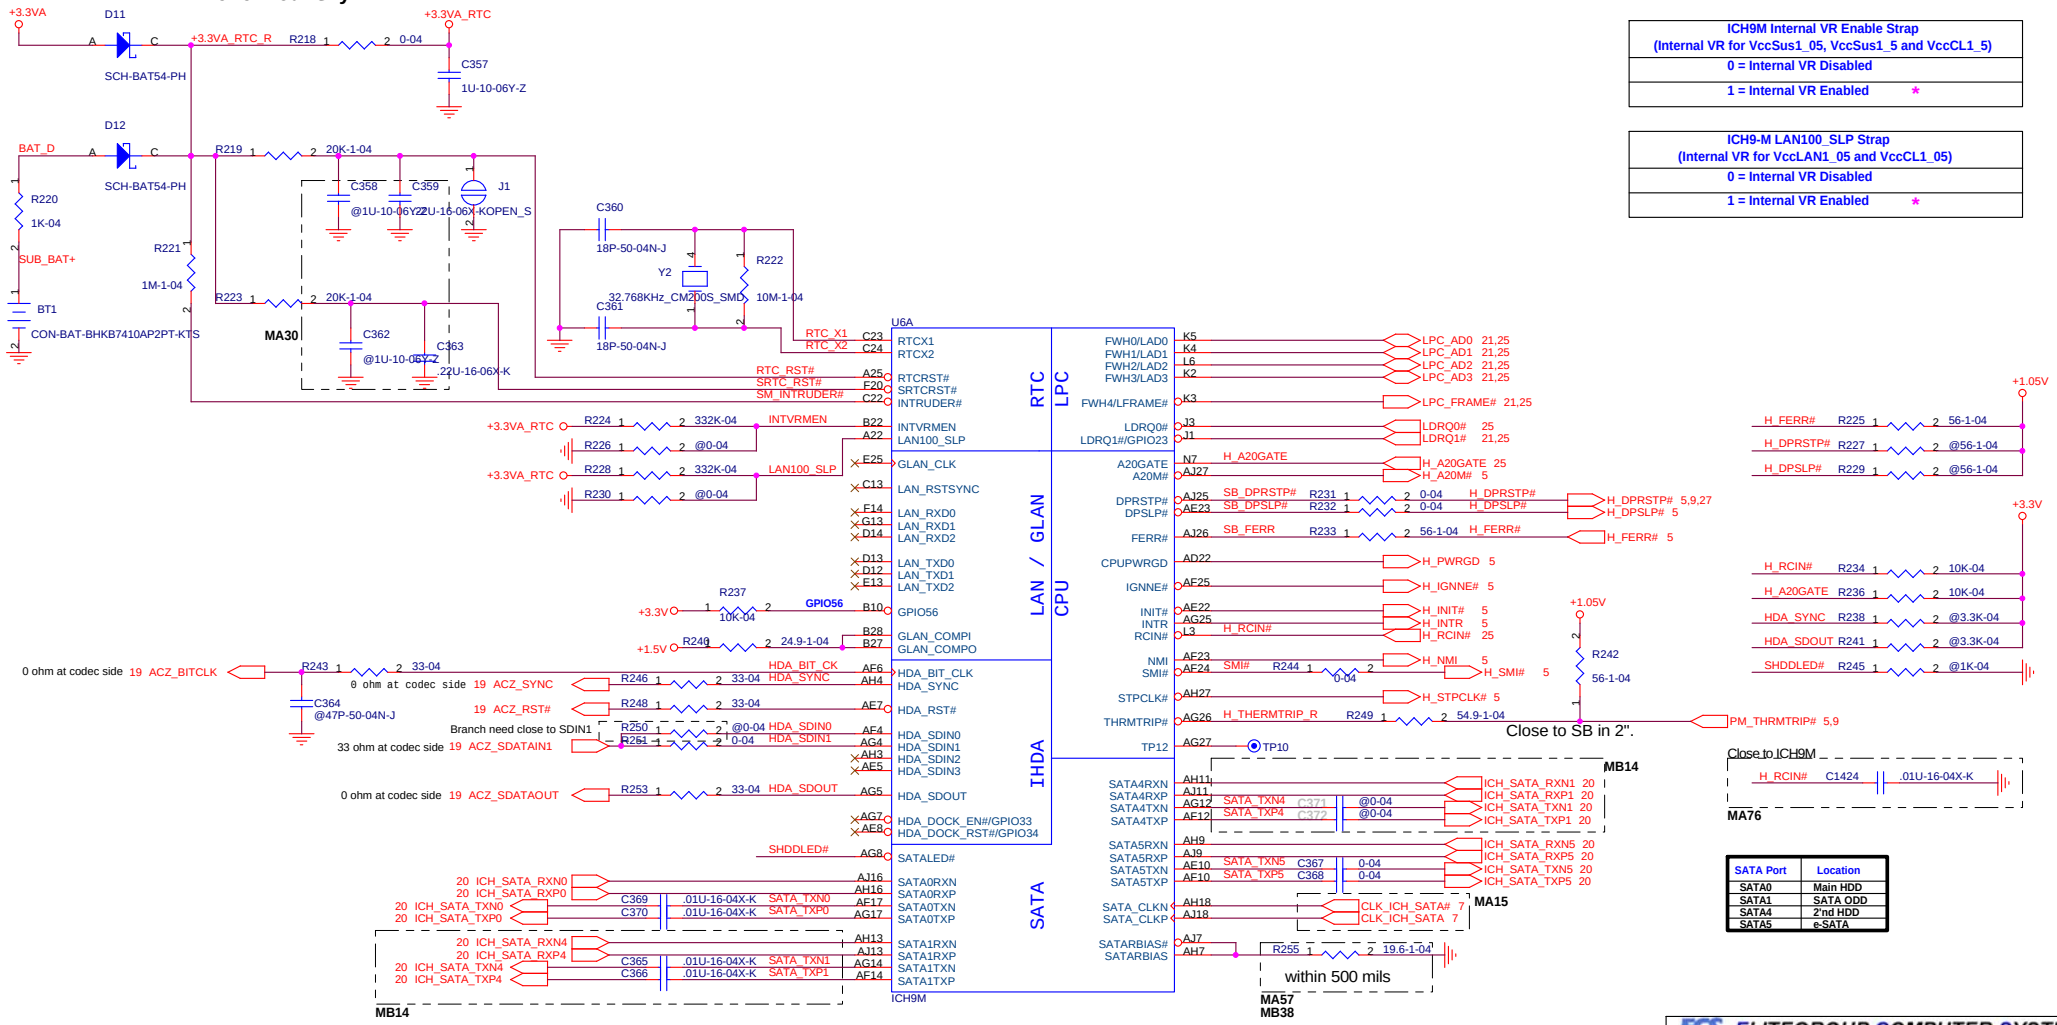

SM_INTRUDER#	
	0 = Disable Internal 1.5Vs LDO
	1 = Enable Internal 1.5Vs LDO *

ICH9M Internal VR Enable Strap (Internal VR for VccSus1_05, VccSus1_5 and VccCL1_5)
0 = Internal VR Disabled
1 = Internal VR Enabled *

ICH9-M LAN100_SLP Strap (Internal VR for VccLAN1_05 and VccCL1_05)
0 = Internal VR Disabled
1 = Internal VR Enabled *

SATA Port	Location
SATA0	Main HDD
SATA1	SATA ODD
SATA4	2'nd HDD
SATA5	e-SATA

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX ICH9M RTC/SATA/HDA/LPC 1/3 | Rev: C

Date: Thursday, April 24, 2008 | Sheet 16 of 50

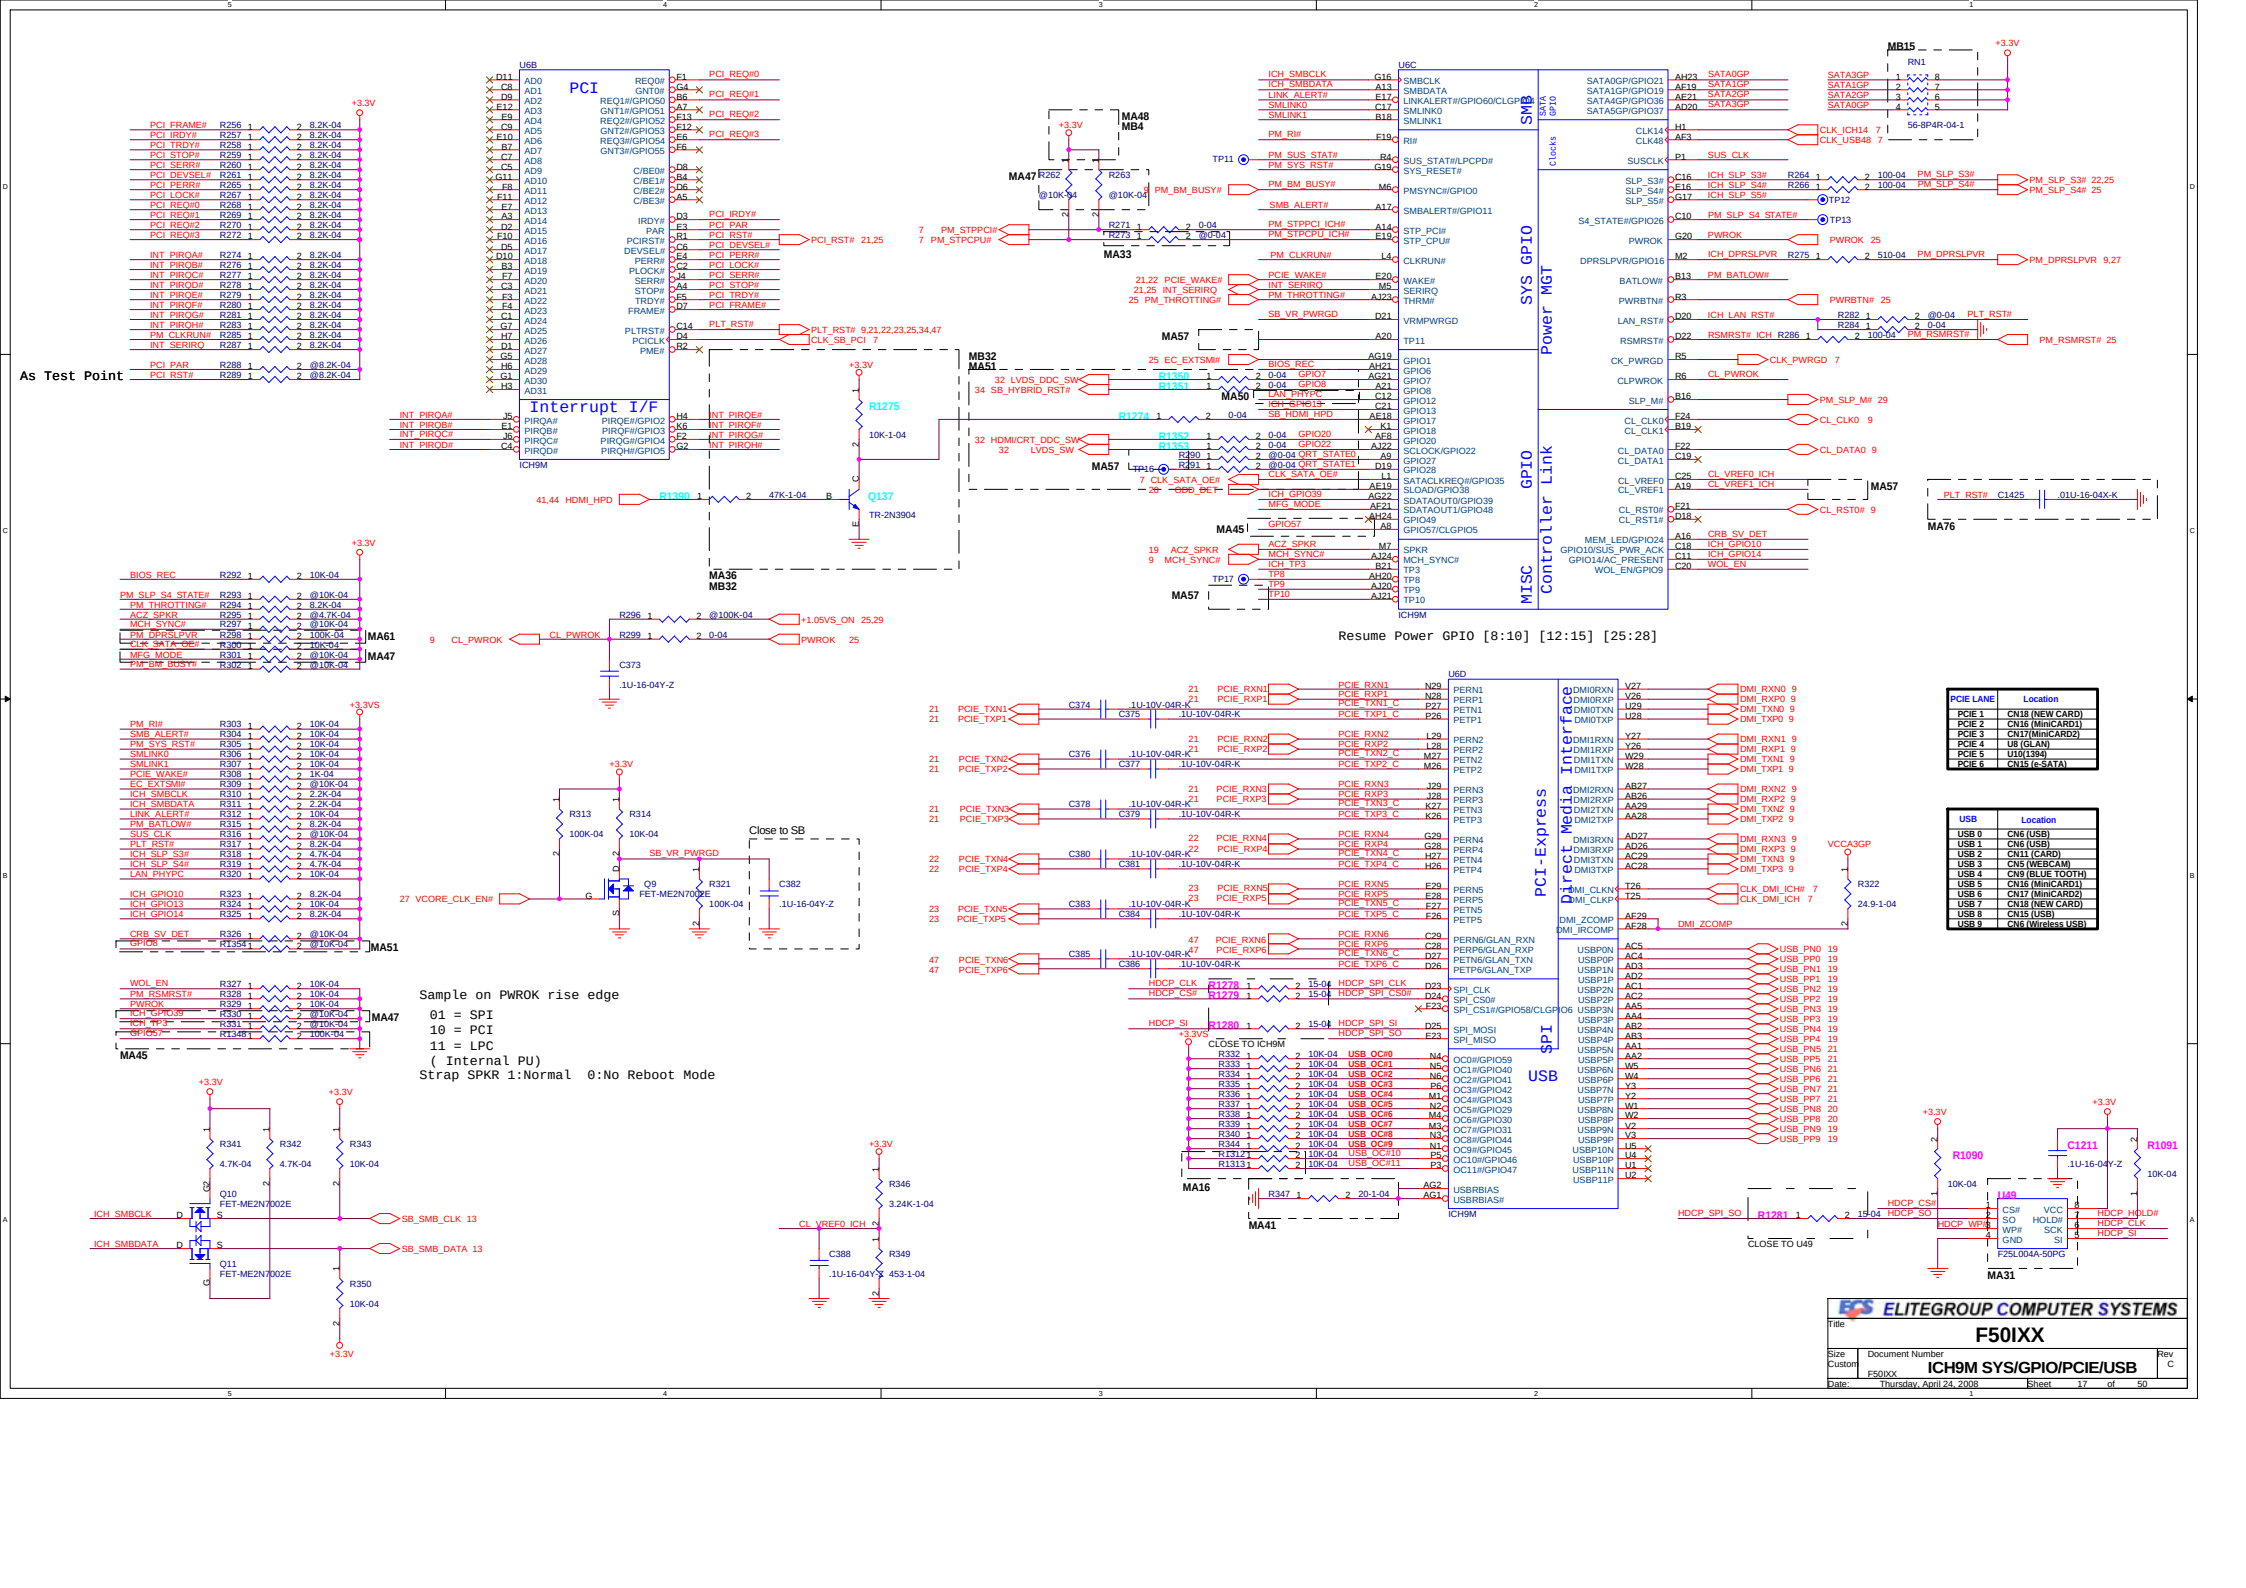
As Test Point
Resume Power GPIO [8:10] [12:15] [25:28]
Sample on PWROK rise edge
01 = SPI
10 = PCI
11 = LPC
(Internal PU)
Strap SPKR 1:Normal 0:No Reboot Mode
Close to SB
CLOSE TO ICH9M
CLOSE TO U49
PCIE LANE | Location
PCIE 1 | CN18 (NEW CARD)
PCIE 2 | CN16 (MiniCARD1)
PCIE 3 | CN17(MiniCARD2)
PCIE 4 | U8 (GLAN)
PCIE 5 | U10(1394)
PCIE 6 | CN15 (e-SATA)
USB | Location
USB 0 | CN6 (USB)
USB 1 | CN6 (USB)
USB 2 | CN11 (CARD)
USB 3 | CN5 (WEBCAM)
USB 4 | CN9 (BLUE TOOTH)
USB 5 | CN16 (MiniCARD1)
USB 6 | CN17 (MiniCARD2)
USB 7 | CN18 (NEW CARD)
USB 8 | CN15 (USB)
USB 9 | CN6 (Wireless USB)
ELITEGROUP COMPUTER SYSTEMS
F50IXX
ICH9M SYS/GPIO/PCIE/USB
Size Custom
Document Number F50IXX
Rev C
Date: Thursday, April 24, 2008
Sheet 17 of 50

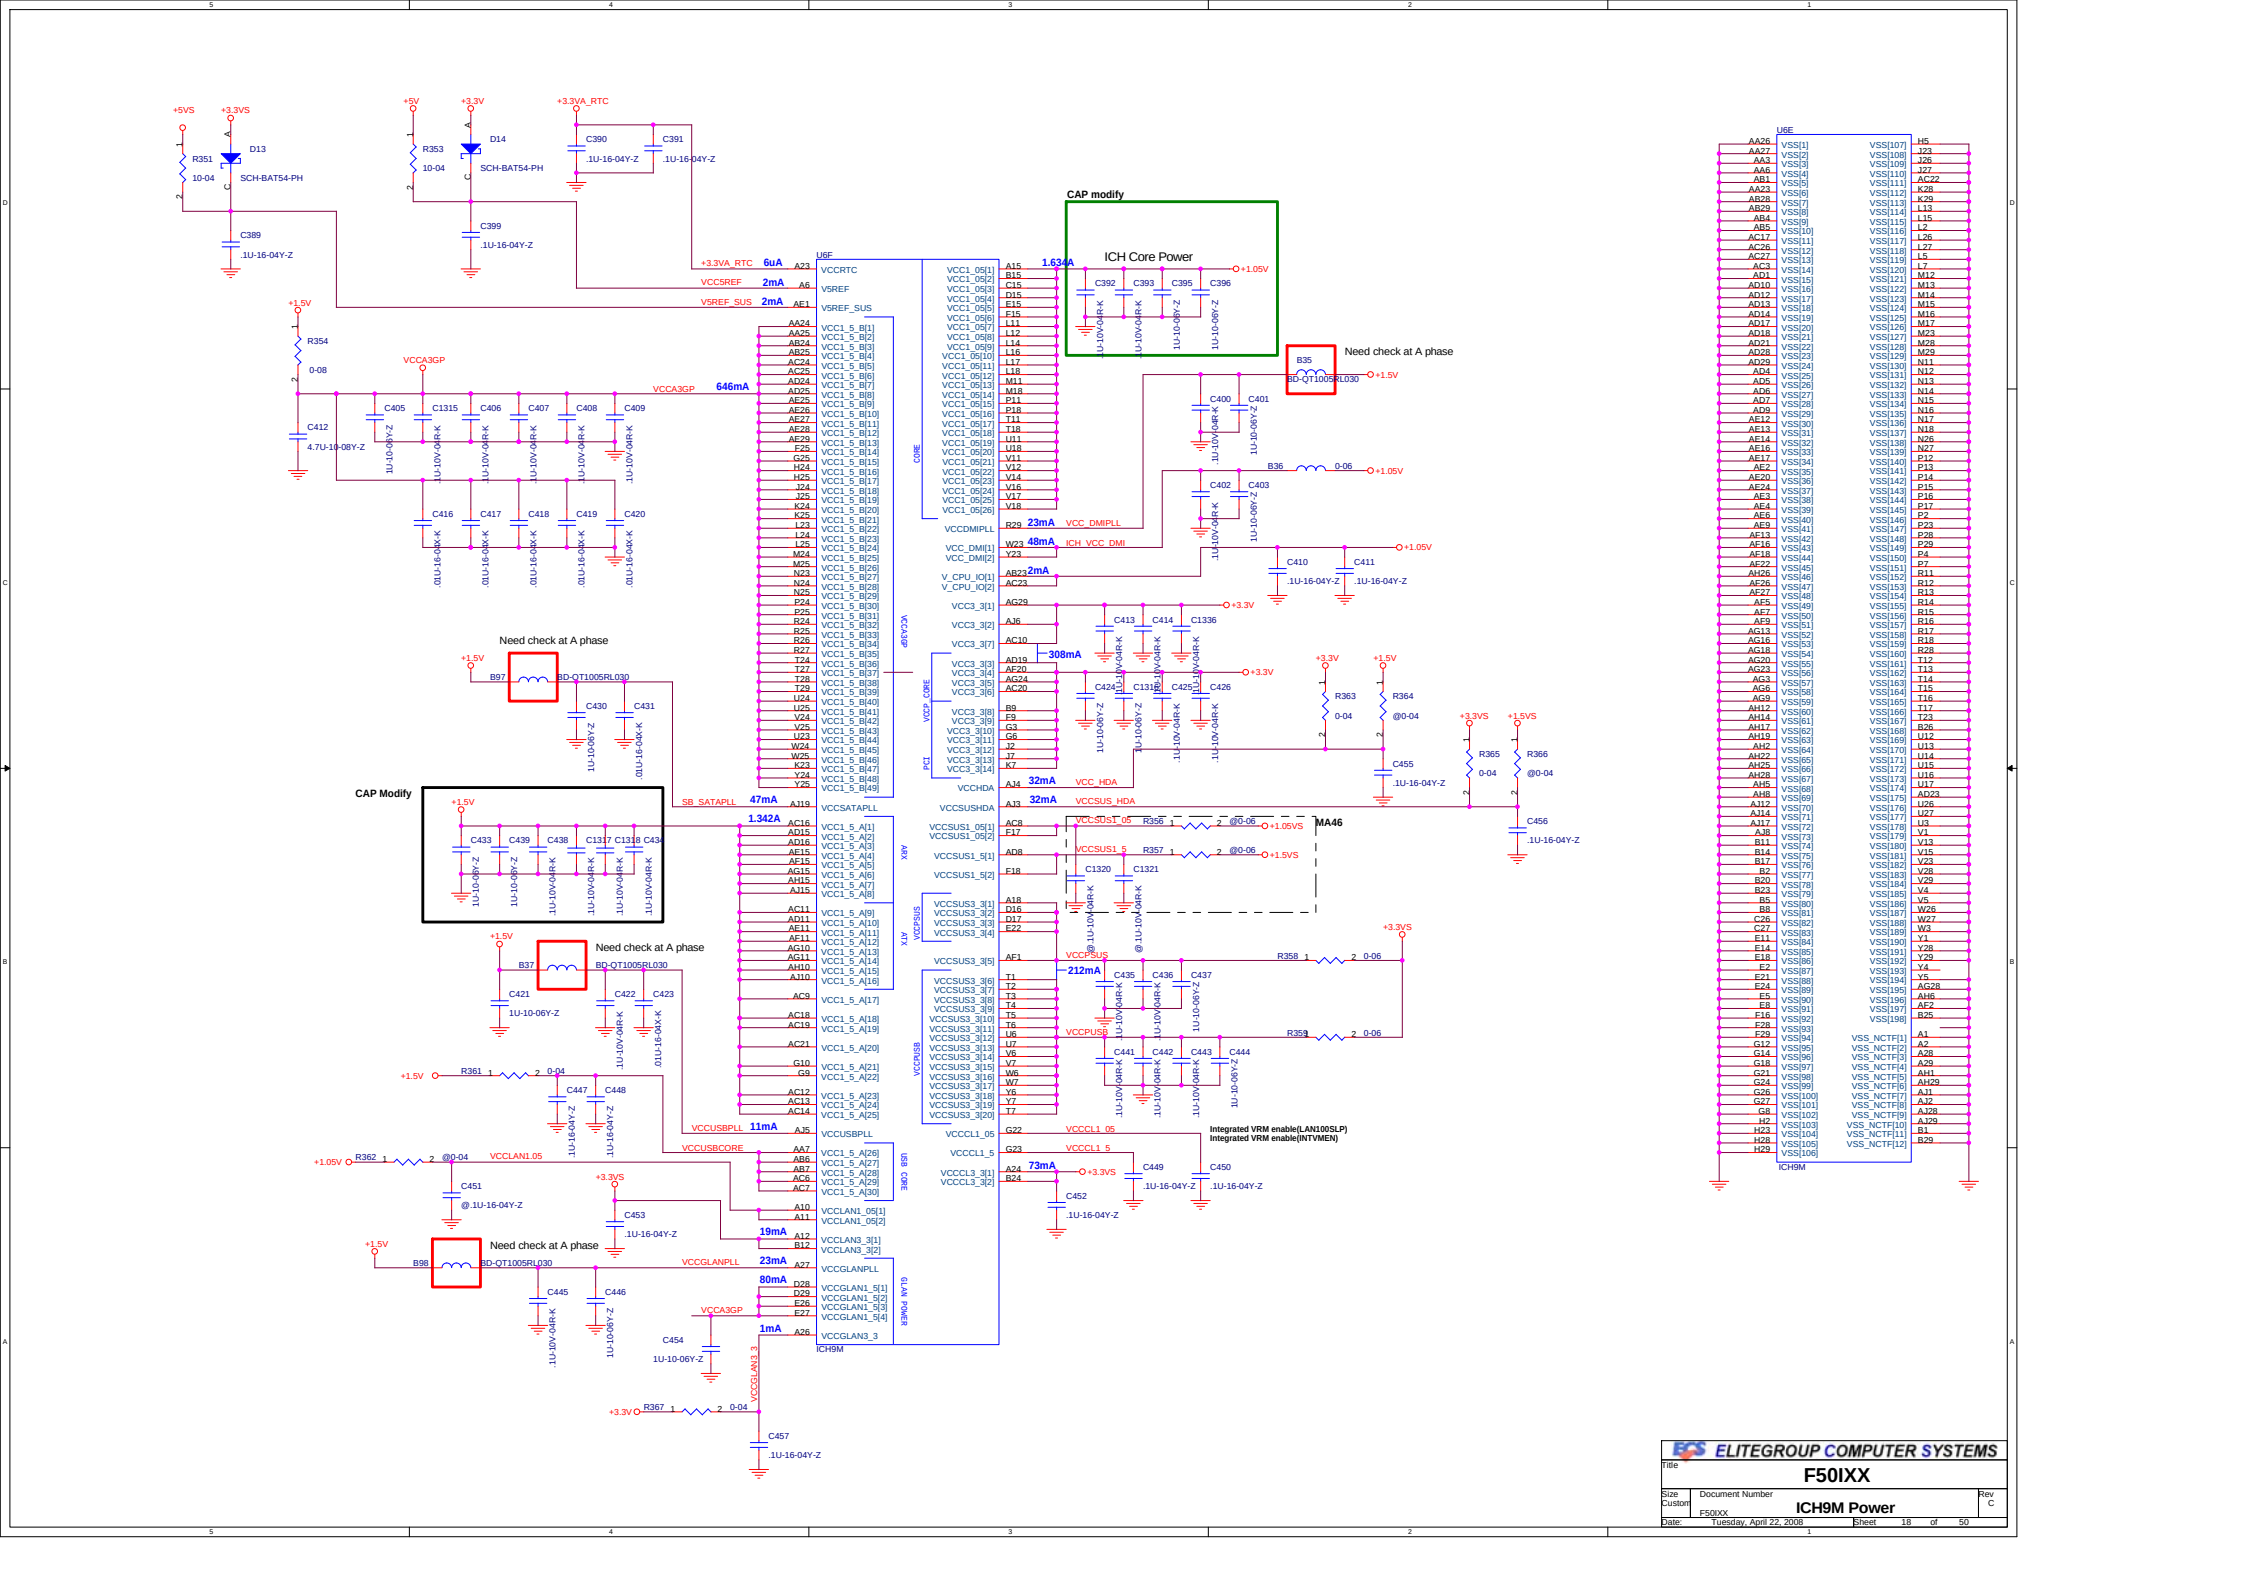
CAP modify
ICH Core Power
Need check at A phase
CAP Modify
Integrated VRM enable(LAN100SLP)
Integrated VRM enable(INTVMEN)
ELITEGROUP COMPUTER SYSTEMS
F50IXX
ICH9M Power
Tuesday, April 22, 2008

LED CON

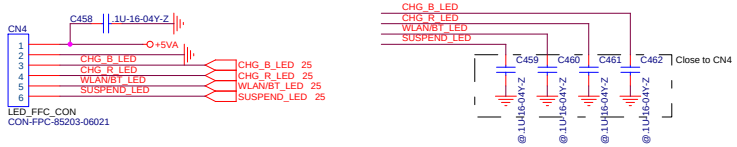

USB CON

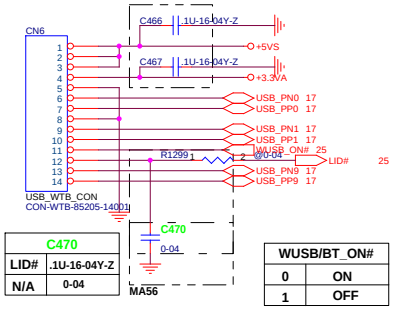

C470	
LID#	.1U-16-04Y-Z
N/A	0-04

WUSB/BT_ON#	
0	ON
1	OFF

D/A MIC CON

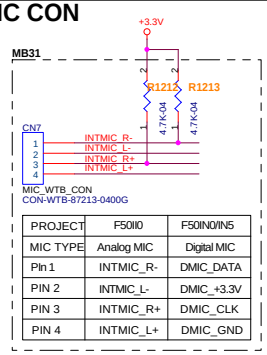

PROJECT	F50II0	F50IN0/IN5
MIC TYPE	Analog MIC	Digital MIC
Pin 1	INTMIC_R-	DMIC_DATA
PIN 2	INTMIC_L-	DMIC_+3.3V
PIN 3	INTMIC_R+	DMIC_CLK
PIN 4	INTMIC_L+	DMIC_GND

SW / MMB CON

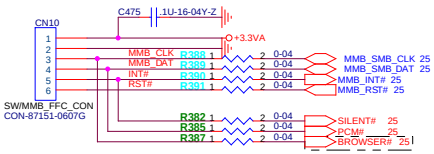

Resirtor Option	
F50II0/IN0	R382,R385,R387
F50IN5	R388,R389,R390,R391

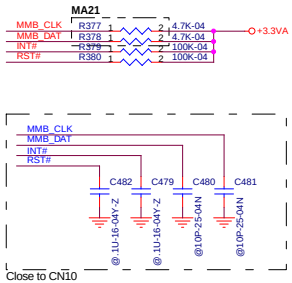

Audio CON

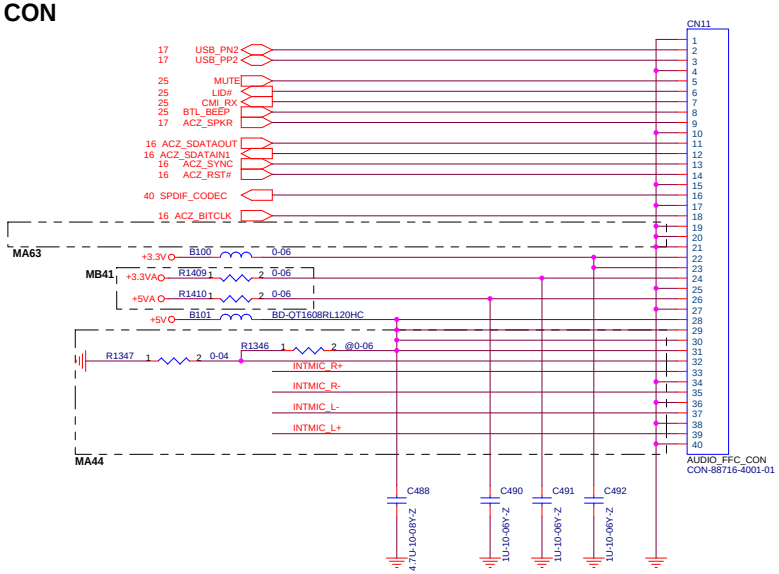

WEBCAM CON

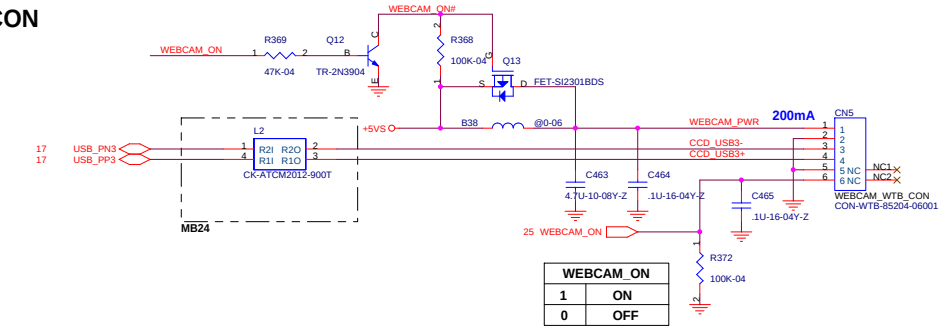

WEBCAM_ON	
1	ON
0	OFF

BLUETOOTH CON

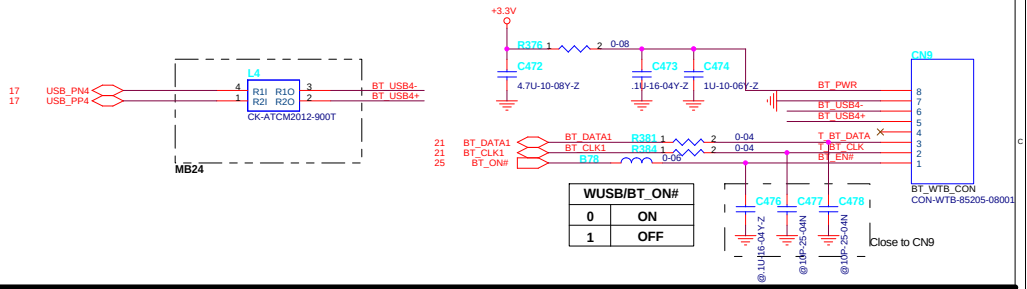

WUSB/BT_ON#	
0	ON
1	OFF

INVERTER

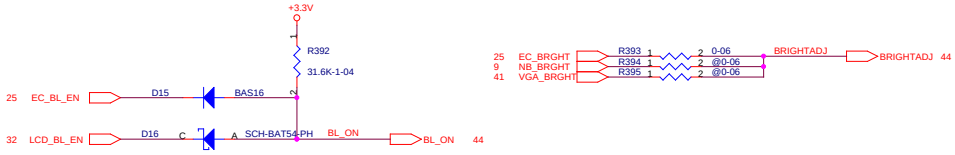

PWR SW

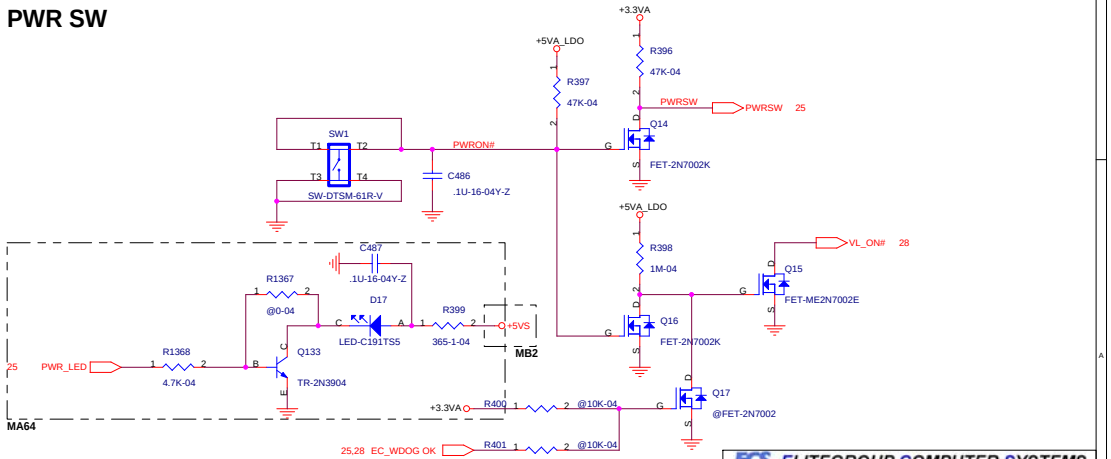

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: PWR SW/IO/INV/WEBCAM/BT CON | Rev: C

F50IXX

Date: Thursday, April 24, 2008 | Sheet 19 of 50

MASTER HDD CON

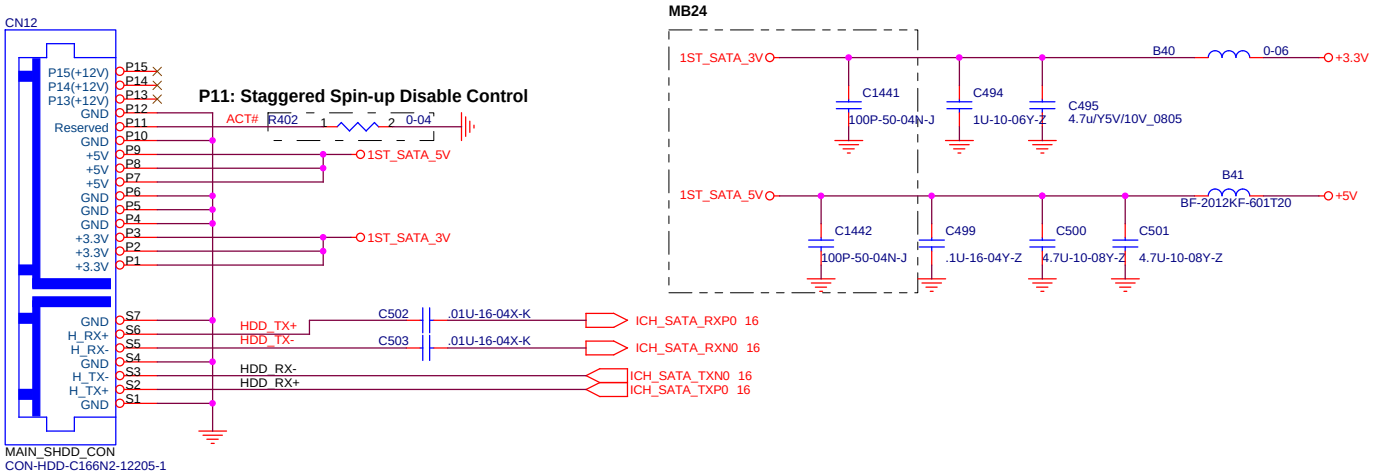

SATA ODD CON

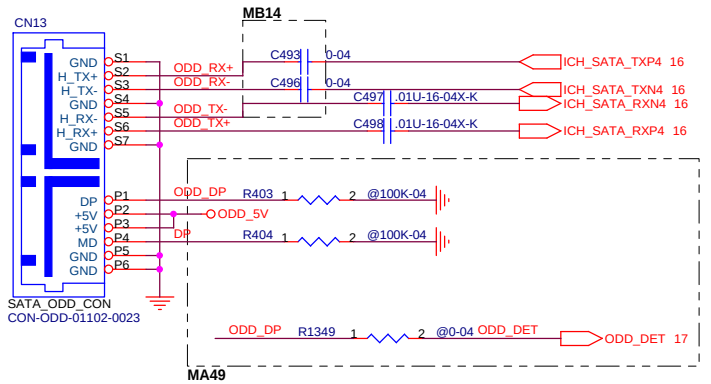

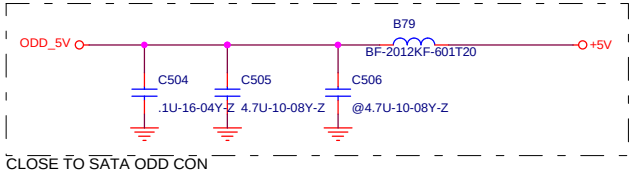

2ND HDD CON

RESERVED FOR 17" 2ND HDD

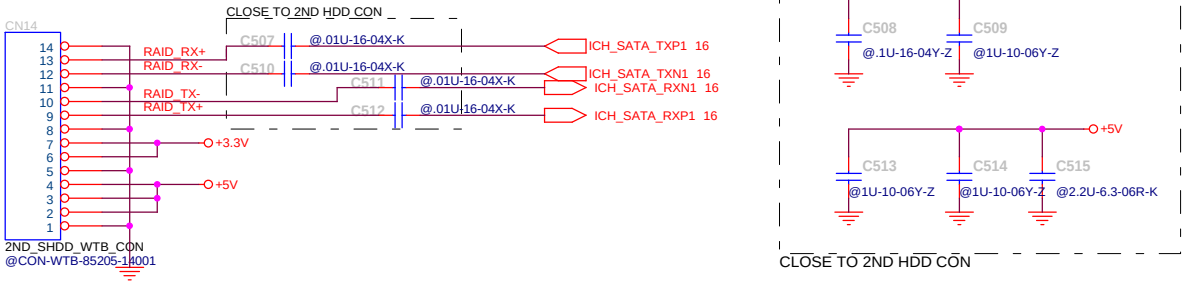

e-SATA CON

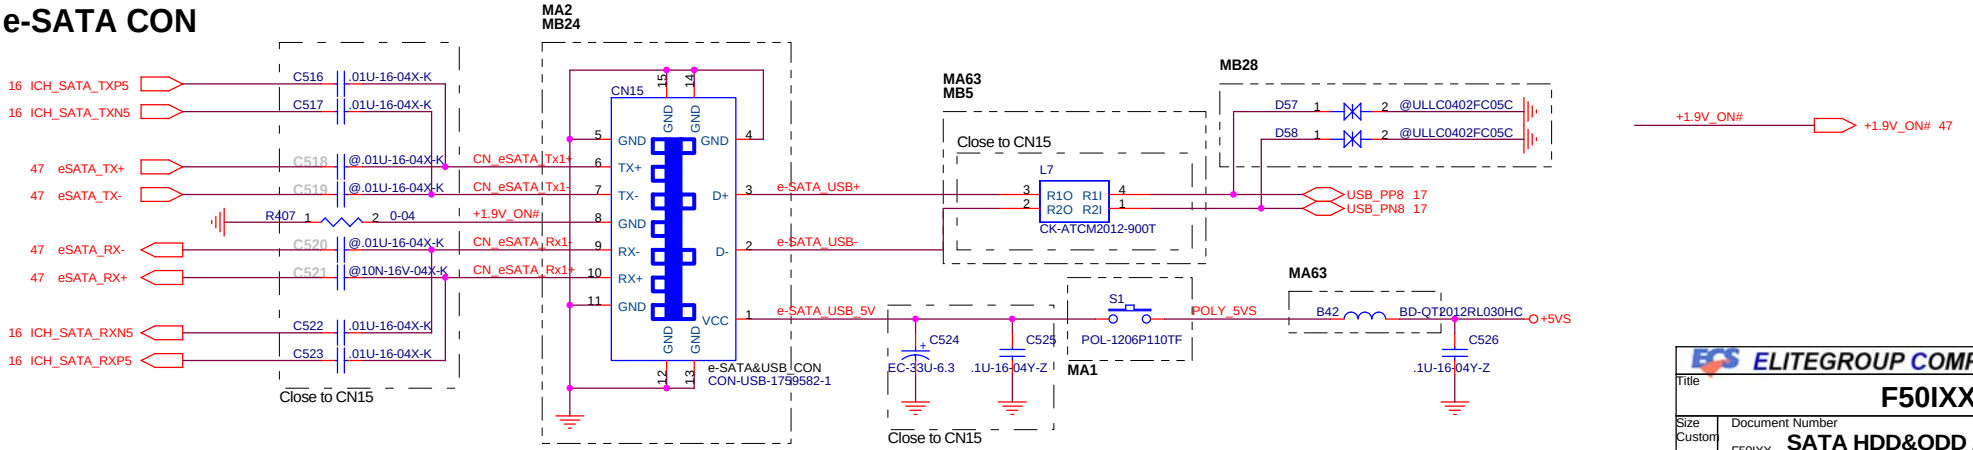

ELITEGROUP COMPUTER SYSTEMS		
Title: F50IXX		
Size: Custom	Document Number: F50IXX SATA HDD&ODD / e-SATA CON	Rev: C
Date: Thursday, April 24, 2008	Sheet 20 of 50	

MINI CARD CON

Intel PRO/Wireless 2100 LAN

PIN11	LED_WLAN_LINK	Hi(3.3V)	Solid ON 1 flash/3 sec	Associated AP Not Associated with an AP
		Low(0V)	LED OFF	Power OFF or RF_Kill active
PIN12	LED_WLAN_ACT	Hi(3.3V)	Rapid Blinking Slow Blinking	Passing data traffic to AP Beacon traffic to Ap
		Low(0V)	LED OFF	Power OFF or not activity or RF_Kill active
PIN13	HW_RadioXMIT_OFF#	Hi(3.3V)	Enable	Radio transmitter is ON
		Low(0V)	Disable	Radio transmitter turn off

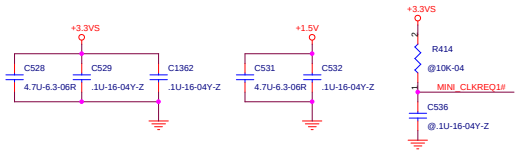

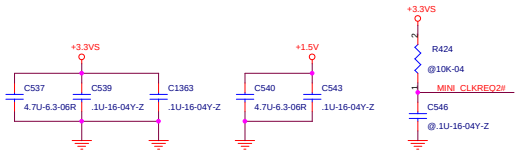

FOR Wireless LAN

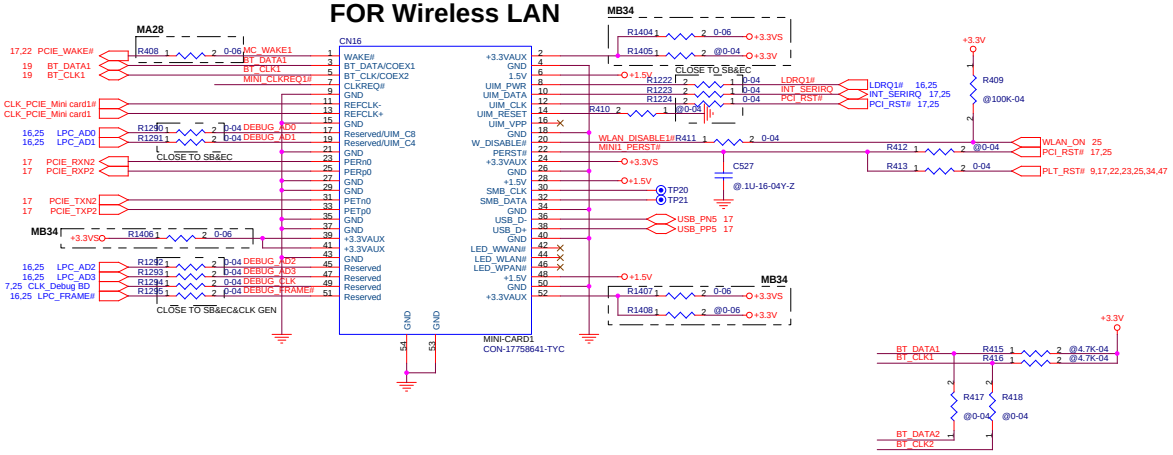

FOR ROBSON

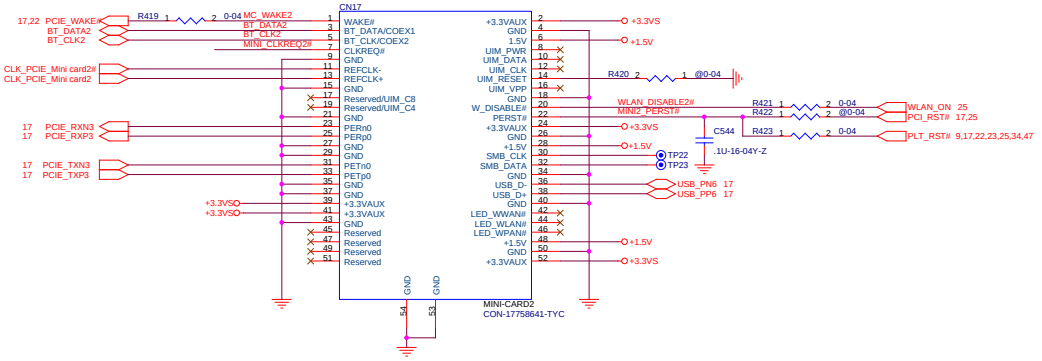

NEW CARD SOCKET

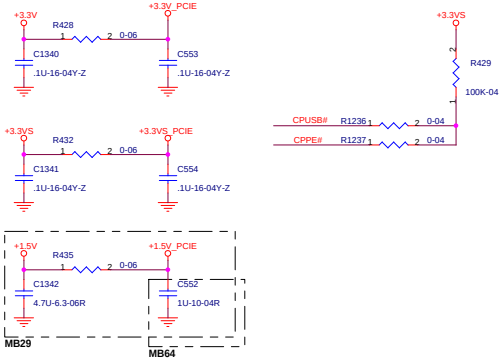

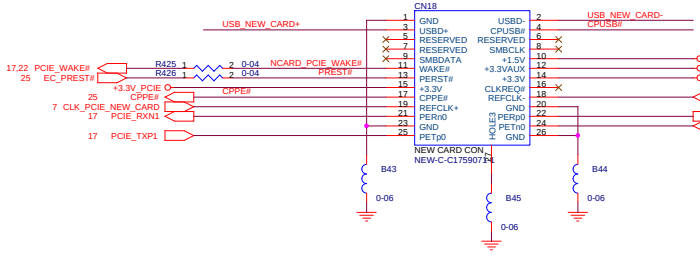

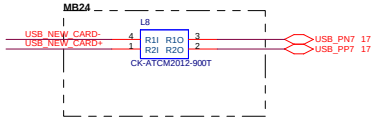

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | Mini Card / New Card CON | Rev: C

Date: Thursday, April 24, 2008 | Sheet 21 of 50

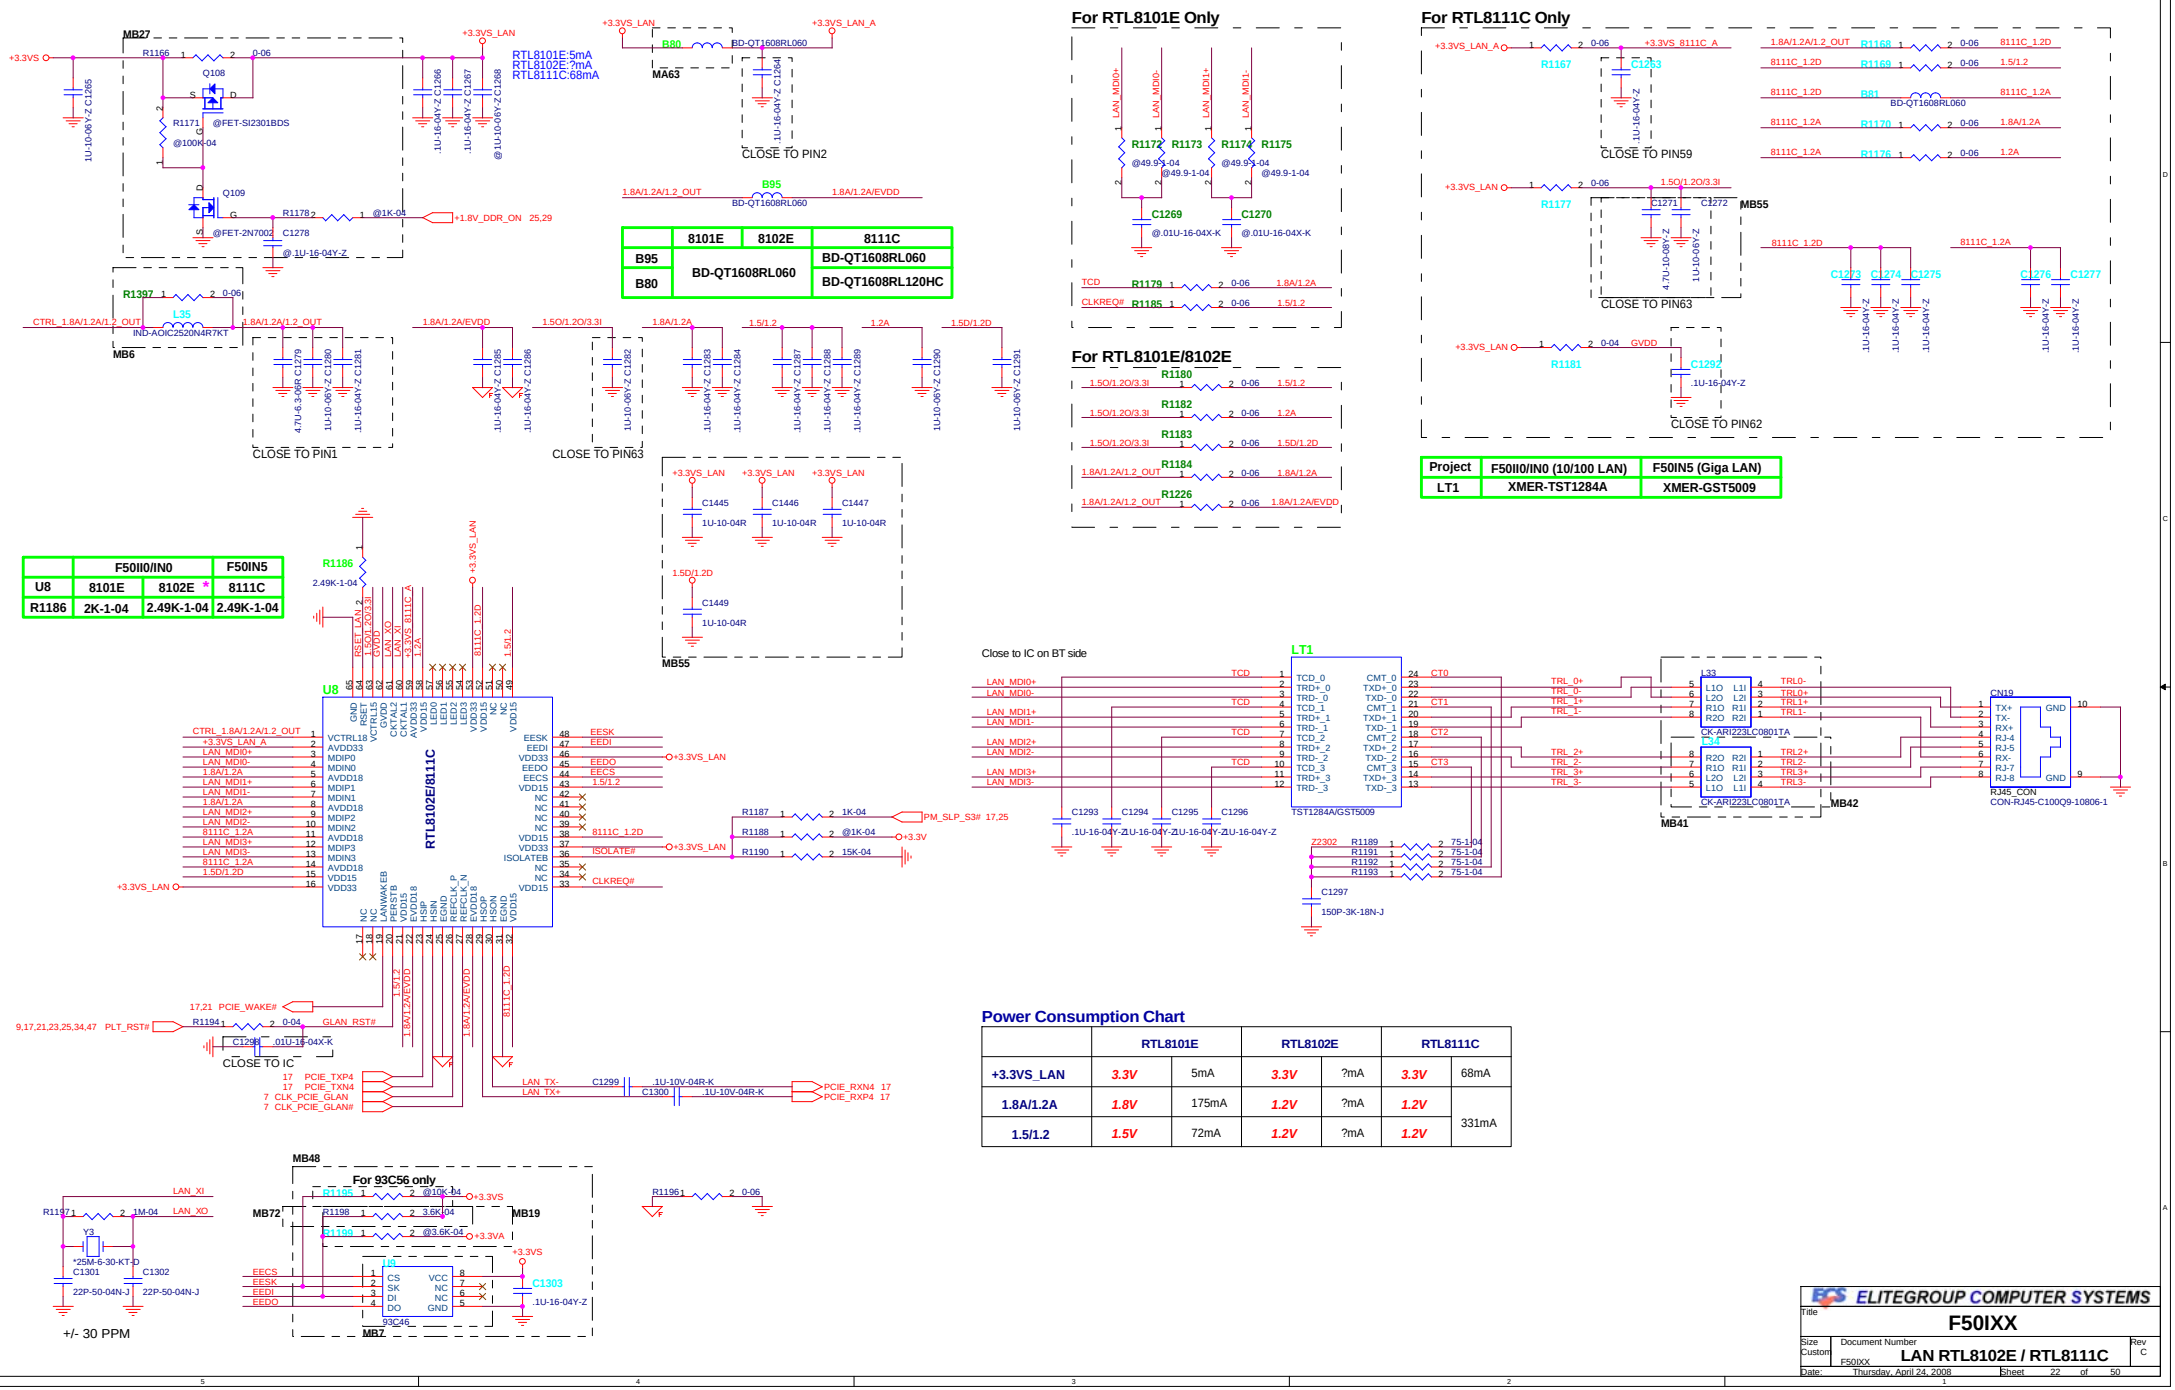

	8101E	8102E	8111C
B95	BD-QT1608RL060		BD-QT1608RL060
B80			BD-QT1608RL120HC

	F50II0/IN0		F50IN5
U8	8101E	8102E *	8111C
R1186	2K-1-04	2.49K-1-04	2.49K-1-04

Project	F50II0/IN0 (10/100 LAN)	F50IN5 (Giga LAN)
LT1	XMER-TST1284A	XMER-GST5009

Power Consumption Chart

	RTL8101E		RTL8102E		RTL8111C	
+3.3VS_LAN	3.3V	5mA	3.3V	?mA	3.3V	68mA
1.8A/1.2A	1.8V	175mA	1.2V	?mA	1.2V	331mA
1.5/1.2	1.5V	72mA	1.2V	?mA	1.2V	

Title	F50IXX
Size	Custom
Document Number	LAN RTL8102E / RTL8111C
Rev	C
Date:	Thursday, April 24, 2008
Sheet	22 of 50

ELITEGROUP COMPUTER SYSTEMS

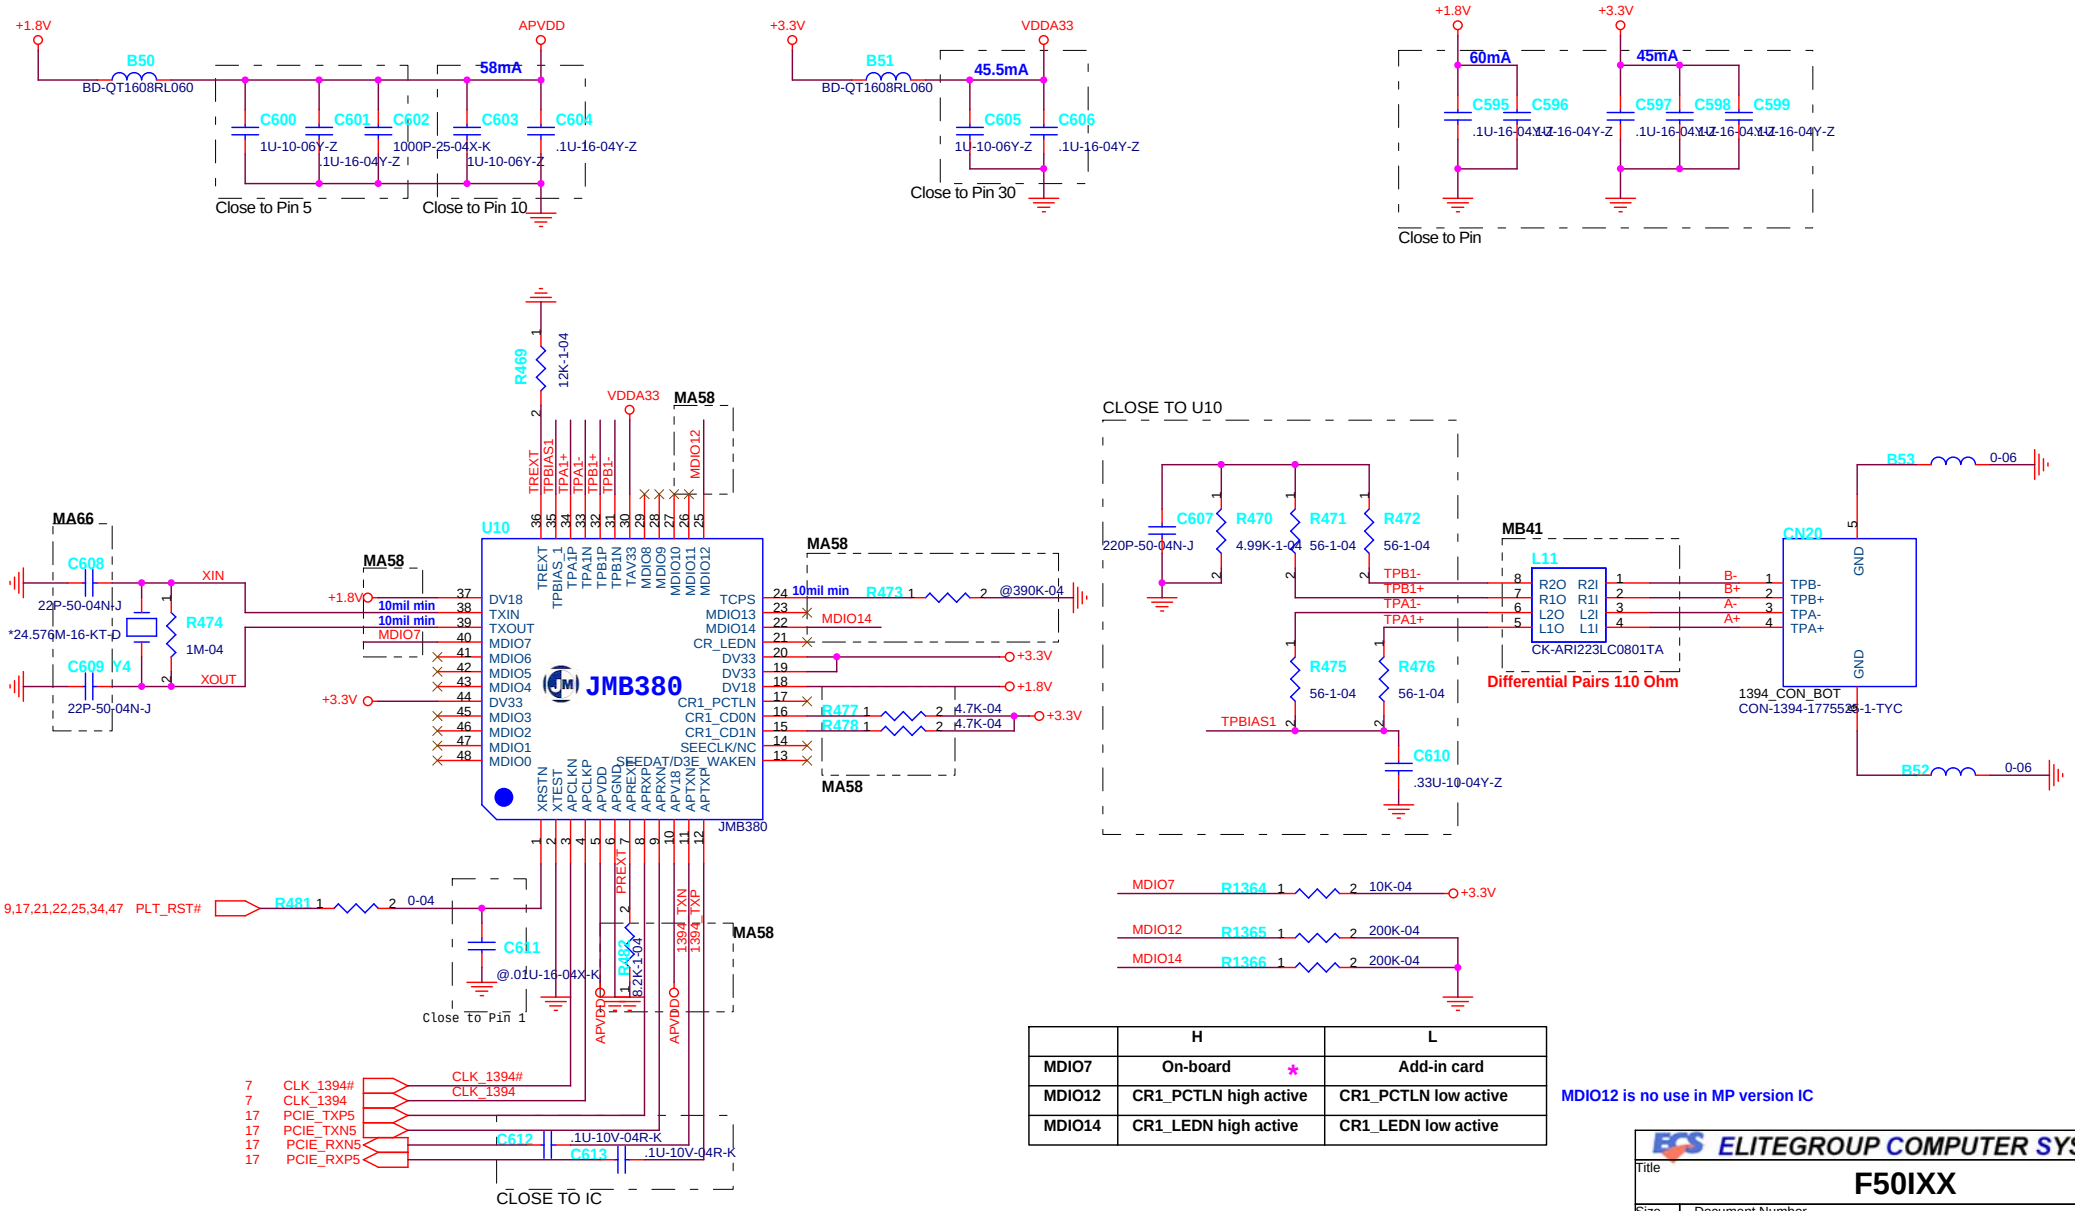

	H	L
MDIO7	On-board *	Add-in card
MDIO12	CR1_PCTLN high active	CR1_PCTLN low active
MDIO14	CR1_LEDN high active	CR1_LEDN low active

MDIO12 is no use in MP version IC

ELITEGROUP COMPUTER SYSTEMS

Title: **F50IXX**

Size: Custom | Document Number: F50IXX **IEEE1394A** | Rev: C

Date: Thursday, April 24, 2008 | Sheet 23 of 50

CPU FAN CONTROL

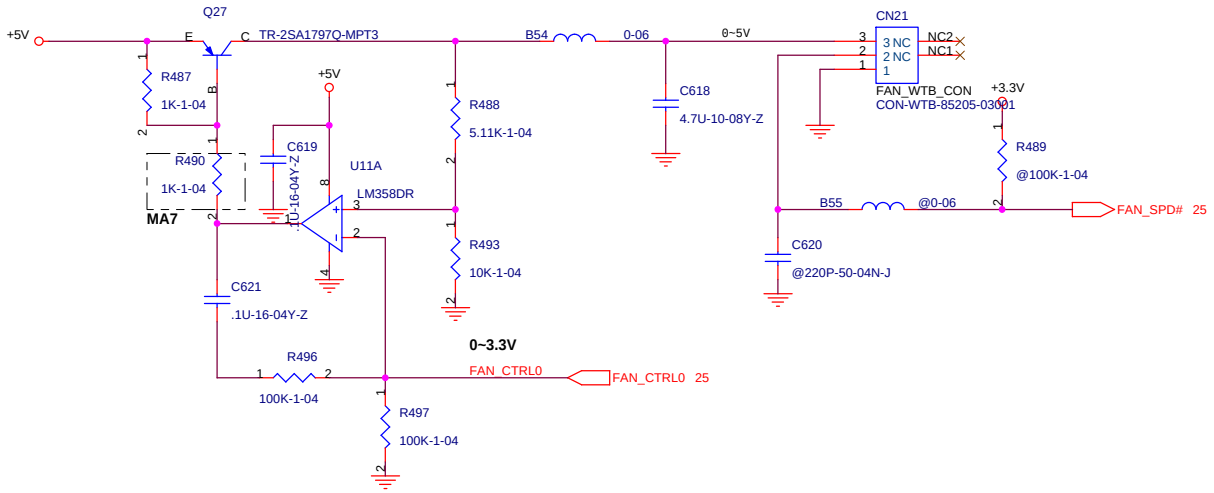

High speed current return path Capacitor

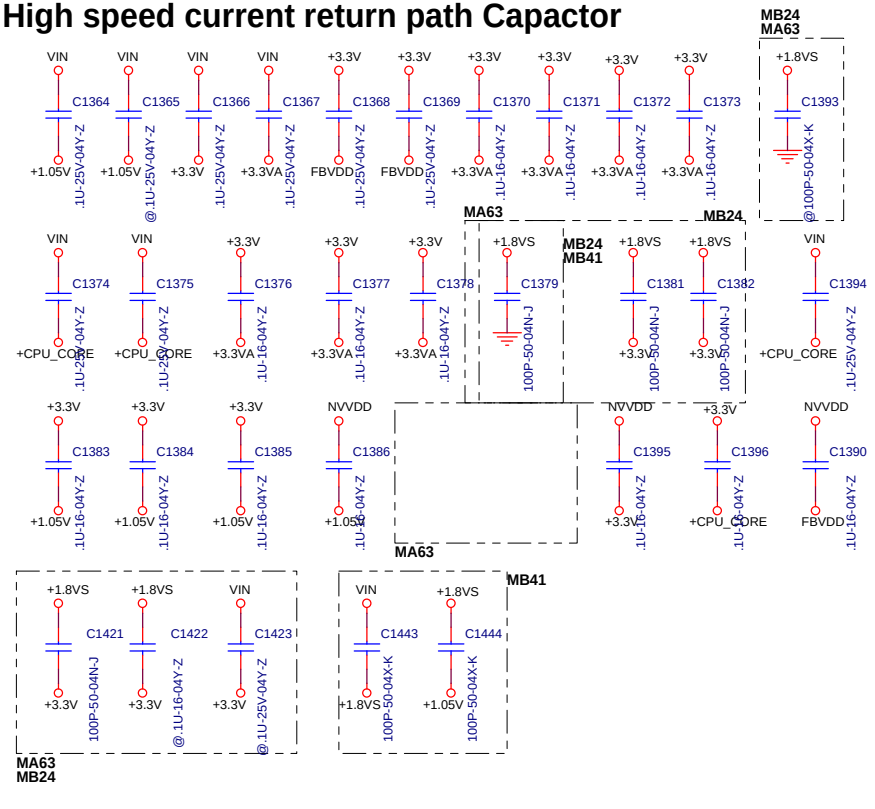

CPU POWER MONITOR

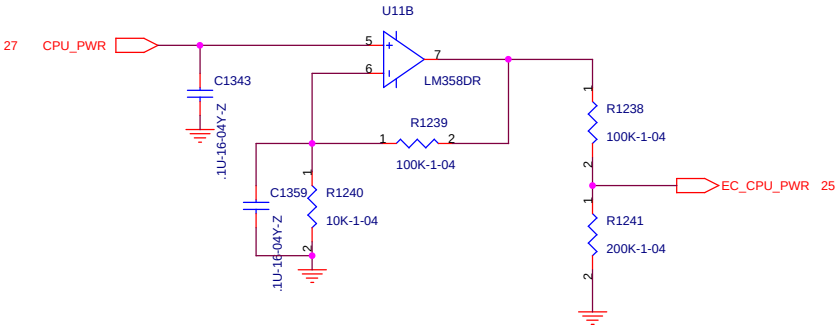

ELITEGROUP COMPUTER SYSTEMS		
Title: F50IXX		
Size: Custom	Document Number: F50IXX — CPU FAN/HSCRP CAP/VCORE SENS	Rev: C
Date: Thursday, April 24, 2008	Sheet 24 of 50	

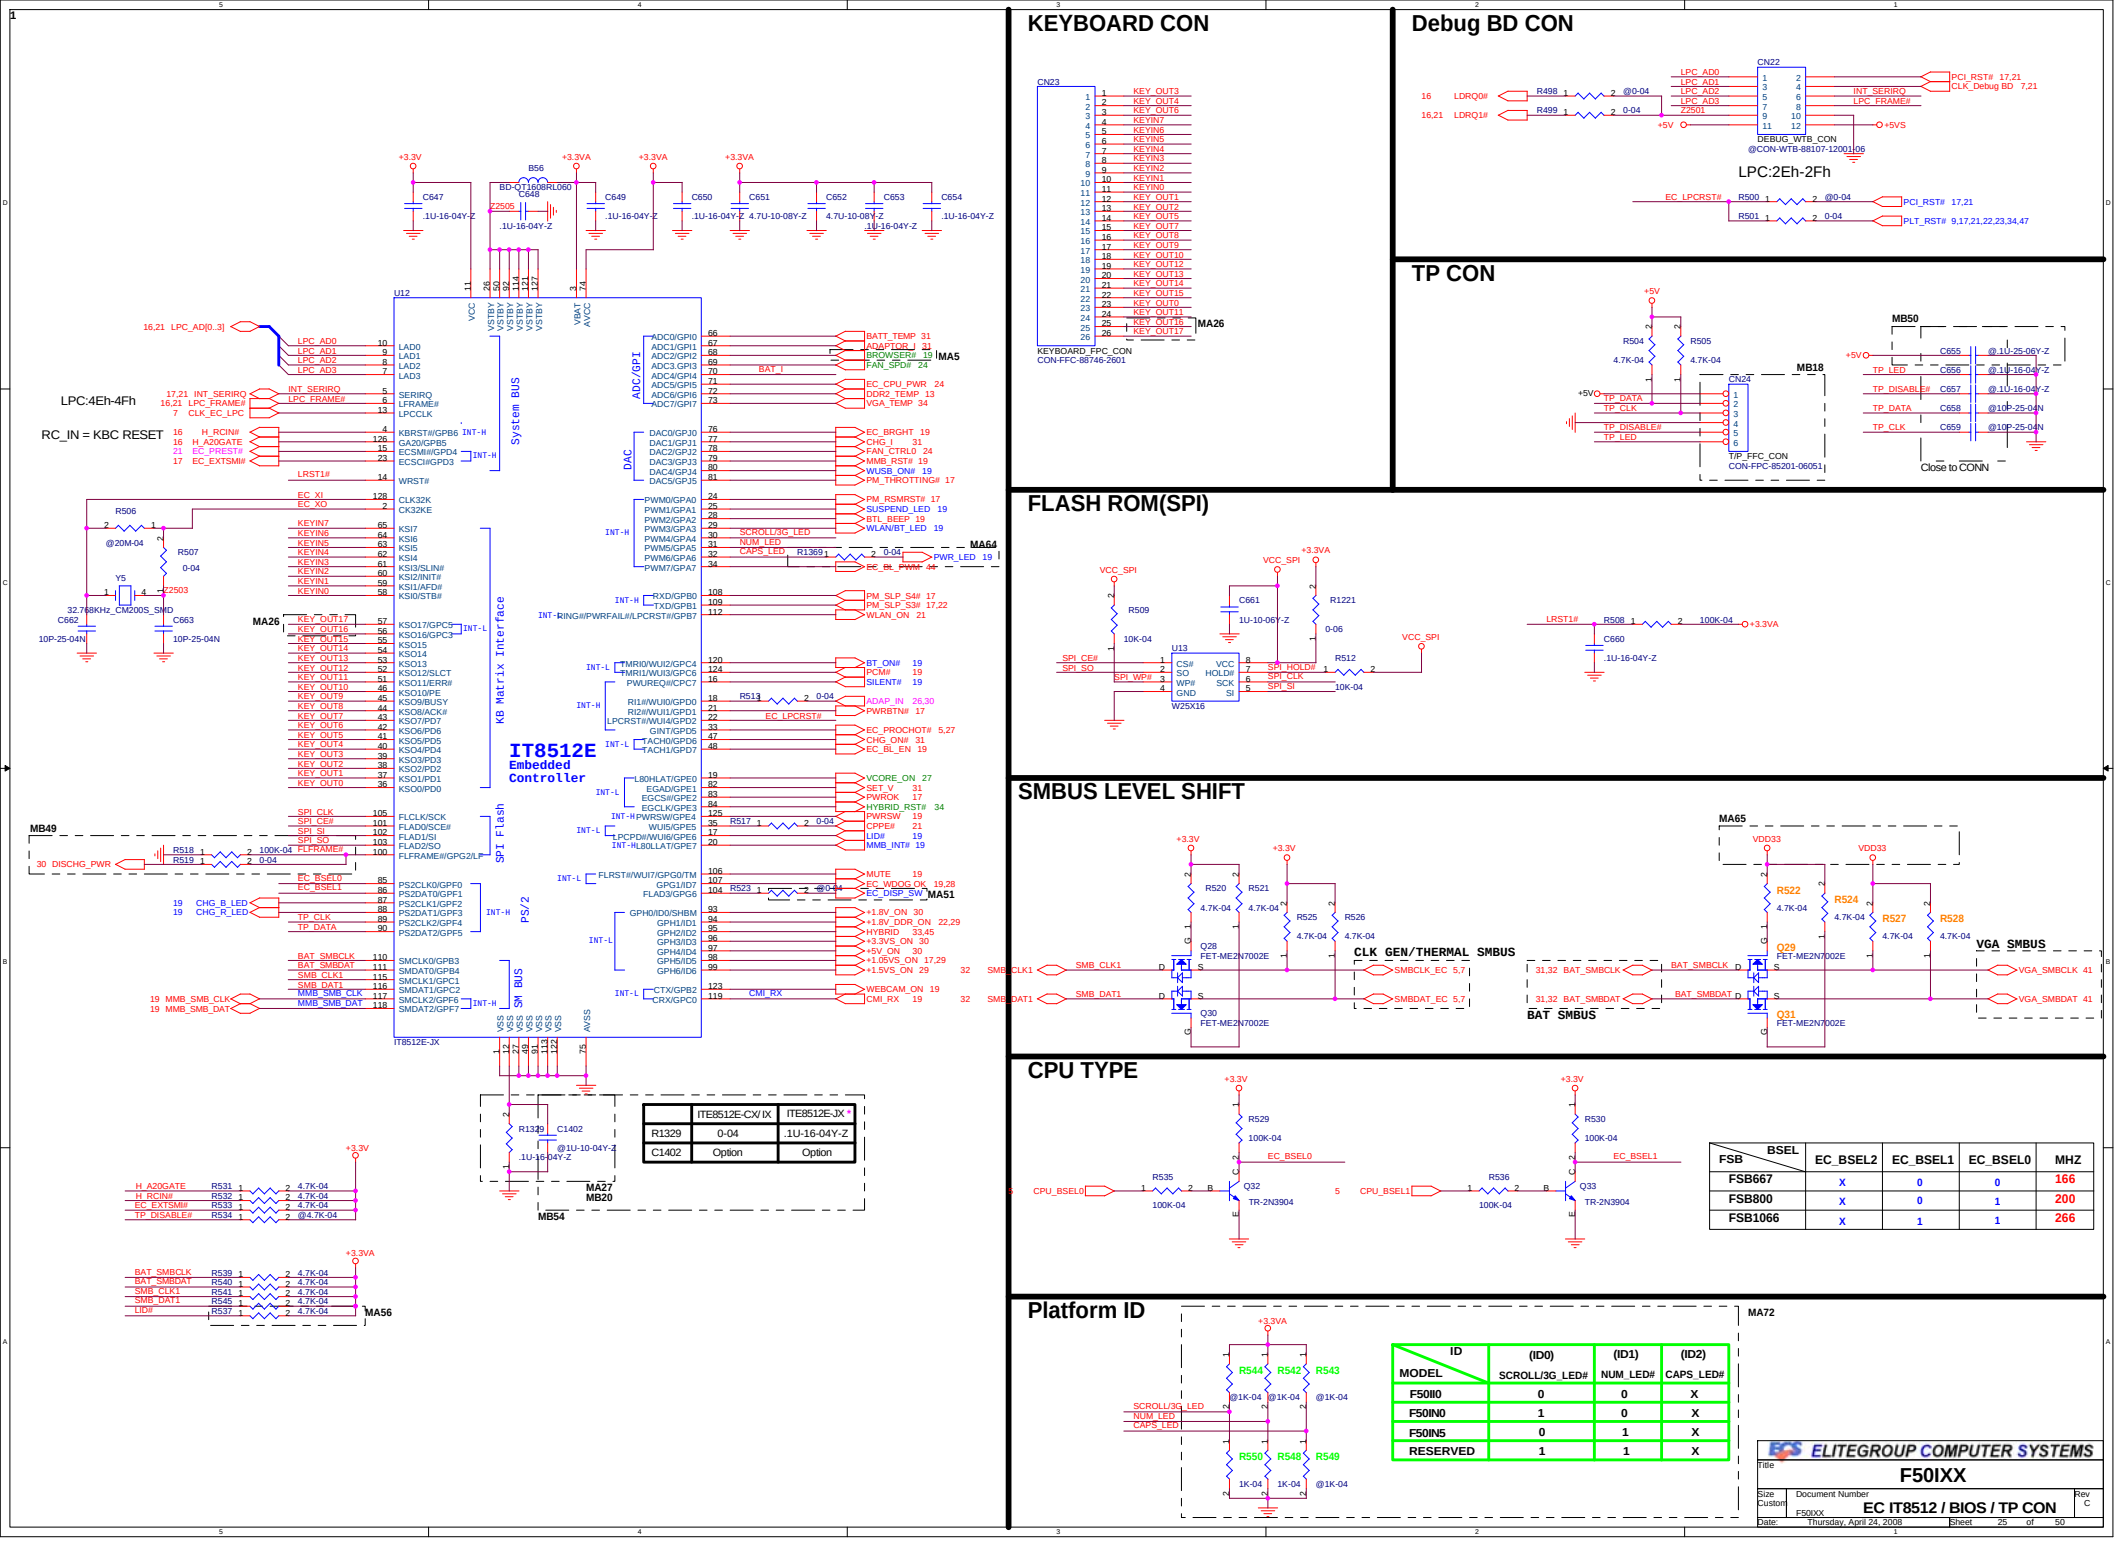

	ITE8512E-CX/ IX	ITE8512E-JX *
R1329	0-04	.1U-16-04Y-Z
C1402	Option	Option

FSB \ BSEL	EC_BSEL2	EC_BSEL1	EC_BSEL0	MHZ
FSB667	X	0	0	166
FSB800	X	0	1	200
FSB1066	X	1	1	266

ID / MODEL	(ID0) SCROLL/3G_LED#	(ID1) NUM_LED#	(ID2) CAPS_LED#
F50II0	0	0	X
F50IN0	1	0	X
F50IN5	0	1	X
RESERVED	1	1	X

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50XX | EC IT8512 / BIOS / TP CON | Rev: C

Date: Thursday, April 24, 2008 | Sheet 25 of 50

PROJECT	F50II0	F50IN0	F50IN5
Adaptor	65W	90W	120W
Rsense	33m Ohm	25m Ohm	18m Ohm
Stop Charger	60W	80W	110W

DC IN

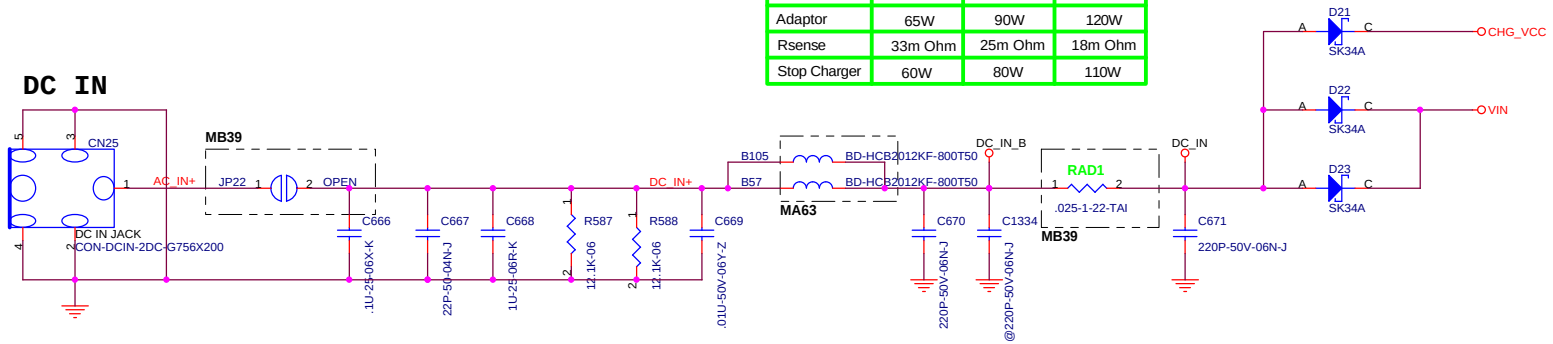

DDR Terminatation

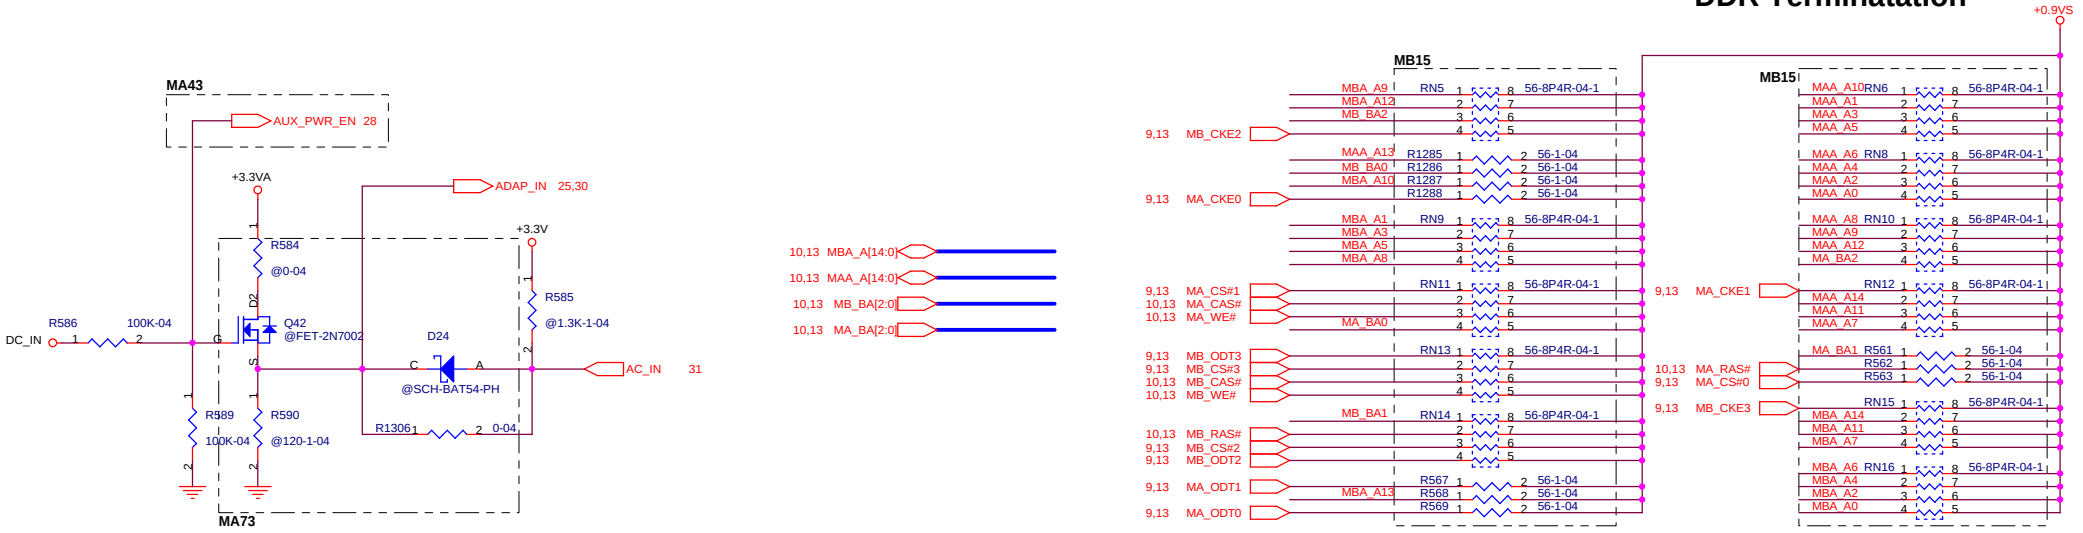

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | DC IN / SYS MEM TERMINATION | Rev: C

Date: Thursday, April 24, 2008 | Sheet 26 of 50

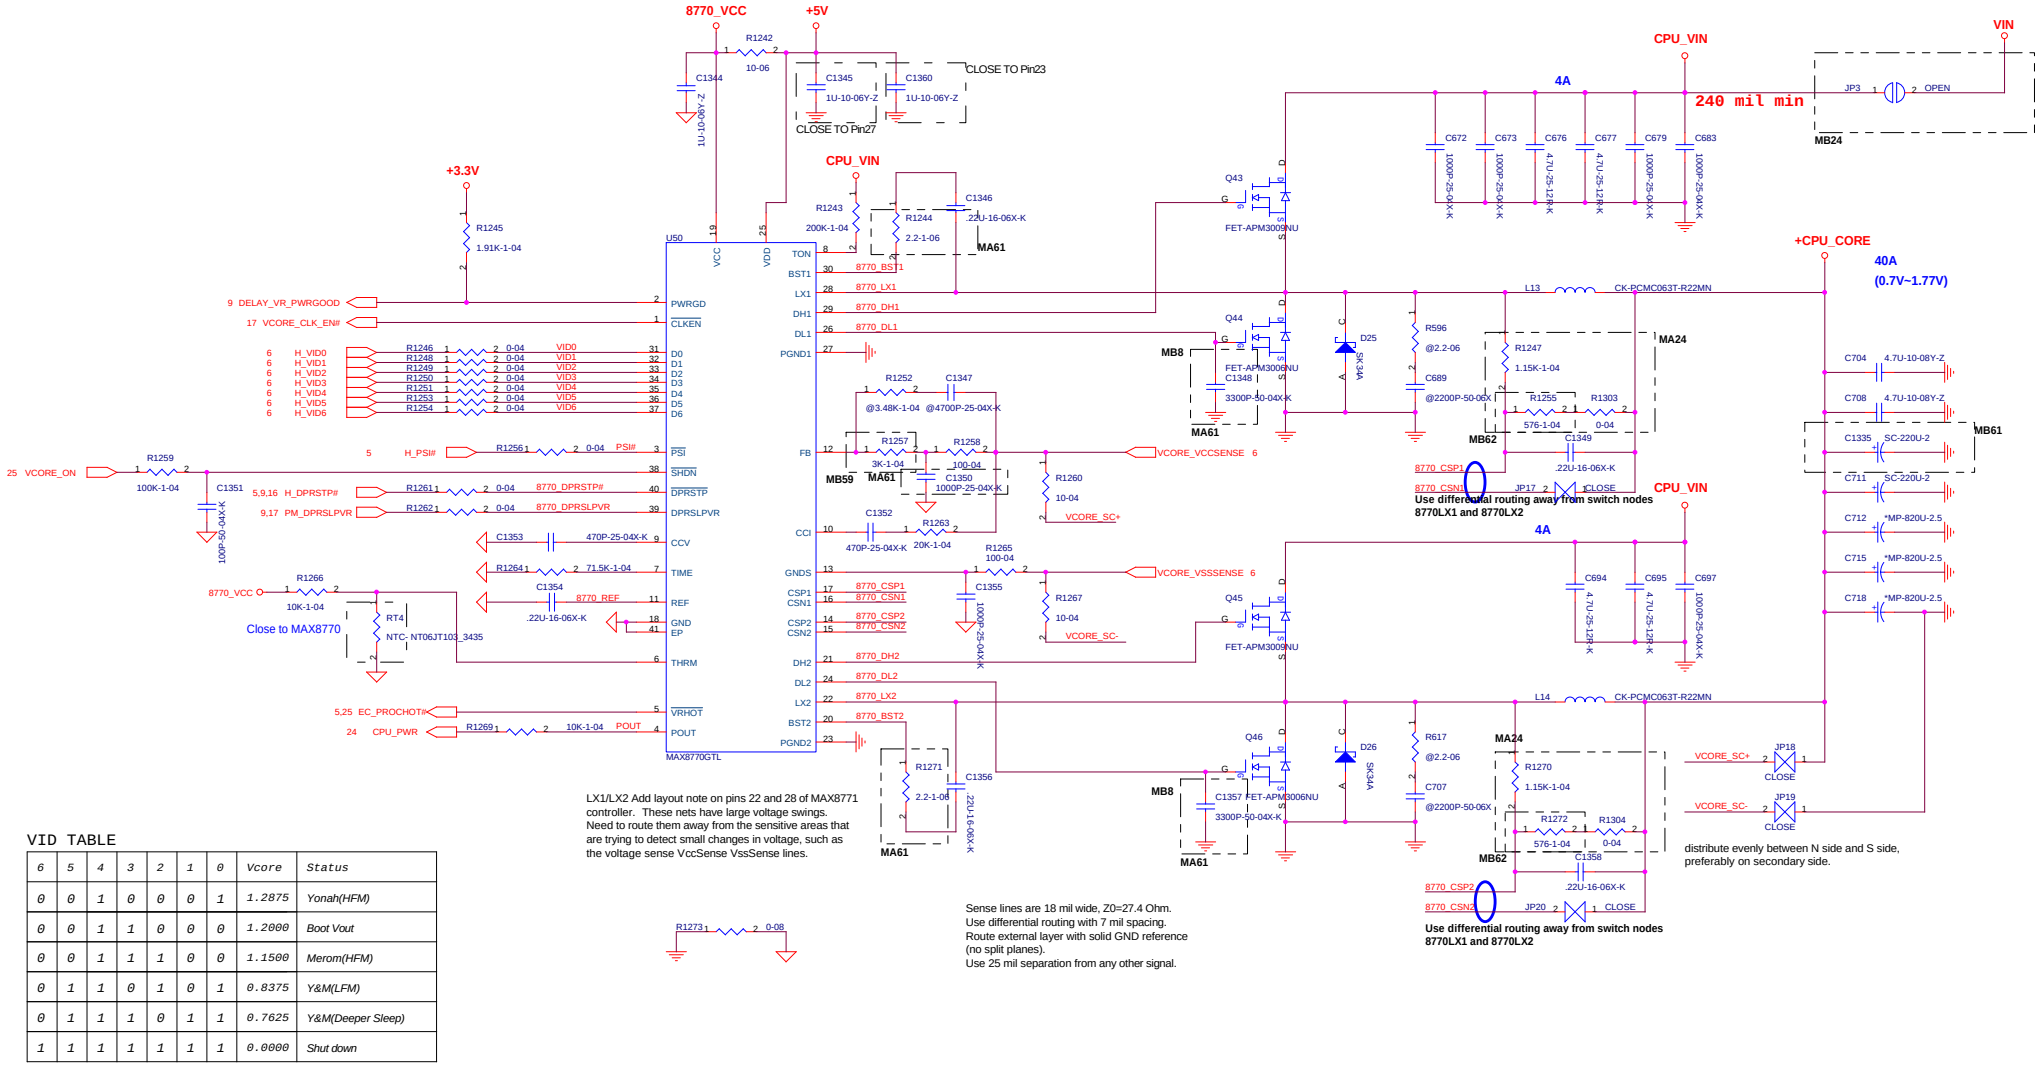

VID TABLE

6	5	4	3	2	1	0	Vcore	Status
0	0	1	0	0	0	1	1.2875	Yonah(HFM)
0	0	1	1	0	0	0	1.2000	Boot Vout
0	0	1	1	1	0	0	1.1500	Merom(HFM)
0	1	1	0	1	0	1	0.8375	Y&M(LFM)
0	1	1	1	0	1	1	0.7625	Y&M(Deeper Sleep)
1	1	1	1	1	1	1	0.0000	Shut down

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: CPU CORE	Rev: C
Date: Thursday, April 24, 2008	Sheet 27 of 50	

Output Voltage =[Vref x R2/(R1+R2)] x 2

+3V/+5V_ON Voltage	Mode
<0.4V	OFF
>0.6V	PWM
>2.1V	SKIP

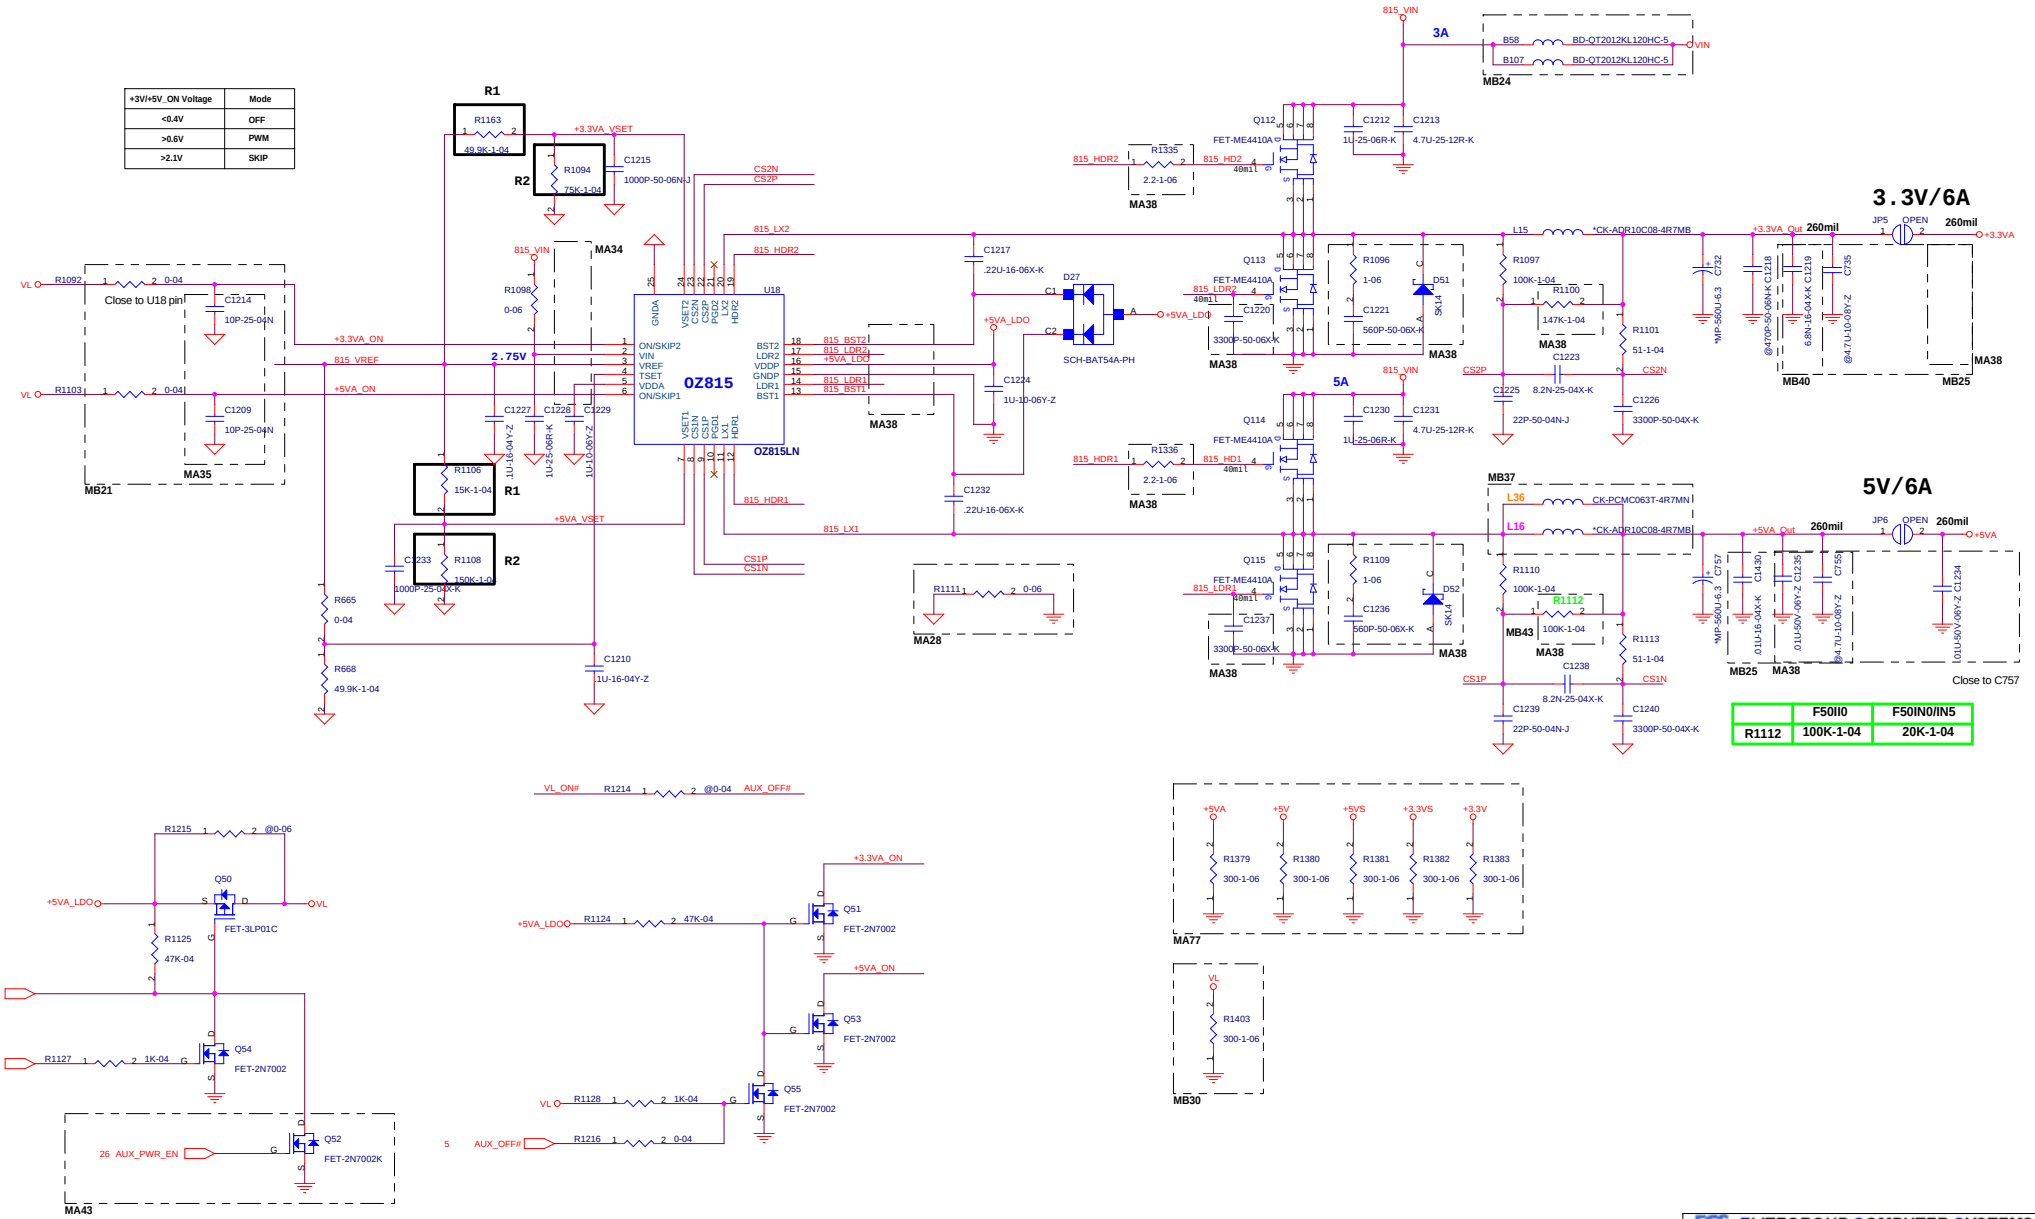

	F50II0	F50IN0/IN5
R1112	100K-1-04	20K-1-04

Title	F50IXX
Size / Custom	Document Number: F50IXX
	+3.3VA / +5VA
Rev	C
Date:	Thursday, April 24, 2008
Sheet	28 of 50

ELITEGROUP COMPUTER SYSTEMS

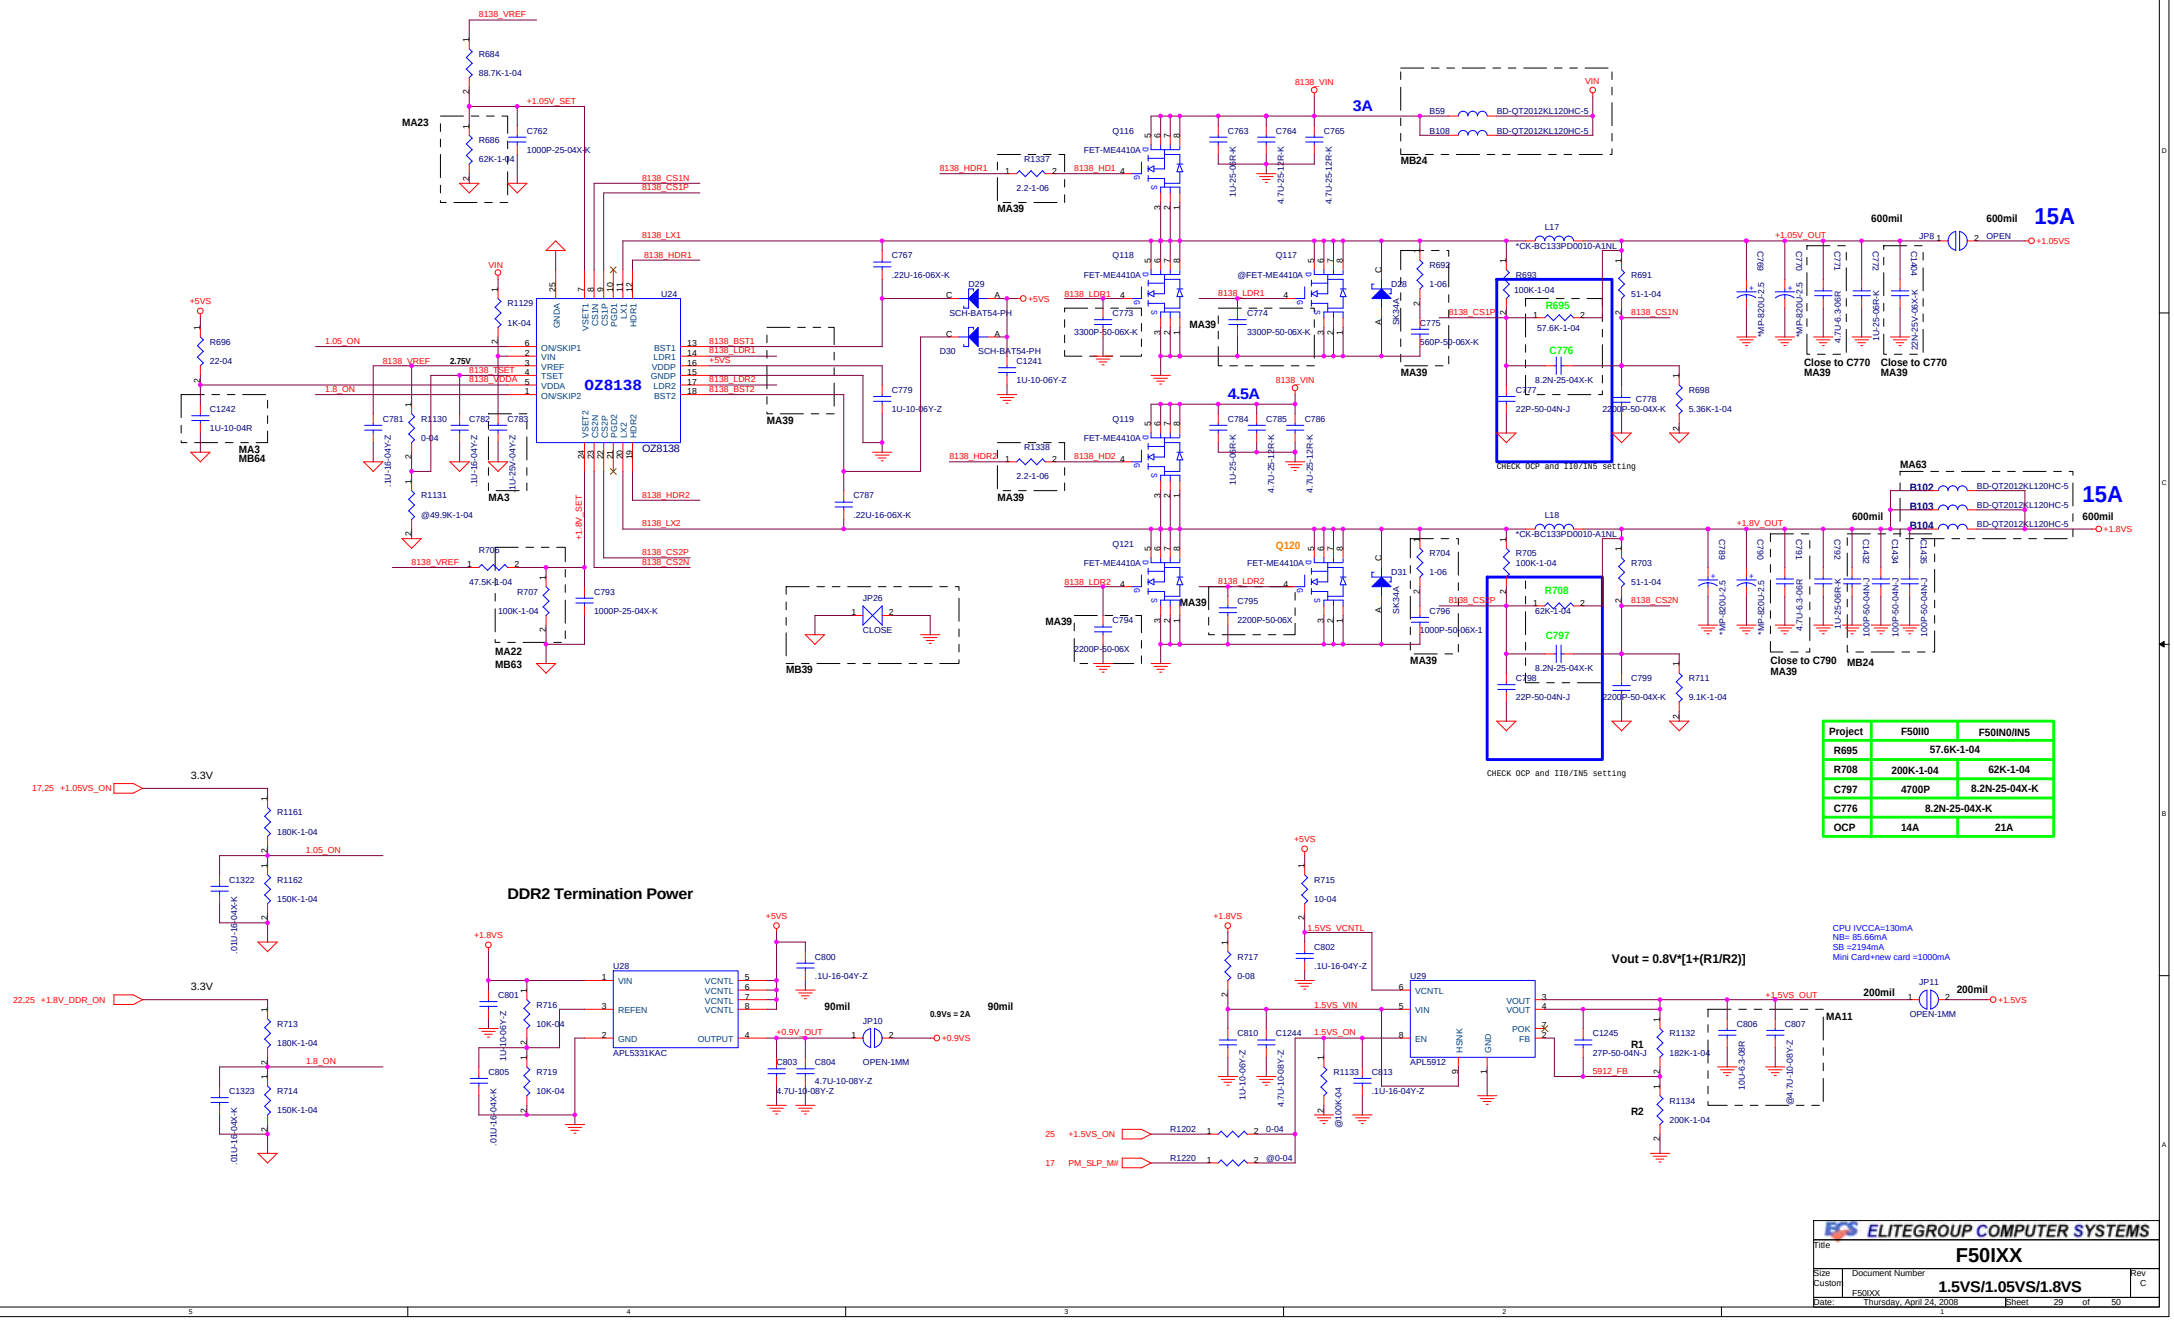

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: 1.5VS/1.05VS/1.8VS | Rev: C

F50IXX

Date: Thursday, April 24, 2008 | Sheet 29 of 50

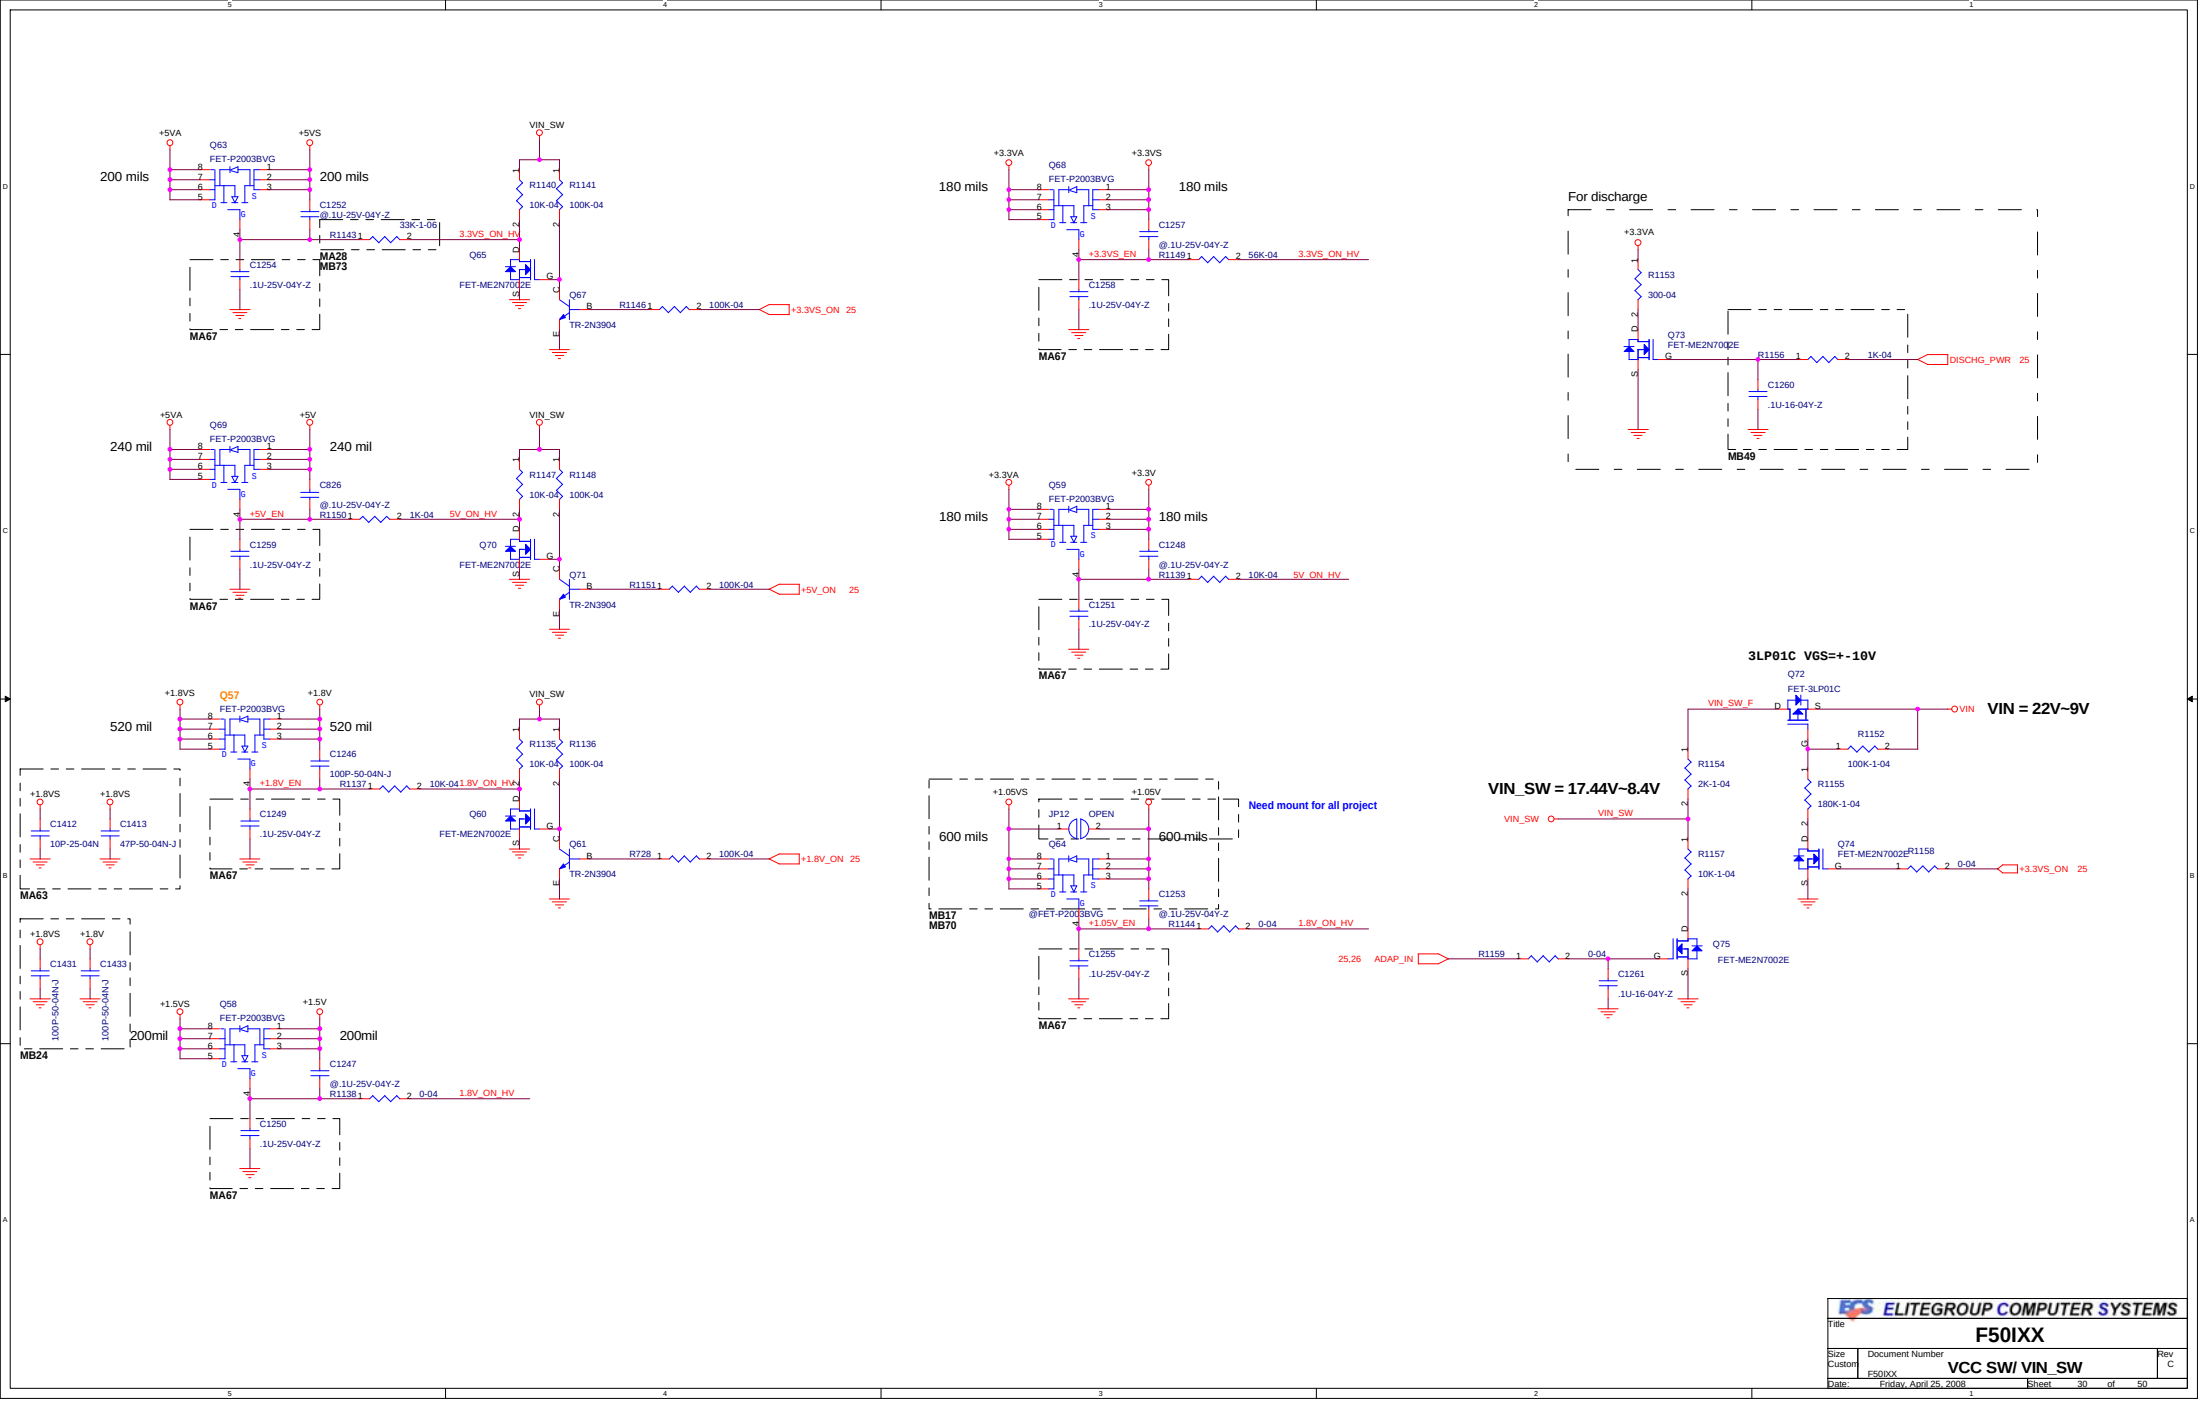

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: VCC SW/ VIN_SW	Rev: C
Date: Friday, April 25, 2008	Sheet 30 of 50	F50IXX

CHARGER

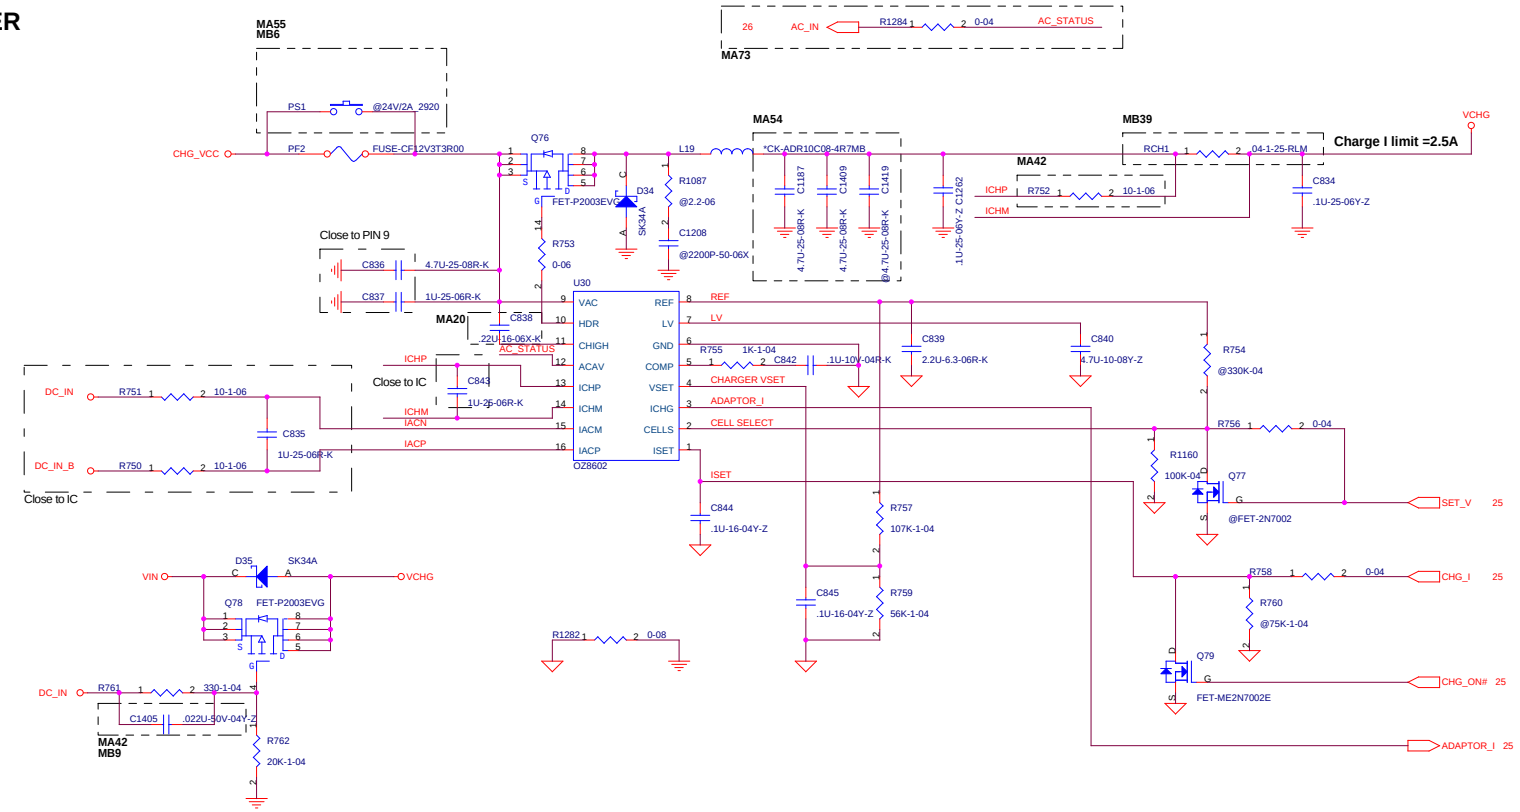

SET_V	
H	16.84V (4CELL)
L	12.71V (3CELL)

Vch =Nx(4.1 +Vset/10)
N=Cell (pin2 =high -->4, low -->3)

SET_V	
L	16.84V (4CELL)
H	12.71V (3CELL)

For Q77,R754 mount

CHG_I	Ich
3.36V	2.8A
3V	2.5A
2.4V	2A
1.2V	1A
0.48V	0.4A
0.3V	0.25A

CHARGER CURRENT =V(CGH_I)/(Rch*30)

CHG_ON	
L	CHARGER ON
H	CHARGER OFF

ADAPTOR_I					
F50II0		F50IN0		F50IN5	
Voltage	W	Voltage	W	Voltage	W
330mV	20W	250mV	20W	180mV	20W
660mV	40W	500mV	40W	360mV	40W
990mV	60W	750mV	60W	540mV	60W
1.32V	80W	1V	80W	720mV	80W
X	X	1.25V	100W	900mV	100W
X	X	X	X	1.08V	120W

Vichg =RAD1*Irsense*10

BATTERY CON

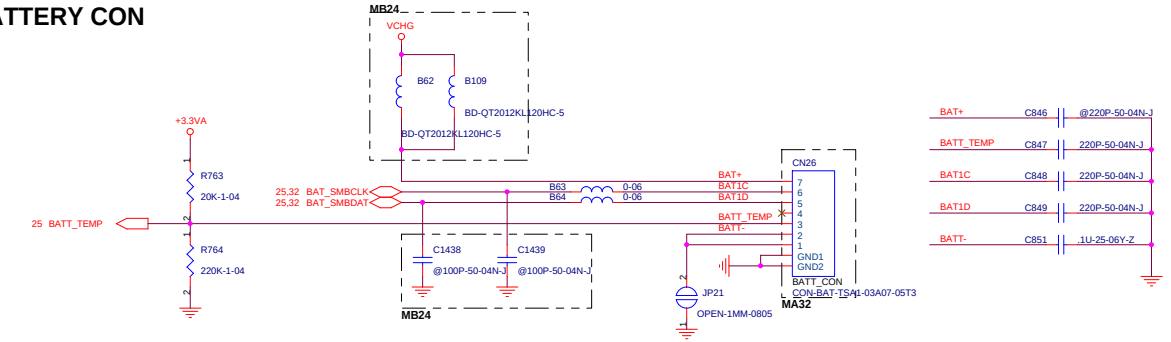

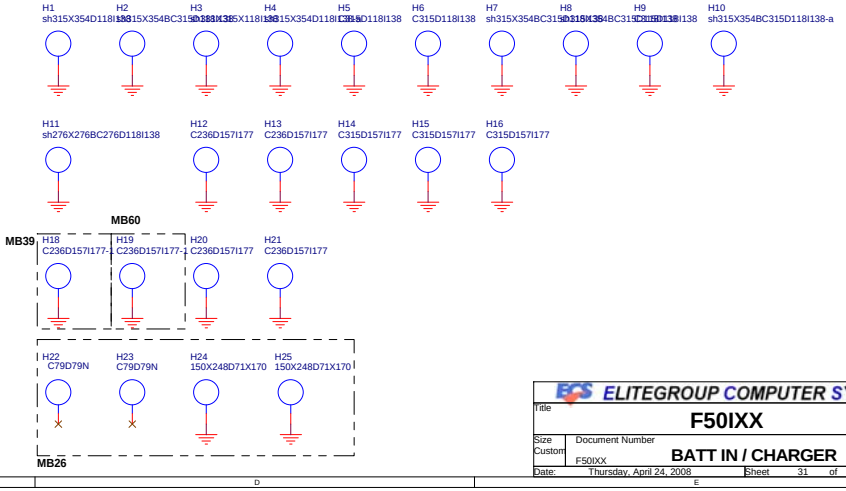

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | BATT IN / CHARGER | Rev: C

Date: Thursday, April 24, 2008 | Sheet 31 of 50

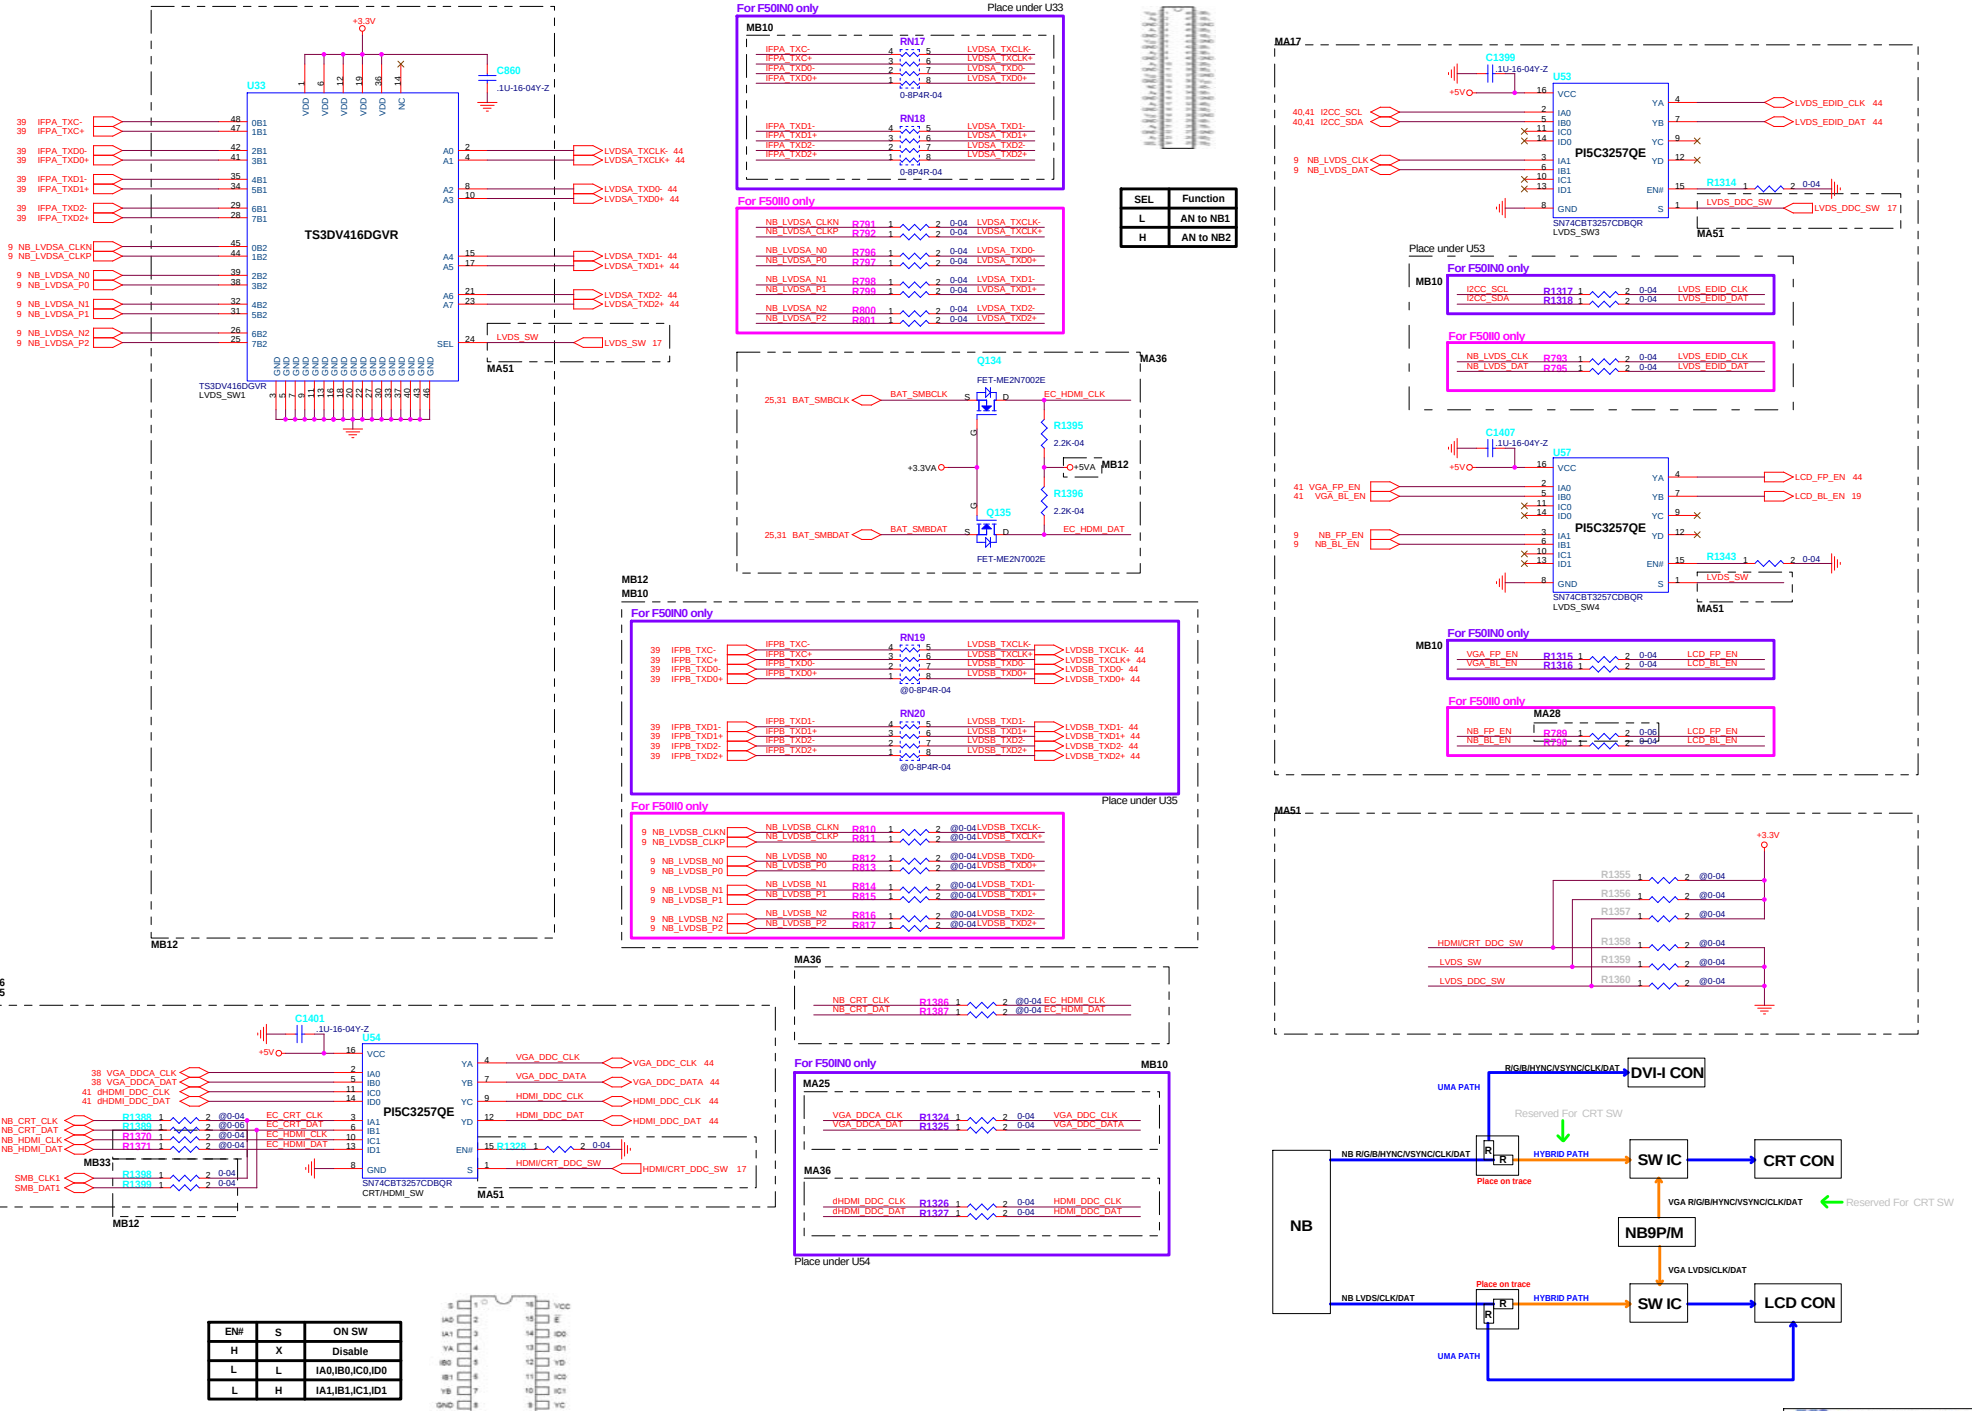

ELITEGROUP COMPUTER SYSTEMS	
Title	F50IXX
Size: Custom	Document Number: F50IXX — HYBRID SIGNAL SW — Rev: C
Date: Thursday, April 24, 2008	Sheet 32 of 50

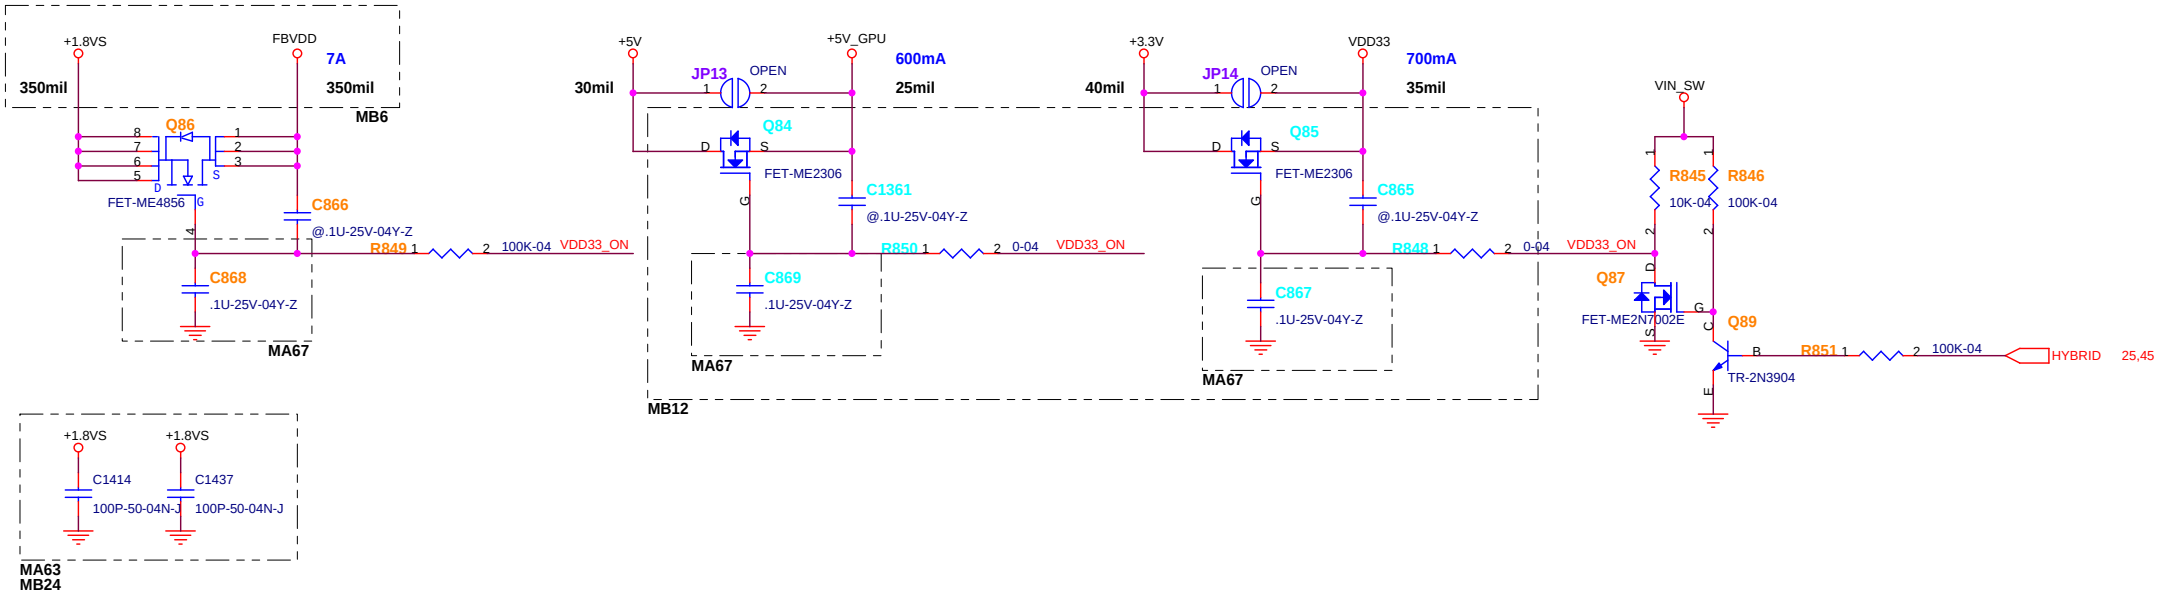

NB9P/M Poewr ON/OFF Sequence

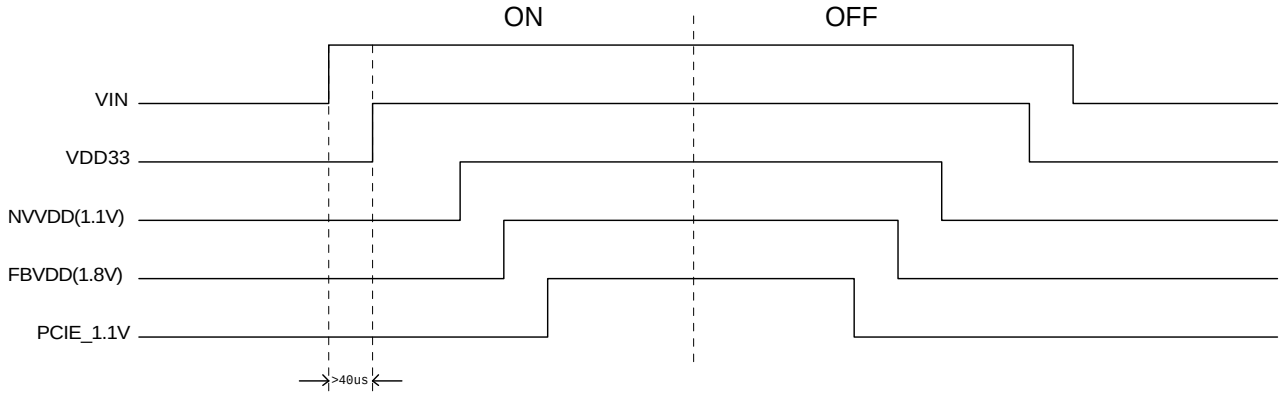

ELITEGROUP COMPUTER SYSTEMS		
Title: F50IXX		
Size: B	Document Number: F50IXX HYBRID POWER SW	Rev: C
Date: Thursday, April 24, 2008	Sheet 33 of 50	

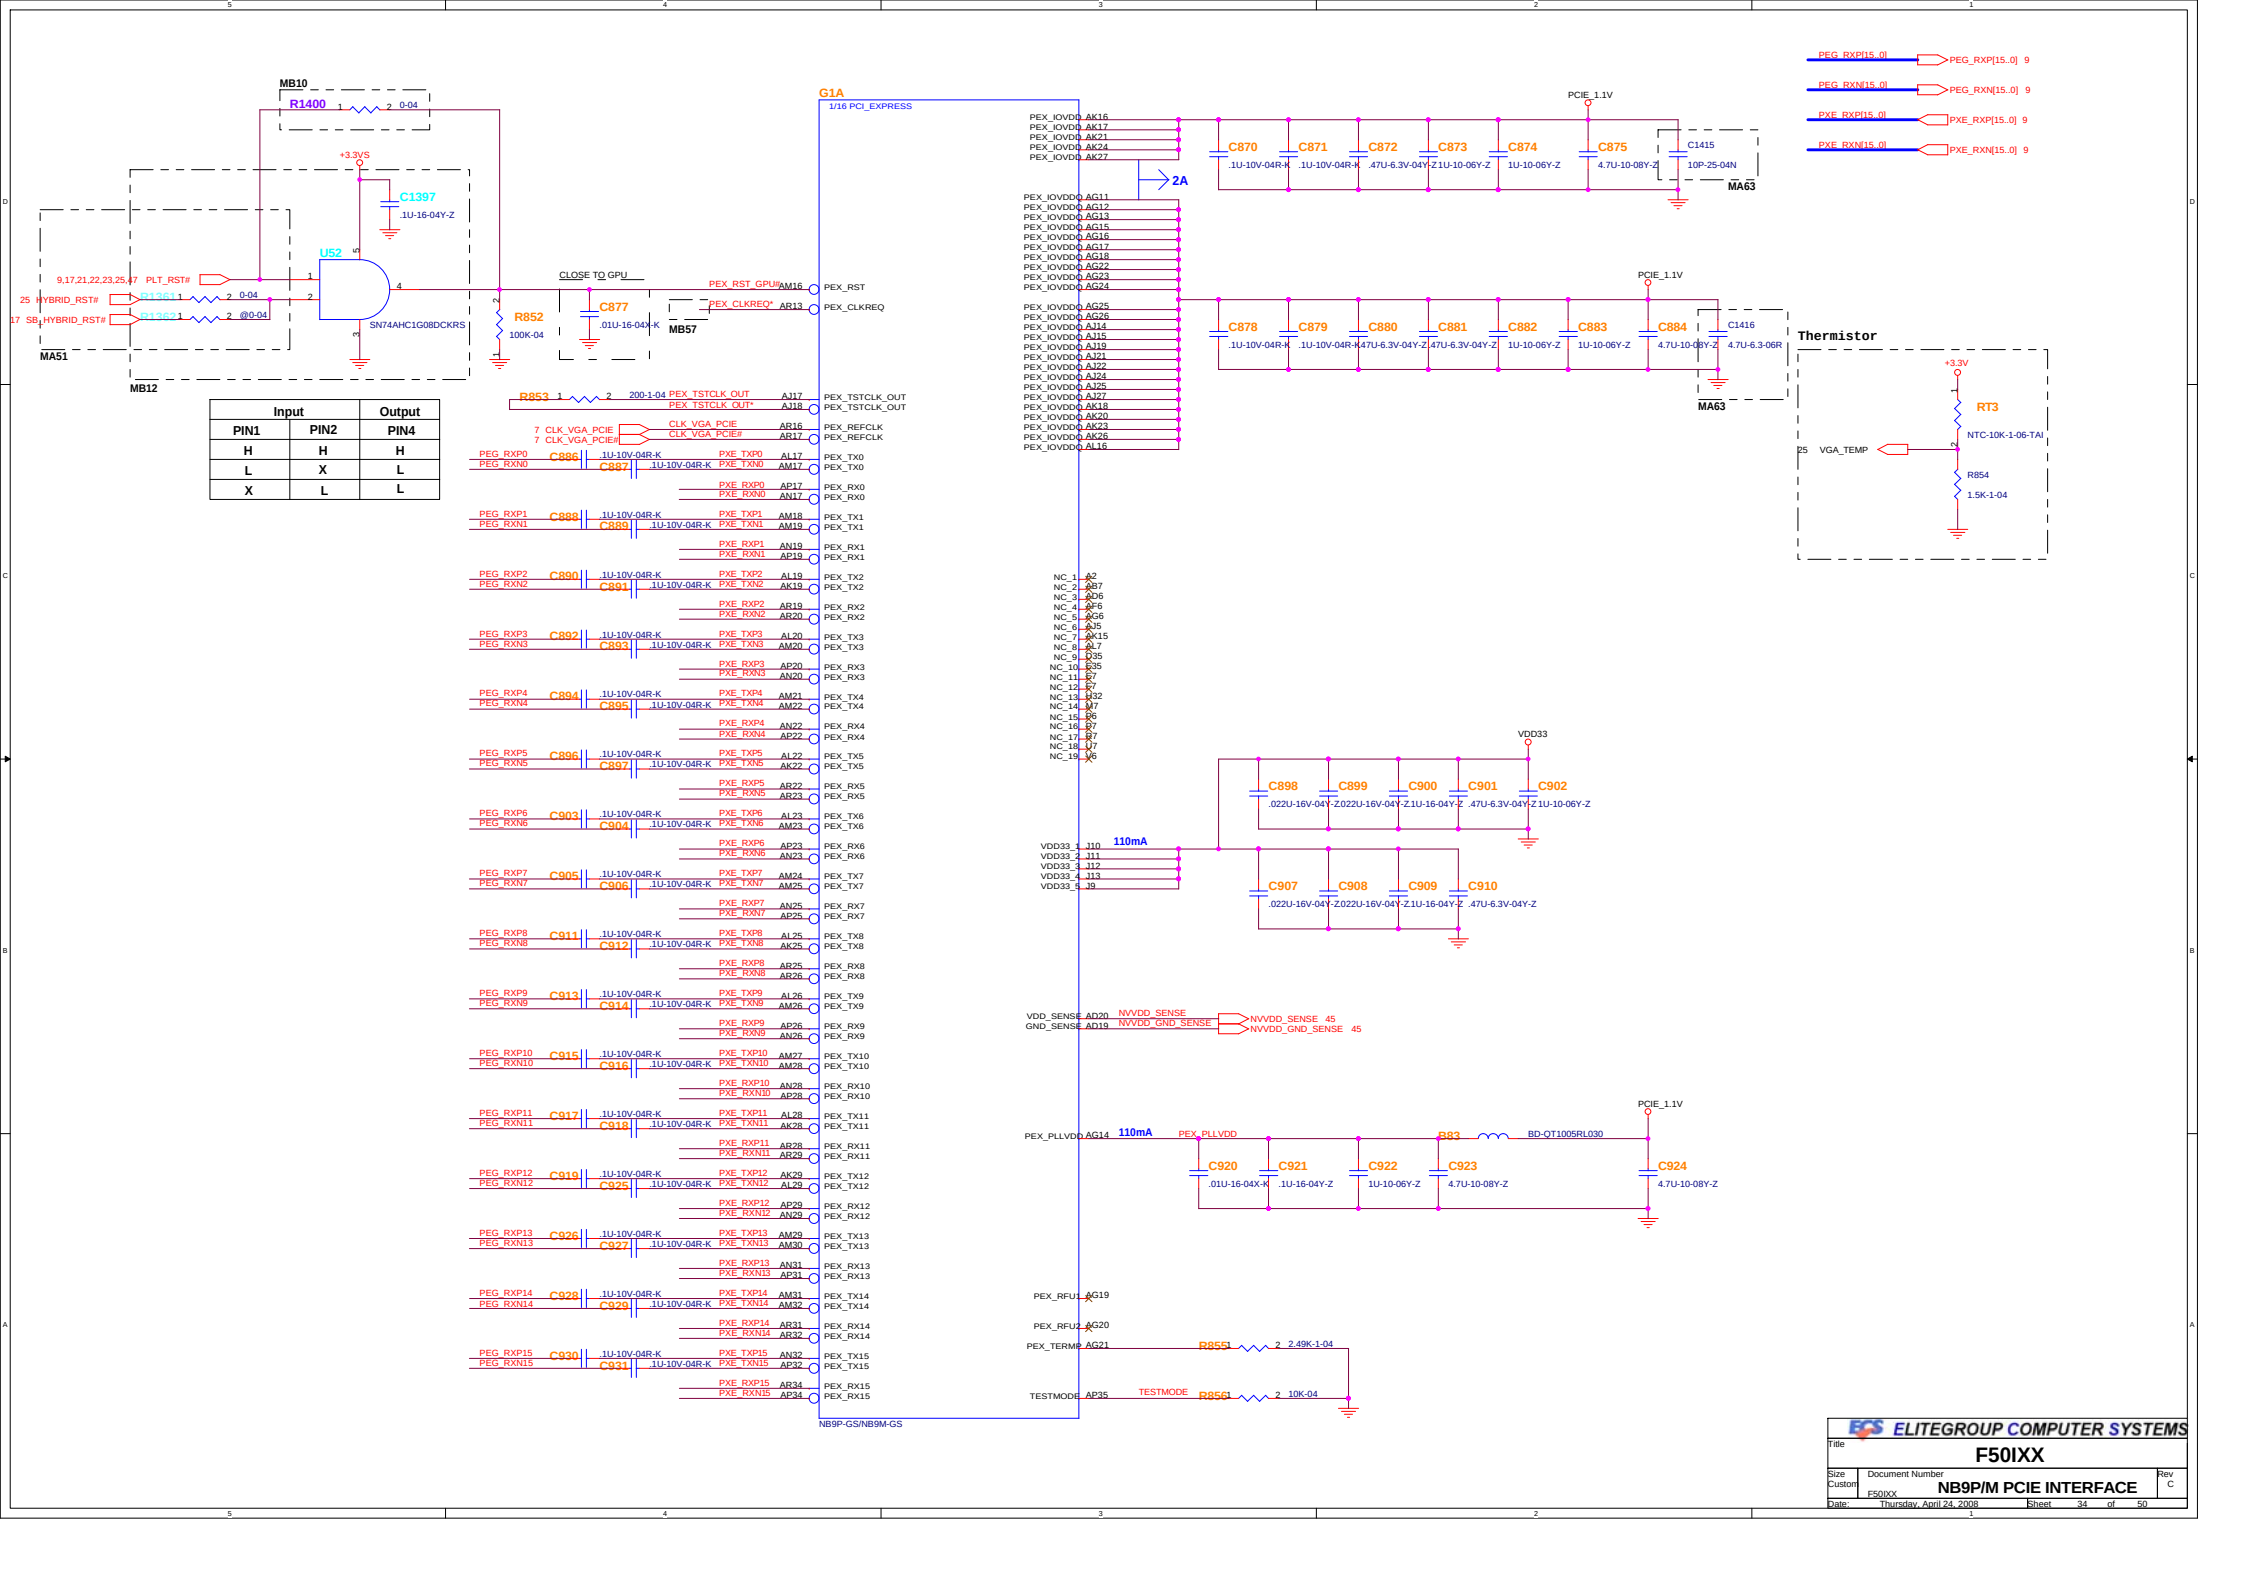
MB10
R1400 1 2 0-04
+3.3VS
C1397 .1U-16-04Y-Z
U52
SN74AHC1G08DCKRS
9,17,21,22,23,25,47 PLT_RST#
25 HYBRID_RST#
17 SB_HYBRID_RST#
R1361 1 2 0-04
R1362 1 2 @0-04
MA51
MB12
CLOSE TO GPU
R852 100K-04
C877 .01U-16-04X-K
MB57
PEX_RST_GPU#
PEX_CLKREQ*
G1A
1/16 PCI_EXPRESS
PEX_RST
PEX_CLKREQ
R853 1 2 200-1-04
PEX_TSTCLK_OUT
PEX_TSTCLK_OUT*
PEX_TSTCLK_OUT
CLK_VGA_PCIE
CLK_VGA_PCIE#
PEX_REFCLK
NB9P-GS/NB9M-GS
Input
Output
PIN1
PIN2
PIN4
H
L
X
PEX_IOVDD AK16
PEX_IOVDD AK17
PEX_IOVDD AK21
PEX_IOVDD AK24
PEX_IOVDD AK27
2A
PEX_IOVDD AG11
PEX_IOVDD AG12
PEX_IOVDD AG13
PEX_IOVDD AG15
PEX_IOVDD AG16
PEX_IOVDD AG17
PEX_IOVDD AG18
PEX_IOVDD AG22
PEX_IOVDD AG23
PEX_IOVDD AG24
PEX_IOVDD AG25
PEX_IOVDD AG26
PEX_IOVDD AJ14
PEX_IOVDD AJ15
PEX_IOVDD AJ19
PEX_IOVDD AJ21
PEX_IOVDD AJ22
PEX_IOVDD AJ24
PEX_IOVDD AJ25
PEX_IOVDD AJ27
PEX_IOVDD AK18
PEX_IOVDD AK20
PEX_IOVDD AK23
PEX_IOVDD AK26
PEX_IOVDD AL16
PCIE_1.1V
C870 .1U-10V-04R-K
C871 .1U-10V-04R-K
C872 .47U-6.3V-04Y-Z
C873 1U-10-06Y-Z
C874 1U-10-06Y-Z
C875 4.7U-10-08Y-Z
C1415 10P-25-04N
MA63
C878 .1U-10V-04R-K
C879 .1U-10V-04R-K
C880 .47U-6.3V-04Y-Z
C881 .47U-6.3V-04Y-Z
C882 1U-10-06Y-Z
C883 1U-10-06Y-Z
C884 4.7U-10-08Y-Z
C1416 4.7U-6.3-06R
MA63
PEG_RXP[15..0] PEG_RXP[15..0] 9
PEG_RXN[15..0] PEG_RXN[15..0] 9
PXE_RXP[15..0] PXE_RXP[15..0] 9
PXE_RXN[15..0] PXE_RXN[15..0] 9
Thermistor
+3.3V
RT3 NTC-10K-1-06-TAI
25 VGA_TEMP
R854 1.5K-1-04
NC_1 A2
NC_2 AB7
NC_3 AD6
NC_4 AF6
NC_5 AG6
NC_6 AJ5
NC_7 AK15
NC_8 AL7
NC_9 D35
NC_10 E35
NC_11 E7
NC_12 F7
NC_13 H32
NC_14 M7
NC_15 P6
NC_16 R7
NC_17 T7
NC_18 U7
NC_19 V6
VDD33
C898 .022U-16V-04Y-Z
C899 .022U-16V-04Y-Z
C900 1U-16-04Y-Z
C901 .47U-6.3V-04Y-Z
C902 1U-10-06Y-Z
VDD33_1 J10
VDD33_2 J11
VDD33_3 J12
VDD33_4 J13
VDD33_5 J9
110mA
C907 .022U-16V-04Y-Z
C908 .022U-16V-04Y-Z
C909 1U-16-04Y-Z
C910 .47U-6.3V-04Y-Z
VDD_SENSE AD20
GND_SENSE AD19
NVVDD_SENSE
NVVDD_GND_SENSE
NVVDD_SENSE 45
NVVDD_GND_SENSE 45
PCIE_1.1V
PEX_PLLVDD AG14
110mA
PEX_PLLVDD
B83 BD-QT1005RL030
C920 .01U-16-04X-K
C921 .1U-16-04Y-Z
C922 1U-10-06Y-Z
C923 4.7U-10-08Y-Z
C924 4.7U-10-08Y-Z
PEX_RFU1 AG19
PEX_RFU2 AG20
PEX_TERM AG21
R855 2.49K-1-04
TESTMODE AP35
TESTMODE
R856 10K-04
ELITEGROUP COMPUTER SYSTEMS
Title
F50IXX
Size Custom
Document Number
NB9P/M PCIE INTERFACE
Rev C
F50IXX
Date: Thursday, April 24, 2008
Sheet 34 of 50

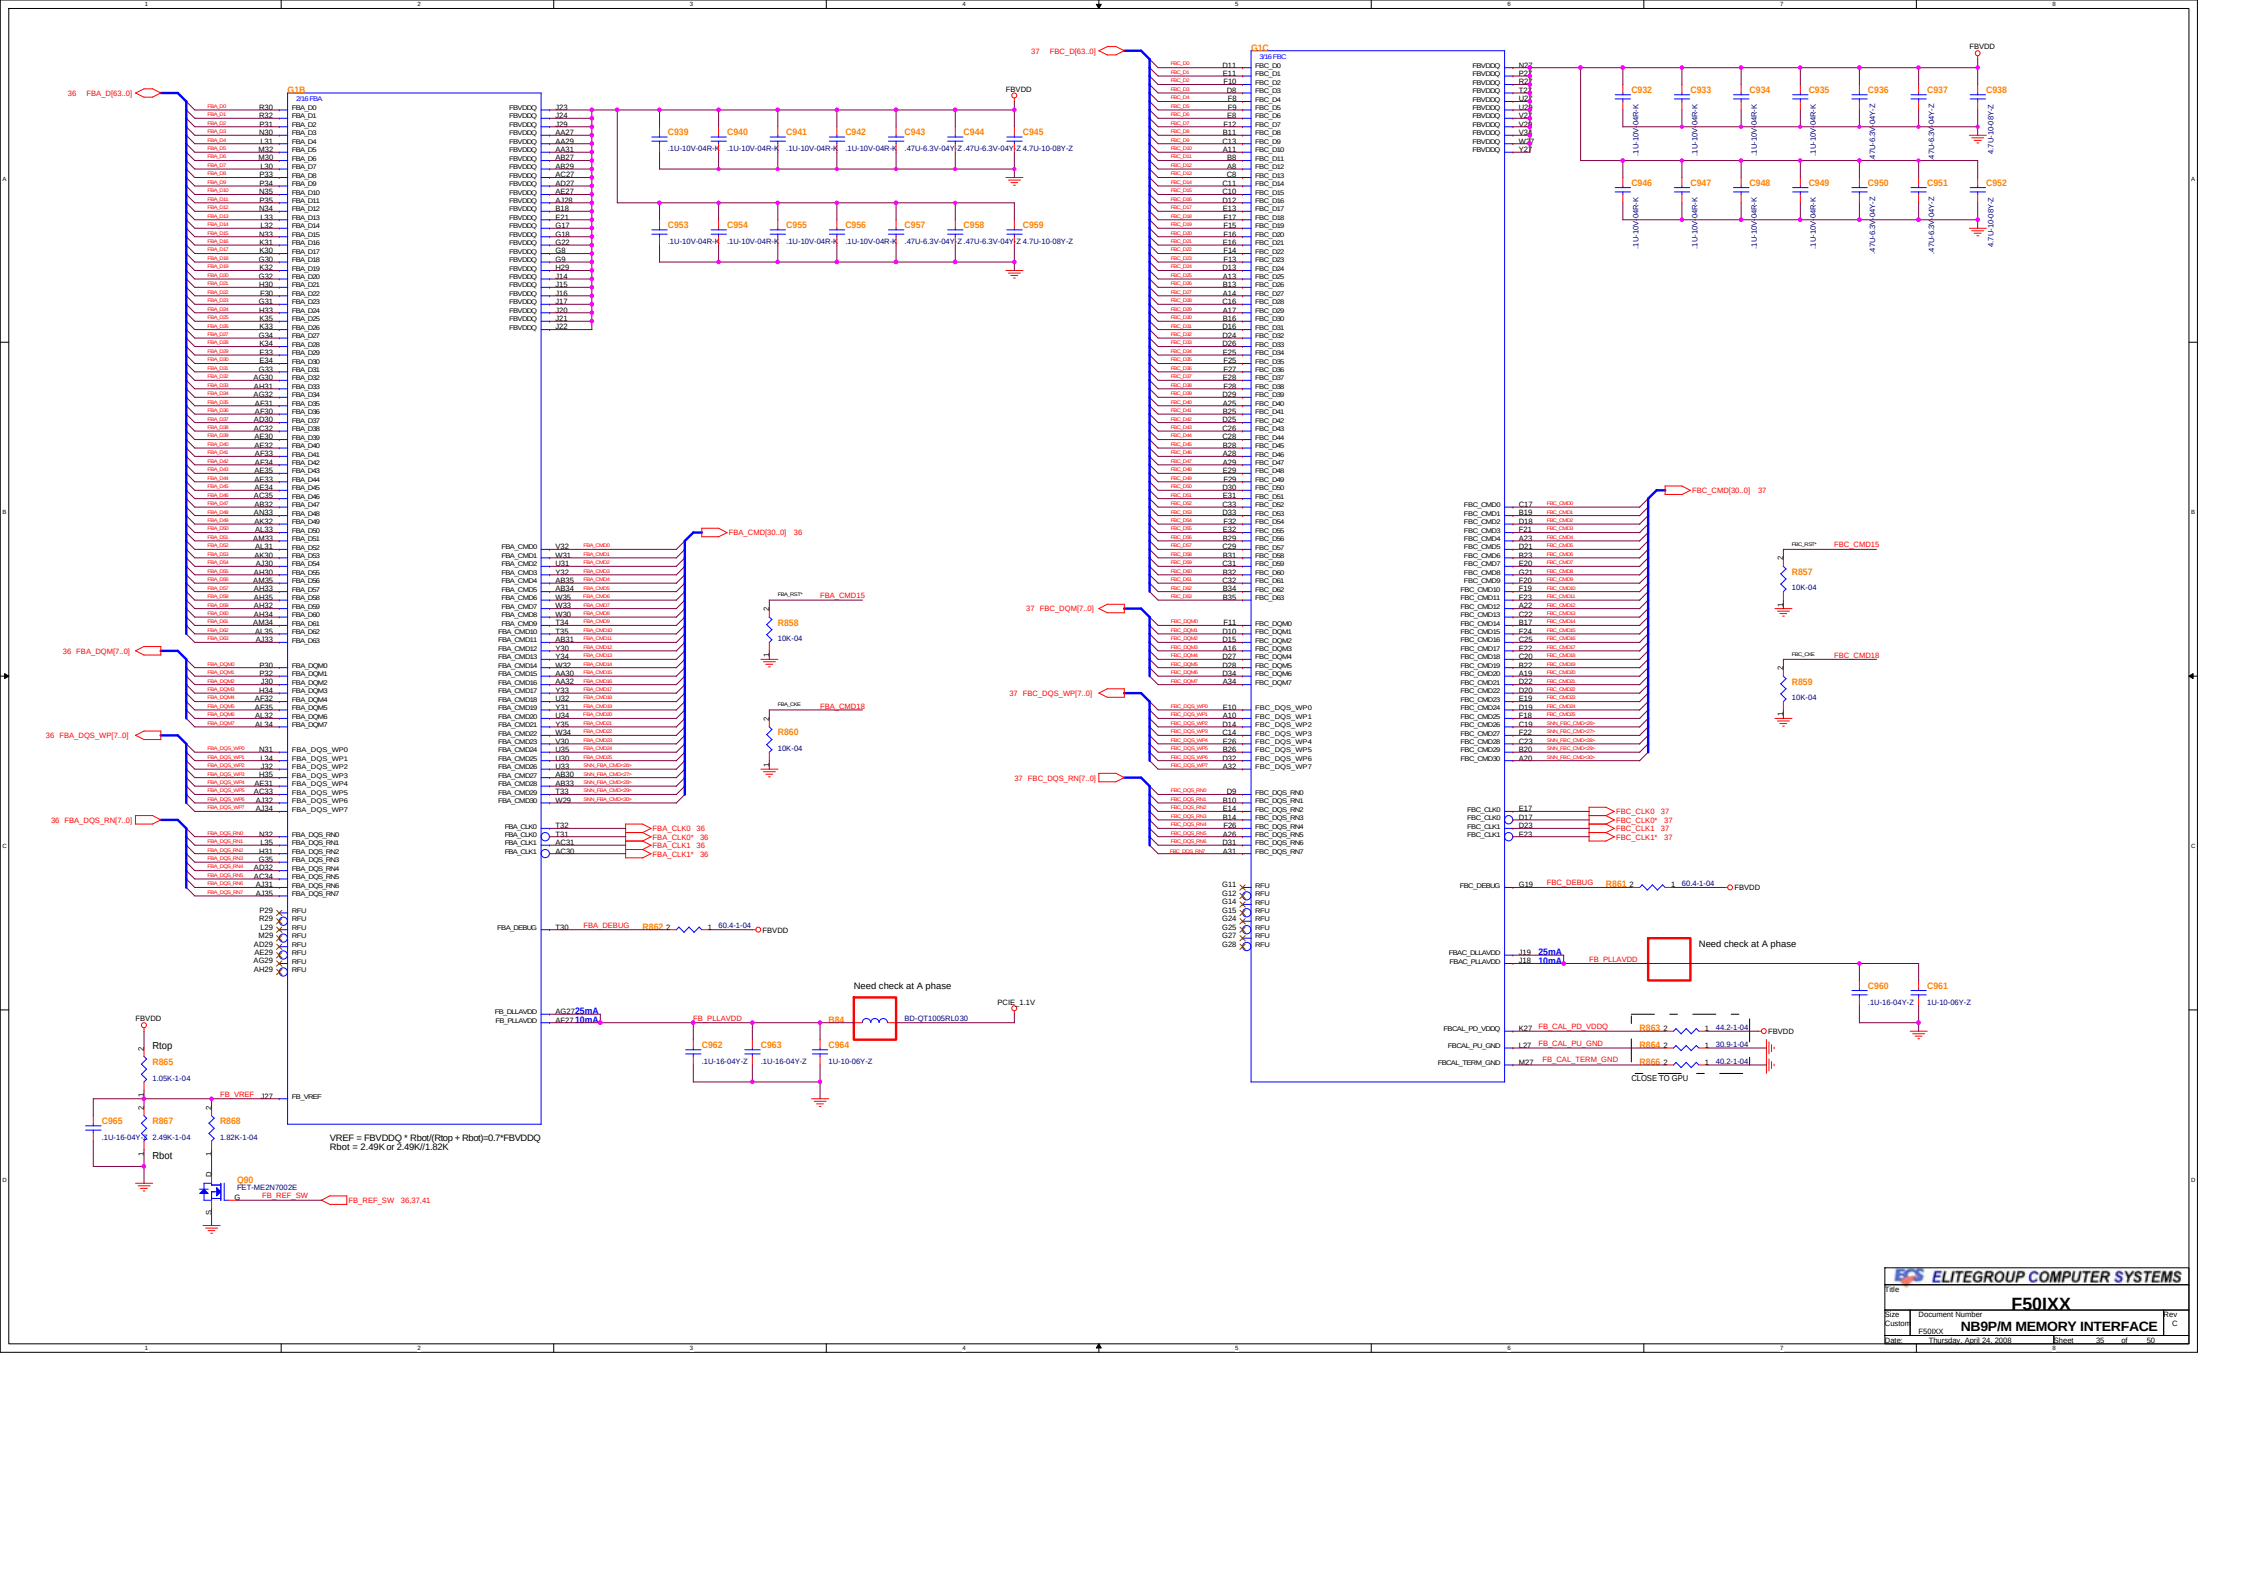
G1B
316 FBA
G1C
316 FBC
FBVDDQ
FBVDD
VREF = FBVDDQ * Rbot/(Rtop + Rbot)=0.7*FBVDDQ
Rbot = 2.49K or 2.49K//1.82K
Need check at A phase
Need check at A phase
CLOSE TO GPU
ELITEGROUP COMPUTER SYSTEMS
F50IXX
NB9P/M MEMORY INTERFACE
Thursday, April 24, 2008

	0.31	32.63
CMD0	A4	
CMD1	RAS*	RAS*
CMD2	A5	
CMD3	BA1	BA1
CMD4		A2
CMD5		A4
CMD6		A3
CMD7	CS1*	CS1*
CMD8	CS0*	CS0*
CMD9	A11	A11
CMD10	CAS*	CAS*
CMD11	WE*	WE*
CMD12	BA0	BA0
CMD13		A5
CMD14	A12	A12
CMD15	RST/ODT	RST/ODT
CMD16	A7	A7
CMD17	A10	A10
CMD18	CKE	CKE
CMD19	A0	A0
CMD20	A9	A9
CMD21	A6	A6
CMD22	A2	
CMD23	A8	A8
CMD24	A3	
CMD25	A1	A1
CMD26	A13	A13
CMD27	BA2	BA2
CMD28	RFU0	RFU0
CMD29	RFU1	RFU1
CMD30	RFU2	RFU2

	CMD0	CMD1	CMD2	CMD3	CMD4	CMD5	CMD6	CMD7	CMD8	CMD9	CMD10	CMD11	CMD12	CMD13
Mode A	A3 (L)	A0	A2 (L)	A1	A3 (H)	A4 (H)	A5 (H)	CS1	CS0	WE	BA0	CKE	R/S0DT	A2 (H)
Mode B	A4 (L)	RAS	A5(L)	BA1	A2 (H)	A4 (H)	A5 (H)	CS1	CS0	CAS	WE	BA0	R/S0DT	A5 (H)
Mode C	A4 (L)	A7	A5(L)	A6	A4 (H)	A3 (H)	A2 (H)	CS1	CS0	WE	BA1	CKE	R/S0DT	A5 (H)
	CMD14	CMD15	CMD16	CMD17	CMD18	CMD19	CMD20	CMD21	CMD22	CMD23	CMD24	CMD25	CMD26	CMD27
Mode A	A12	BA2	A11	A10	BA1	A8	A9	A6	A5 (L)	A7	A4 (L)	CAS	A13	BA2
Mode B	A12	R/S0DT	A7	A10	CKE	A0	A9	A6	A2 (L)	A8	A7 (L)	A1	A13	BA2
Mode C	A12	RAS	A8	A9	BA0	A11	A10	A1	A2 (L)	A0	A3 (L)	CAS	A13	BA2

ODDR3 Mirror mode		RAS	CAS	WE	CS0	A0	A1	A2	A3	A4	A5	A6
MIRROR (LOW)	PIN	H3	F4	H9	F9	K4	H2	K3	M4	K9	H11	K10
MIRROR (HIGH)		H10	F9	H4	F4	K9	H11	K10	M9	K4	H2	K3
		A7	A8	A9	A10	A11	A12	BA0	BA1	BA2	CKE	
MIRROR (LOW)	PIN	L9	K11	M9	K2	L4	J3	G4	G9	H10	N4	
MIRROR (HIGH)		L4	K2	M4	K11	L9	J3	G9	G4	H10	N4	

Title	F50IXX		
Size: Custom	Document Number: NB9P/M DDR3 16MX32 PART A (F50IXX)		Rev: C
Date: Thursday, April 24, 2008	Sheet 36 of 50		

ELITEGROUP COMPUTER SYSTEMS

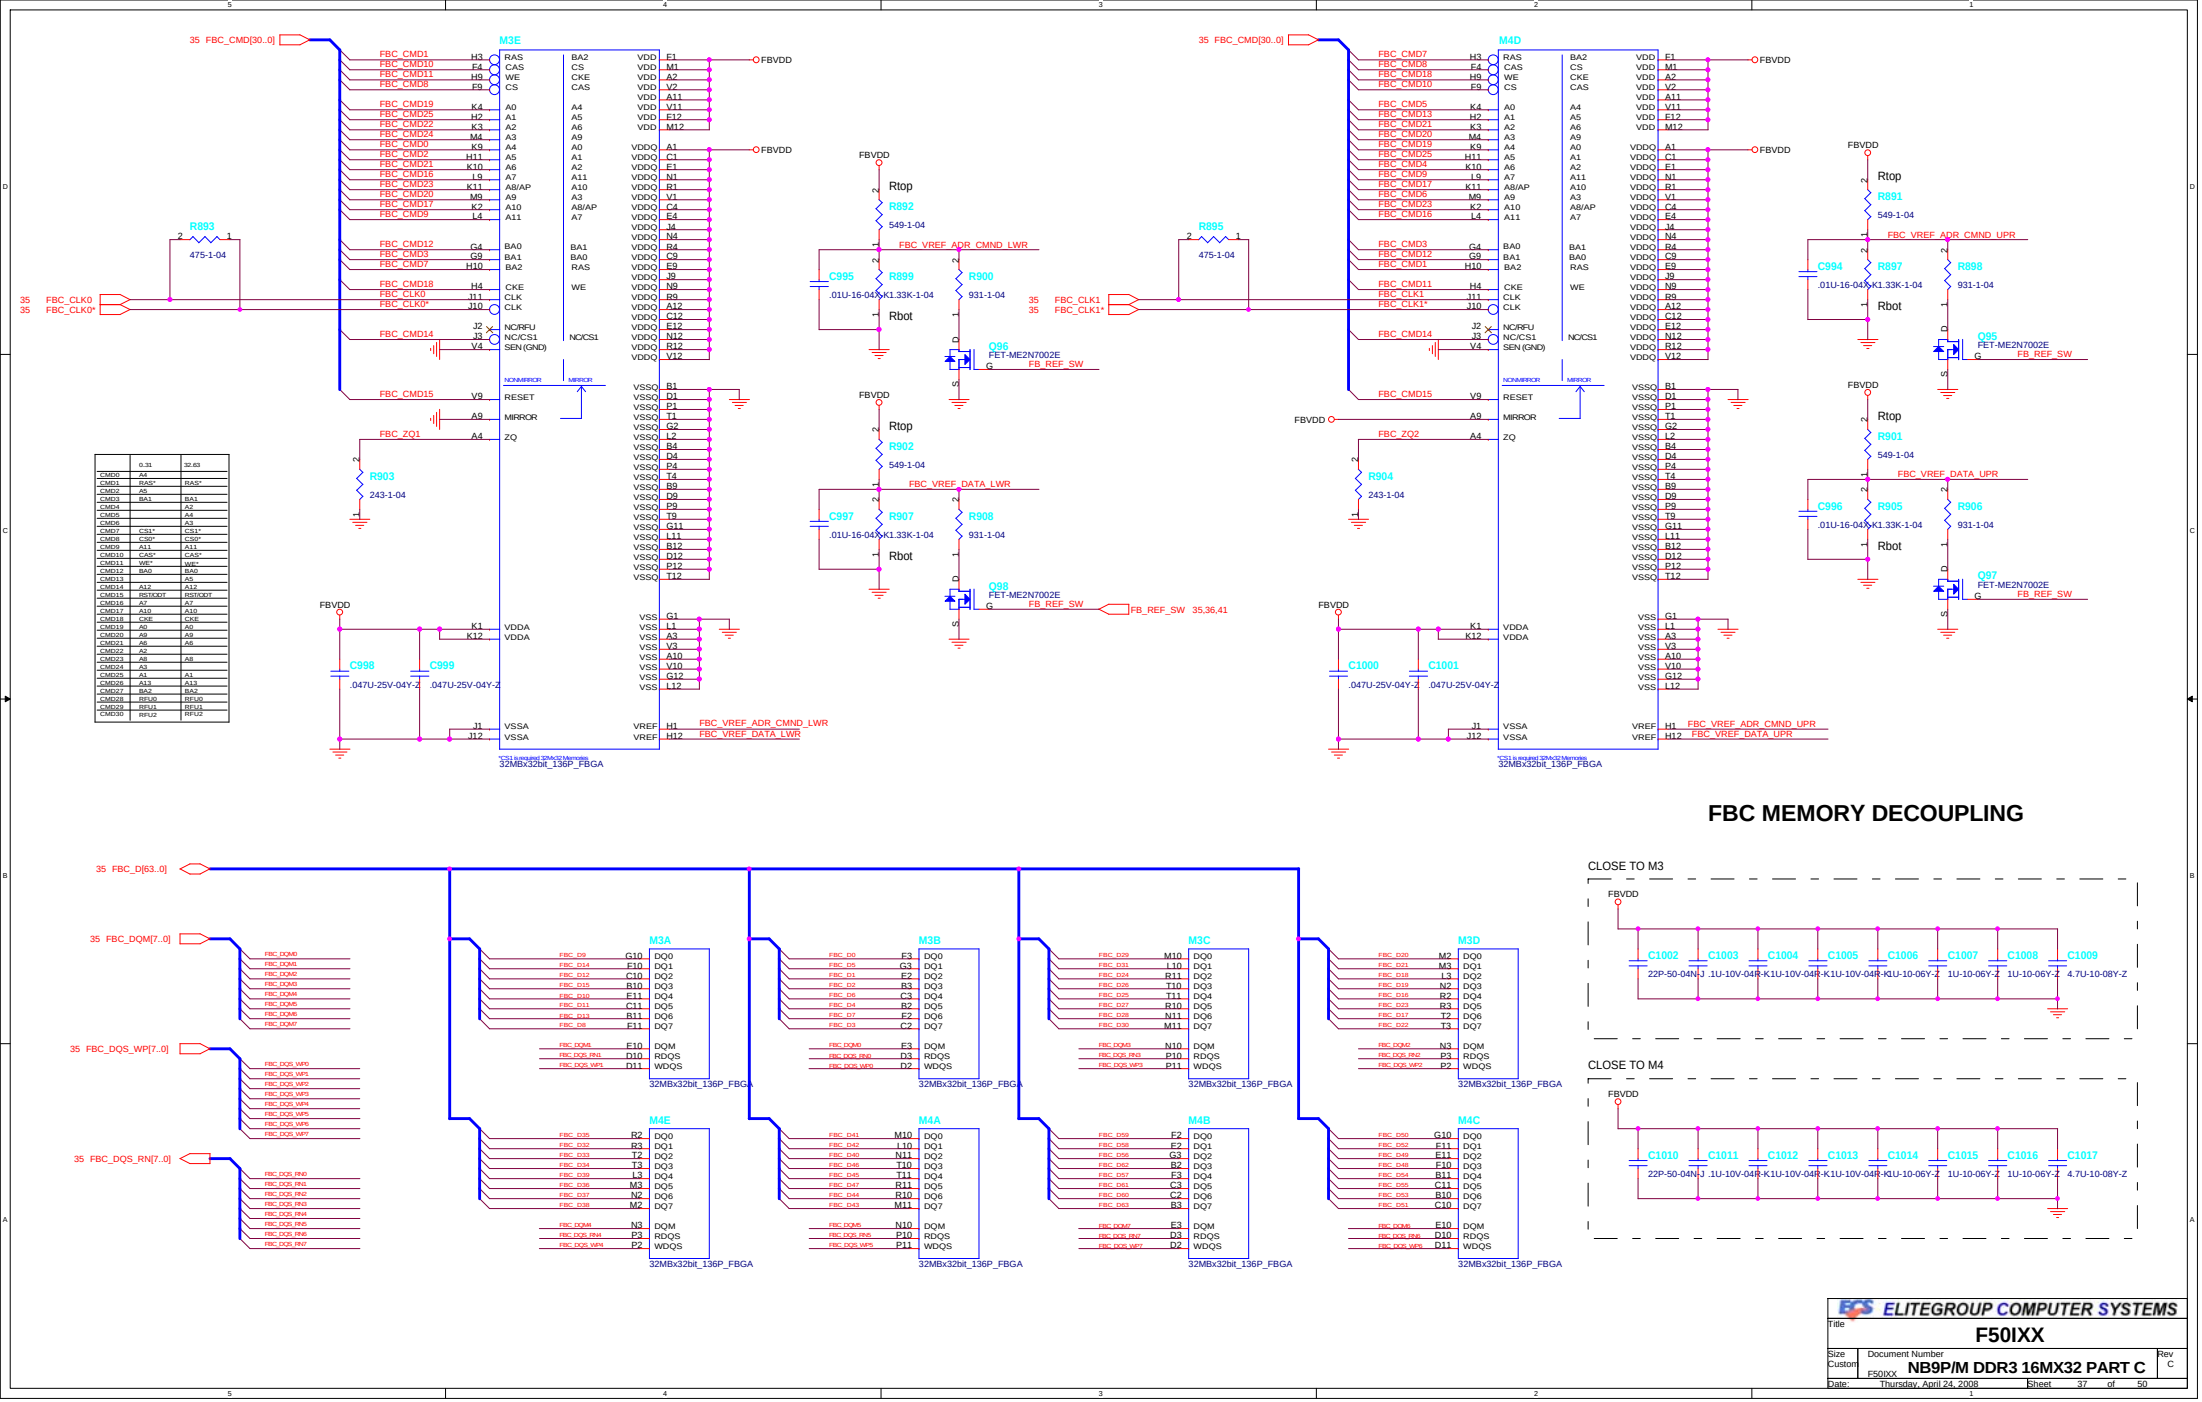

FBC MEMORY DECOUPLING

Title	F50IXX		
Size: Custom	Document Number: NB9P/M DDR3 16MX32 PART C (F50IXX)		Rev: C
Date: Thursday, April 24, 2008	Sheet 37 of 50		

ELITEGROUP COMPUTER SYSTEMS

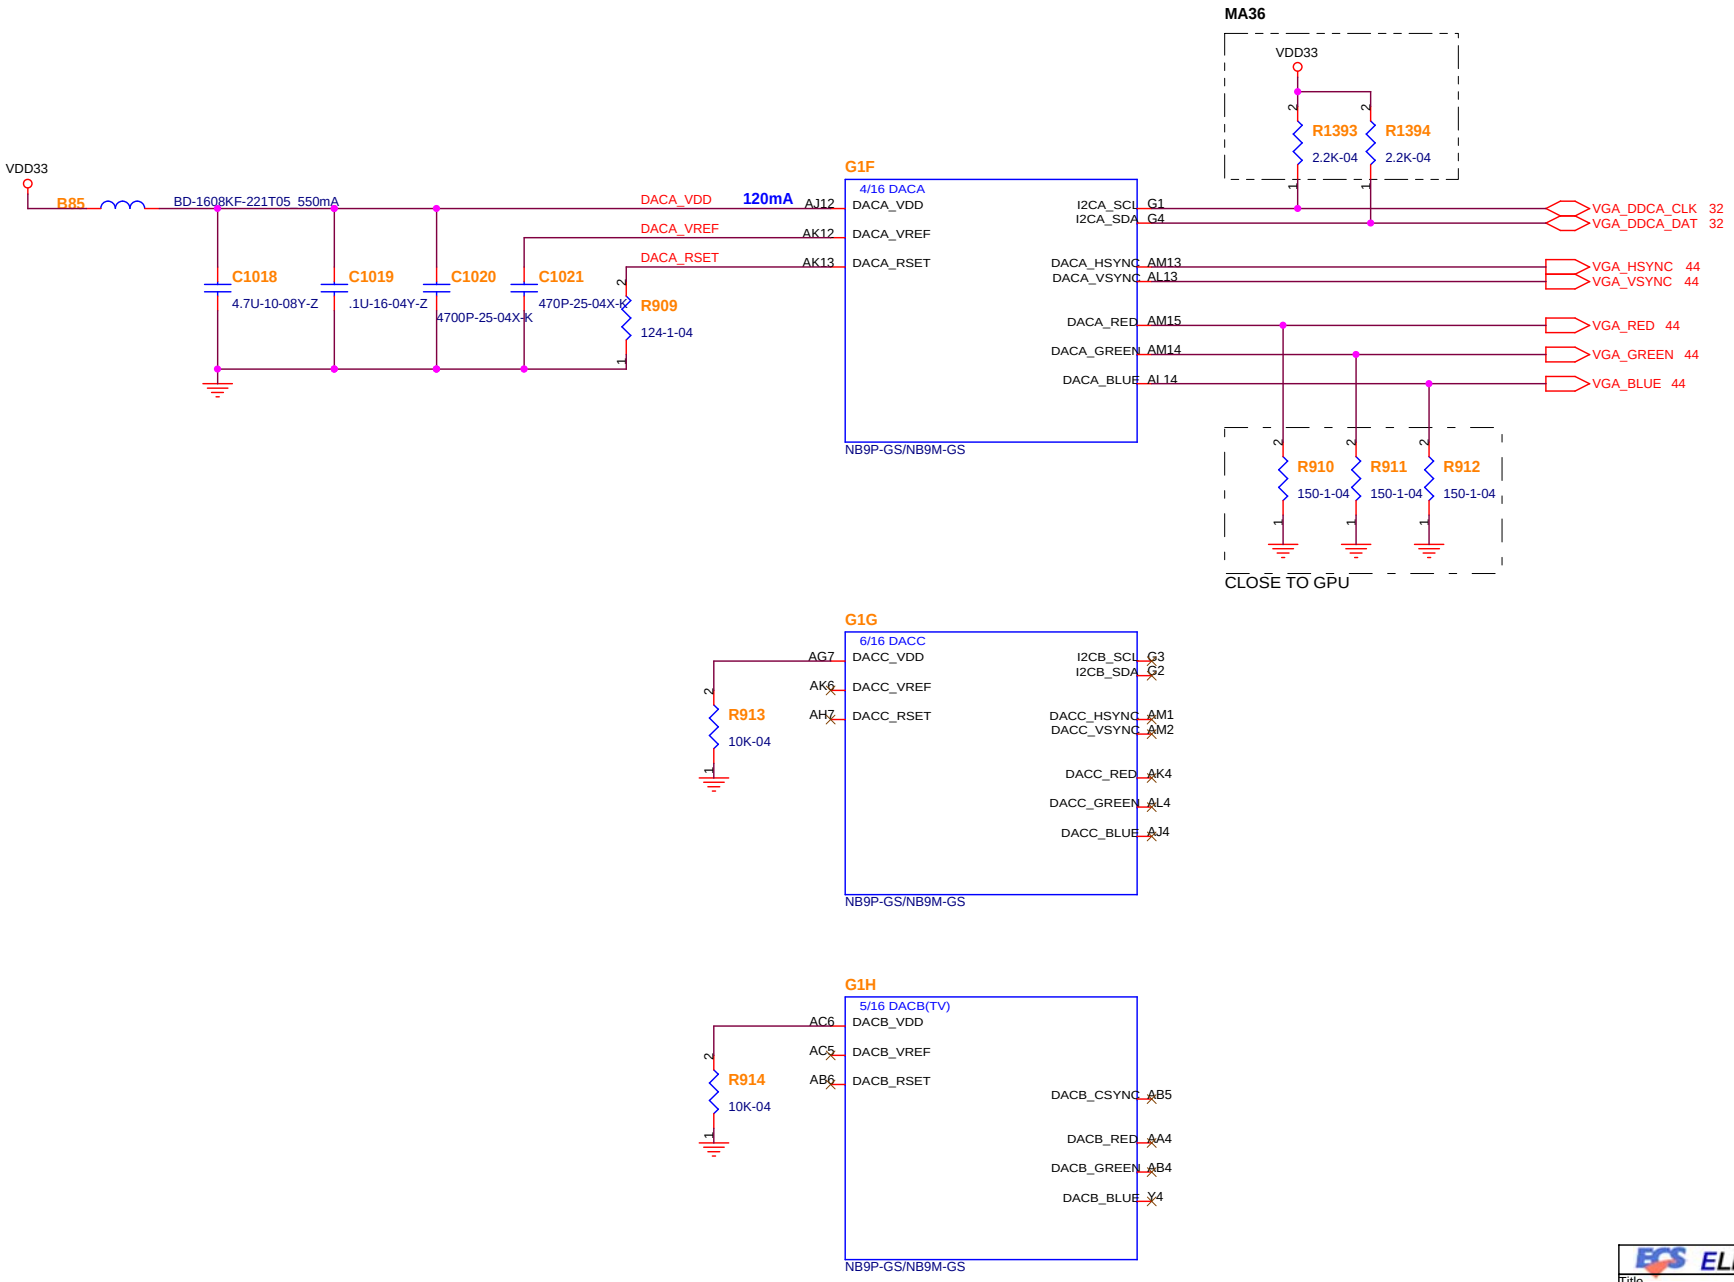

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: B | Document Number: F50IXX NB9P/M DACA / DACB / DACC | Rev: C

Date: Thursday, April 24, 2008 | Sheet 38 of 50

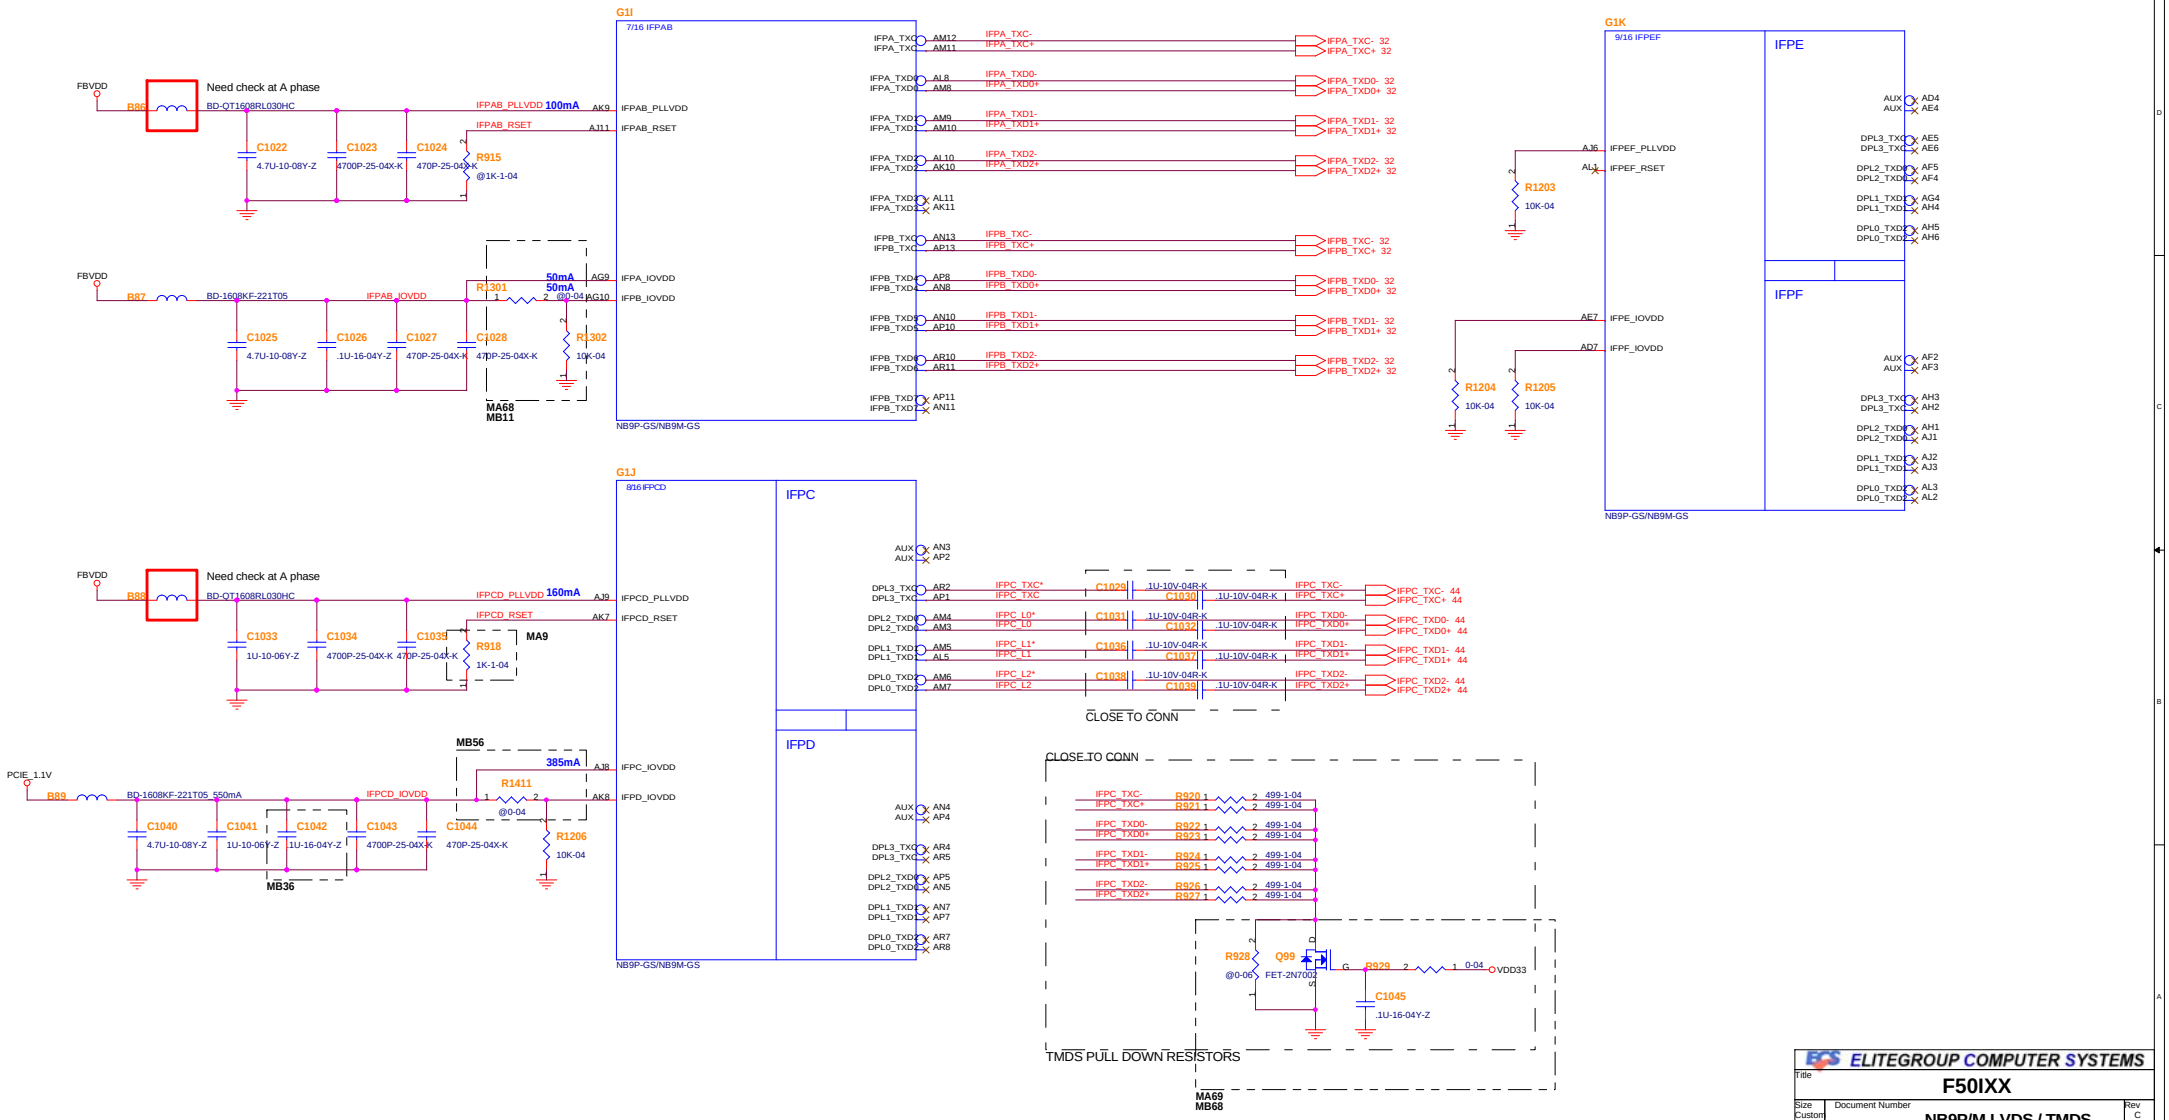

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: F50IXX — NB9P/M LVDS / TMDS	Rev: C
Date: Thursday, April 24, 2008	Sheet 39 of 50	

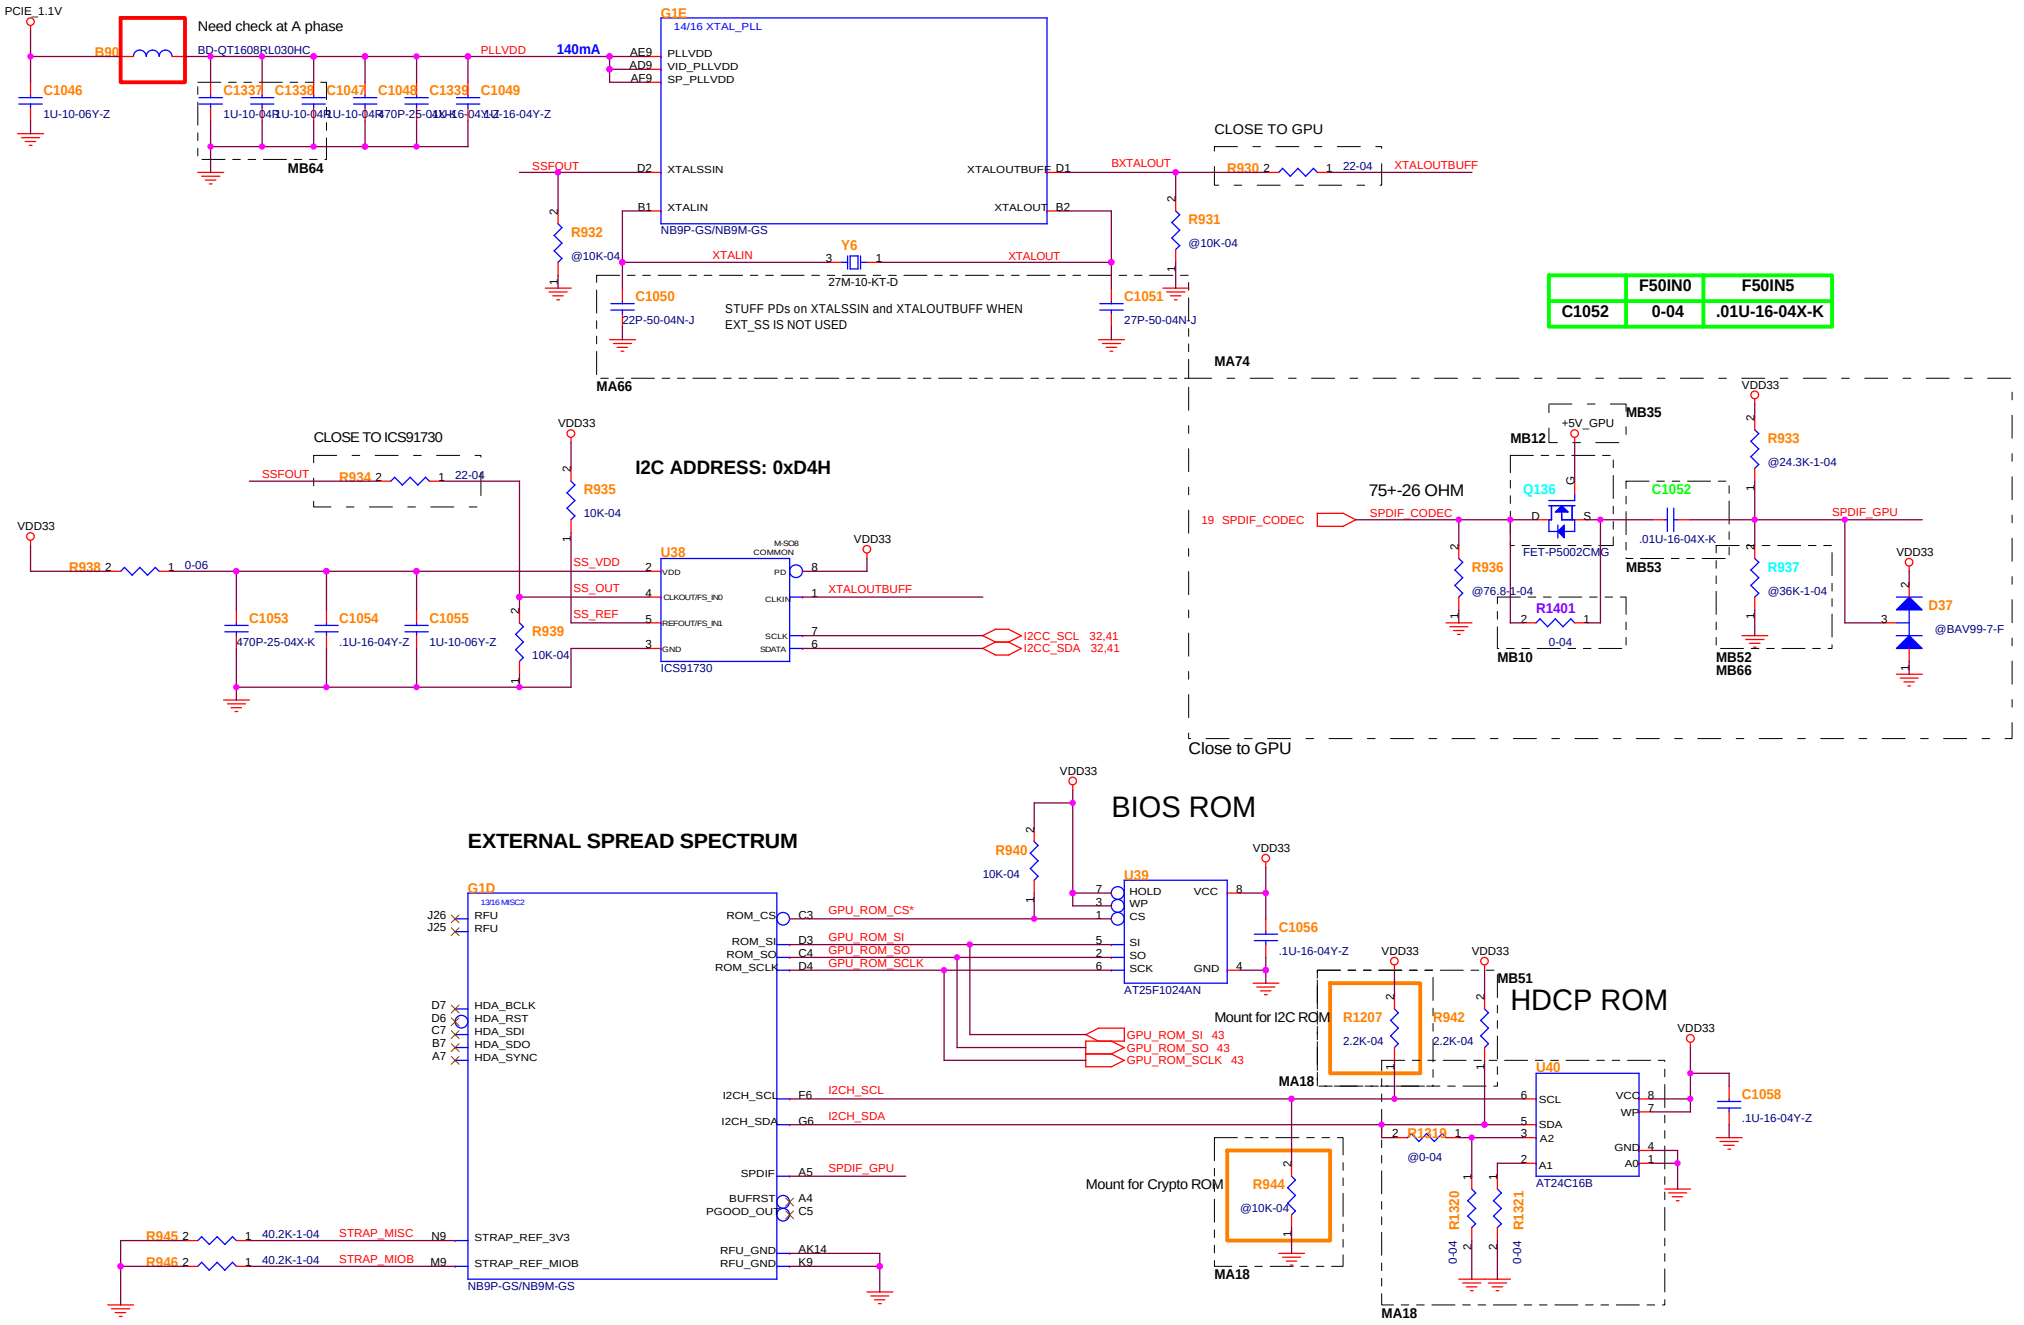

	F50IN0	F50IN5
C1052	0-04	.01U-16-04X-K

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size: Custom	Document Number: F50IXX — NB9P/M SS/BIOS/HDCP/XTAL	Rev: C
Date: Thursday, April 24, 2008	Sheet 40 of 50	

GPIO ASSIGNMENTS

GPIO	I/O	ACTIVE	USAGE
0	IN	N/A	PRIMARY DVI HOTPLUG
1	IN	N/A	SECONDARY DVI HOTPLUG
2	OUT	HIGH	PANEL BACKLIGHT PWM
3	OUT	HIGH	PANEL POWER ENABLE
4	OUT	HIGH	PANEL BACKLIGHT ENABLE
5	OUT	N/A	NVVDD VID0
6	OUT	N/A	NVVDD VID1
7	OUT	N/A	FBVDD VID0
8	IN	LOW	THERMAL ALERT
9	OUT	LOW	FAN PWM
10	OUT	N/A	FBVREF SELECT
11	OUT	N/A	SLI SYNC0
12	IN	N/A	AC DETECT
13	OUT	LOW	PS CONTROL OR HDMI_CEC
14	OUT	HIGH	PS CONTROL

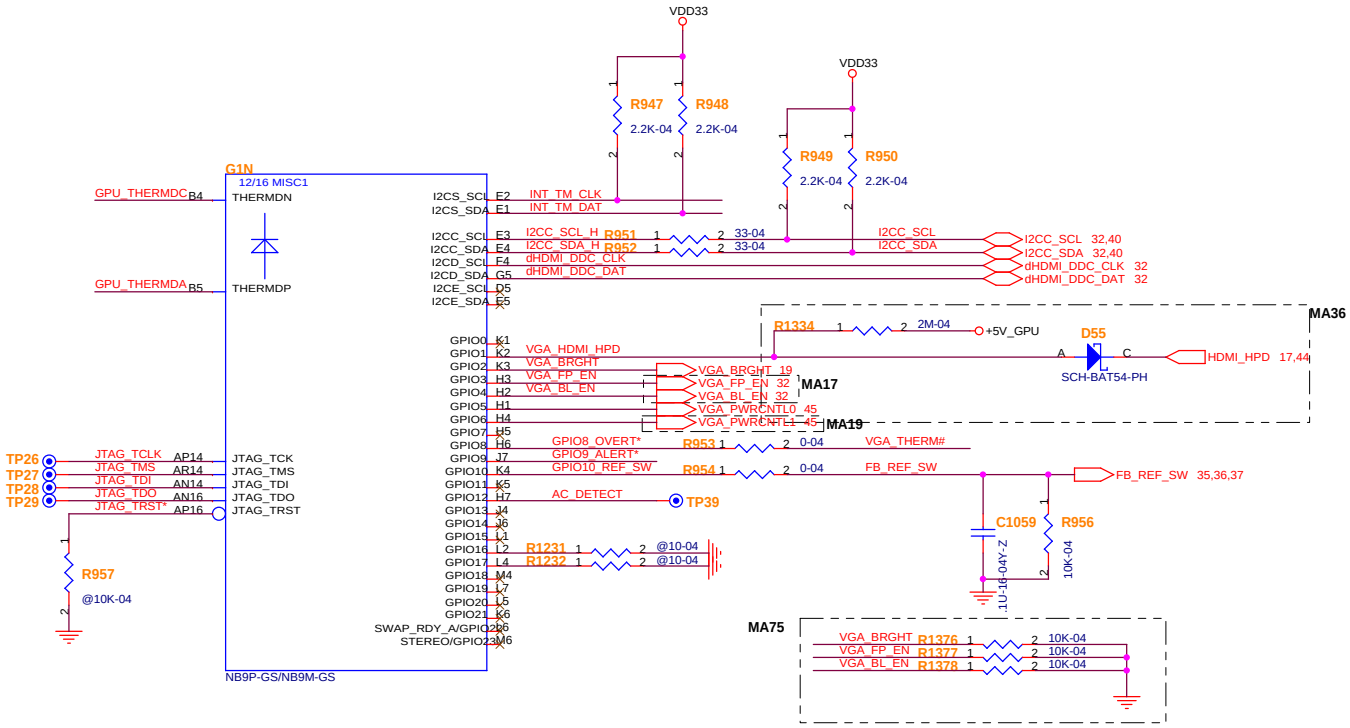

GPU THERMAL SENSOR

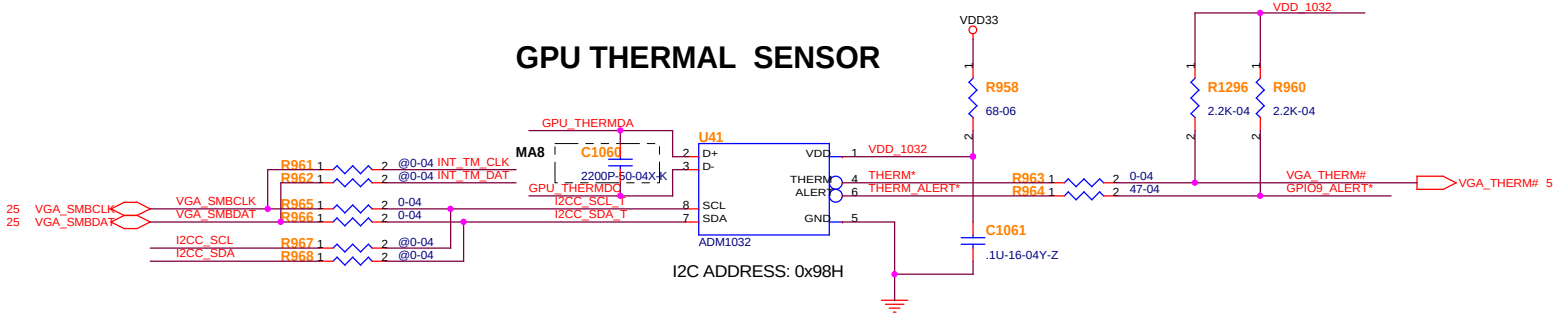

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | NB9P/M GPIO / THERMAL | Rev: C

Date: Thursday, April 24, 2008 | Sheet 41 of 50

MIOA

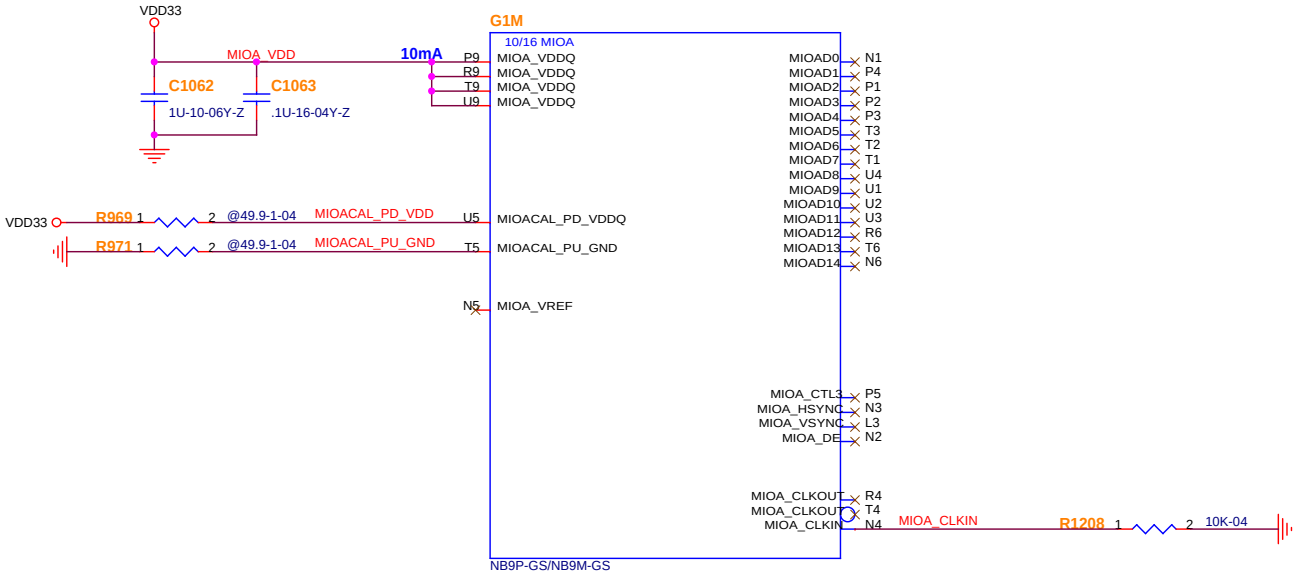

MIOB

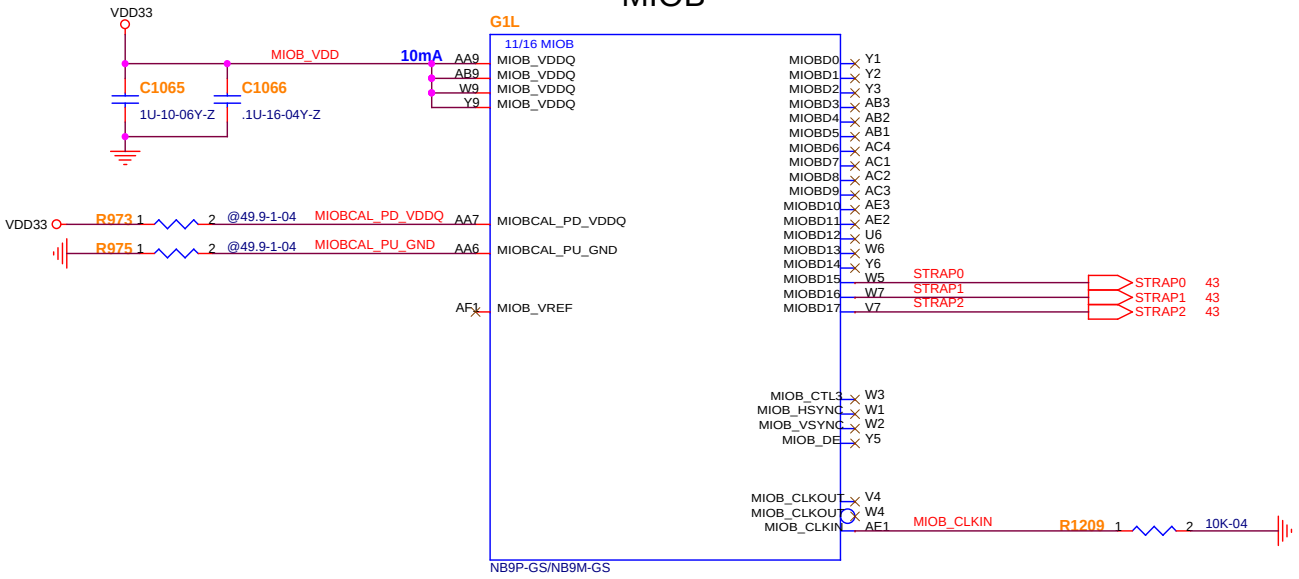

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size B	Document Number F50IXX NB9P/M MIOA / MIOB	Rev C
Date: Thursday, April 24, 2008	Sheet 42 of 50	

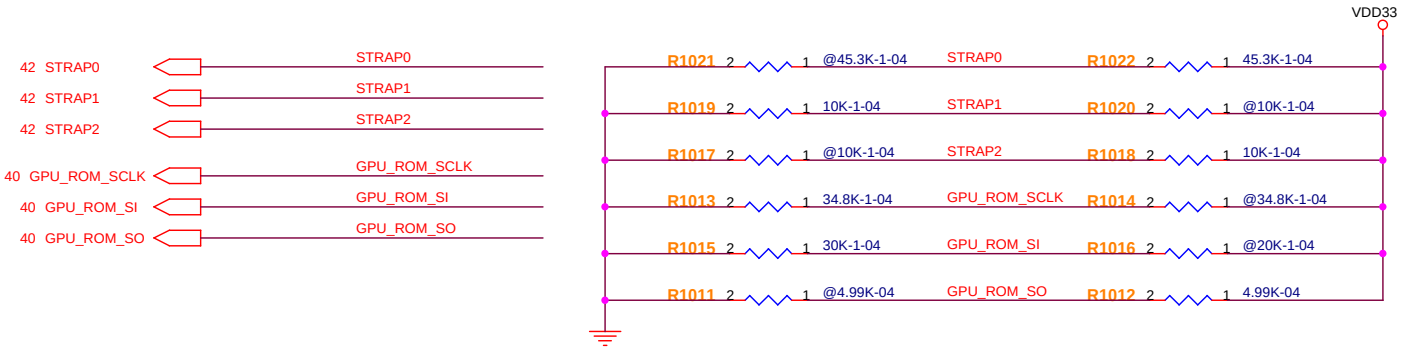

NB9M-GS/NB9P-GS

(GDDR3: Qimonda 16Mx32)

Strap[0] --> pull up 45K ohm 1% to +3VS
Strap[1] --> pull down 10K ohm 1% to GND
Strap[2] --> pull up 10K ohm 1% to +3VS
ROM_SCLK --> pull down 35K ohm 1% to GND
ROM_SI --> pull down 10K ohm 1% to GND
ROM_SO --> pull up 5K ohm 1% to +3VS

(GDDR3: Hynix 16Mx32)

Strap[0] --> pull up 45K ohm 1% to +3VS
Strap[1] --> pull down 10K ohm 1% to GND
Strap[2] --> pull up 10K ohm 1% to +3VS
ROM_SCLK --> pull down 35K ohm 1% to GND
ROM_SI --> pull down 15K ohm 1% to GND
ROM_SO --> pull up 5K ohm 1% to +3VS

(GDDR3: Samsung 16Mx32)

Strap[0] --> pull up 45K ohm 1% to +3VS
Strap[1] --> pull down 10K ohm 1% to GND
Strap[2] --> pull up 10K ohm 1% to +3VS
ROM_SCLK --> pull down 35K ohm 1% to GND
ROM_SI --> pull down 20K ohm 1% to GND
ROM_SO --> pull up 5K ohm 1% to +3VS

Signal	Bit 3	Bit 2	Bit 1	Bit 0
GPU_ROM_SO	1	0	0	1
GPU_ROM_SCLK	?	1	1	1
GPU_ROM_SI	0	0	0	1
STRAP2	1	0	0	1
STRAP1	0	0	0	1
STRAP0	1	1	1	1

Memory HW Strap

RAM_CFG[3:0]	Chip Config	FB Bus Width for NB9x	Definitions			GPU_ROM_SI
			Manufacturer	P/N	Speed (MHz)	
0001	16Mx32 DDR3	128/64-bit	Qimonda	K4J52324QE-BC14	700	10K_1 pull down
				HYB18H512321BF-12	800	
0010			Hynix	HY5RS123235BFP-11	900	15K_1 pull down
0011			Samsung	K4J52324QE-BC14	700	20K_1 pull down
0101	32Mx32 DDR3	128/64-bit	Qimonda	HYB18H1G321AF-14	700	30K_1 pull down
				HYB18H1G321AF-11	900	
0110			Hynix		700	35K_1 pull down
0111			Samsung	K4J10324QD-BC14	700	45K_1 pull down

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | NB9P/M STRAP | Rev: C

Date: Thursday, April 24, 2008 | Sheet 43 of 50

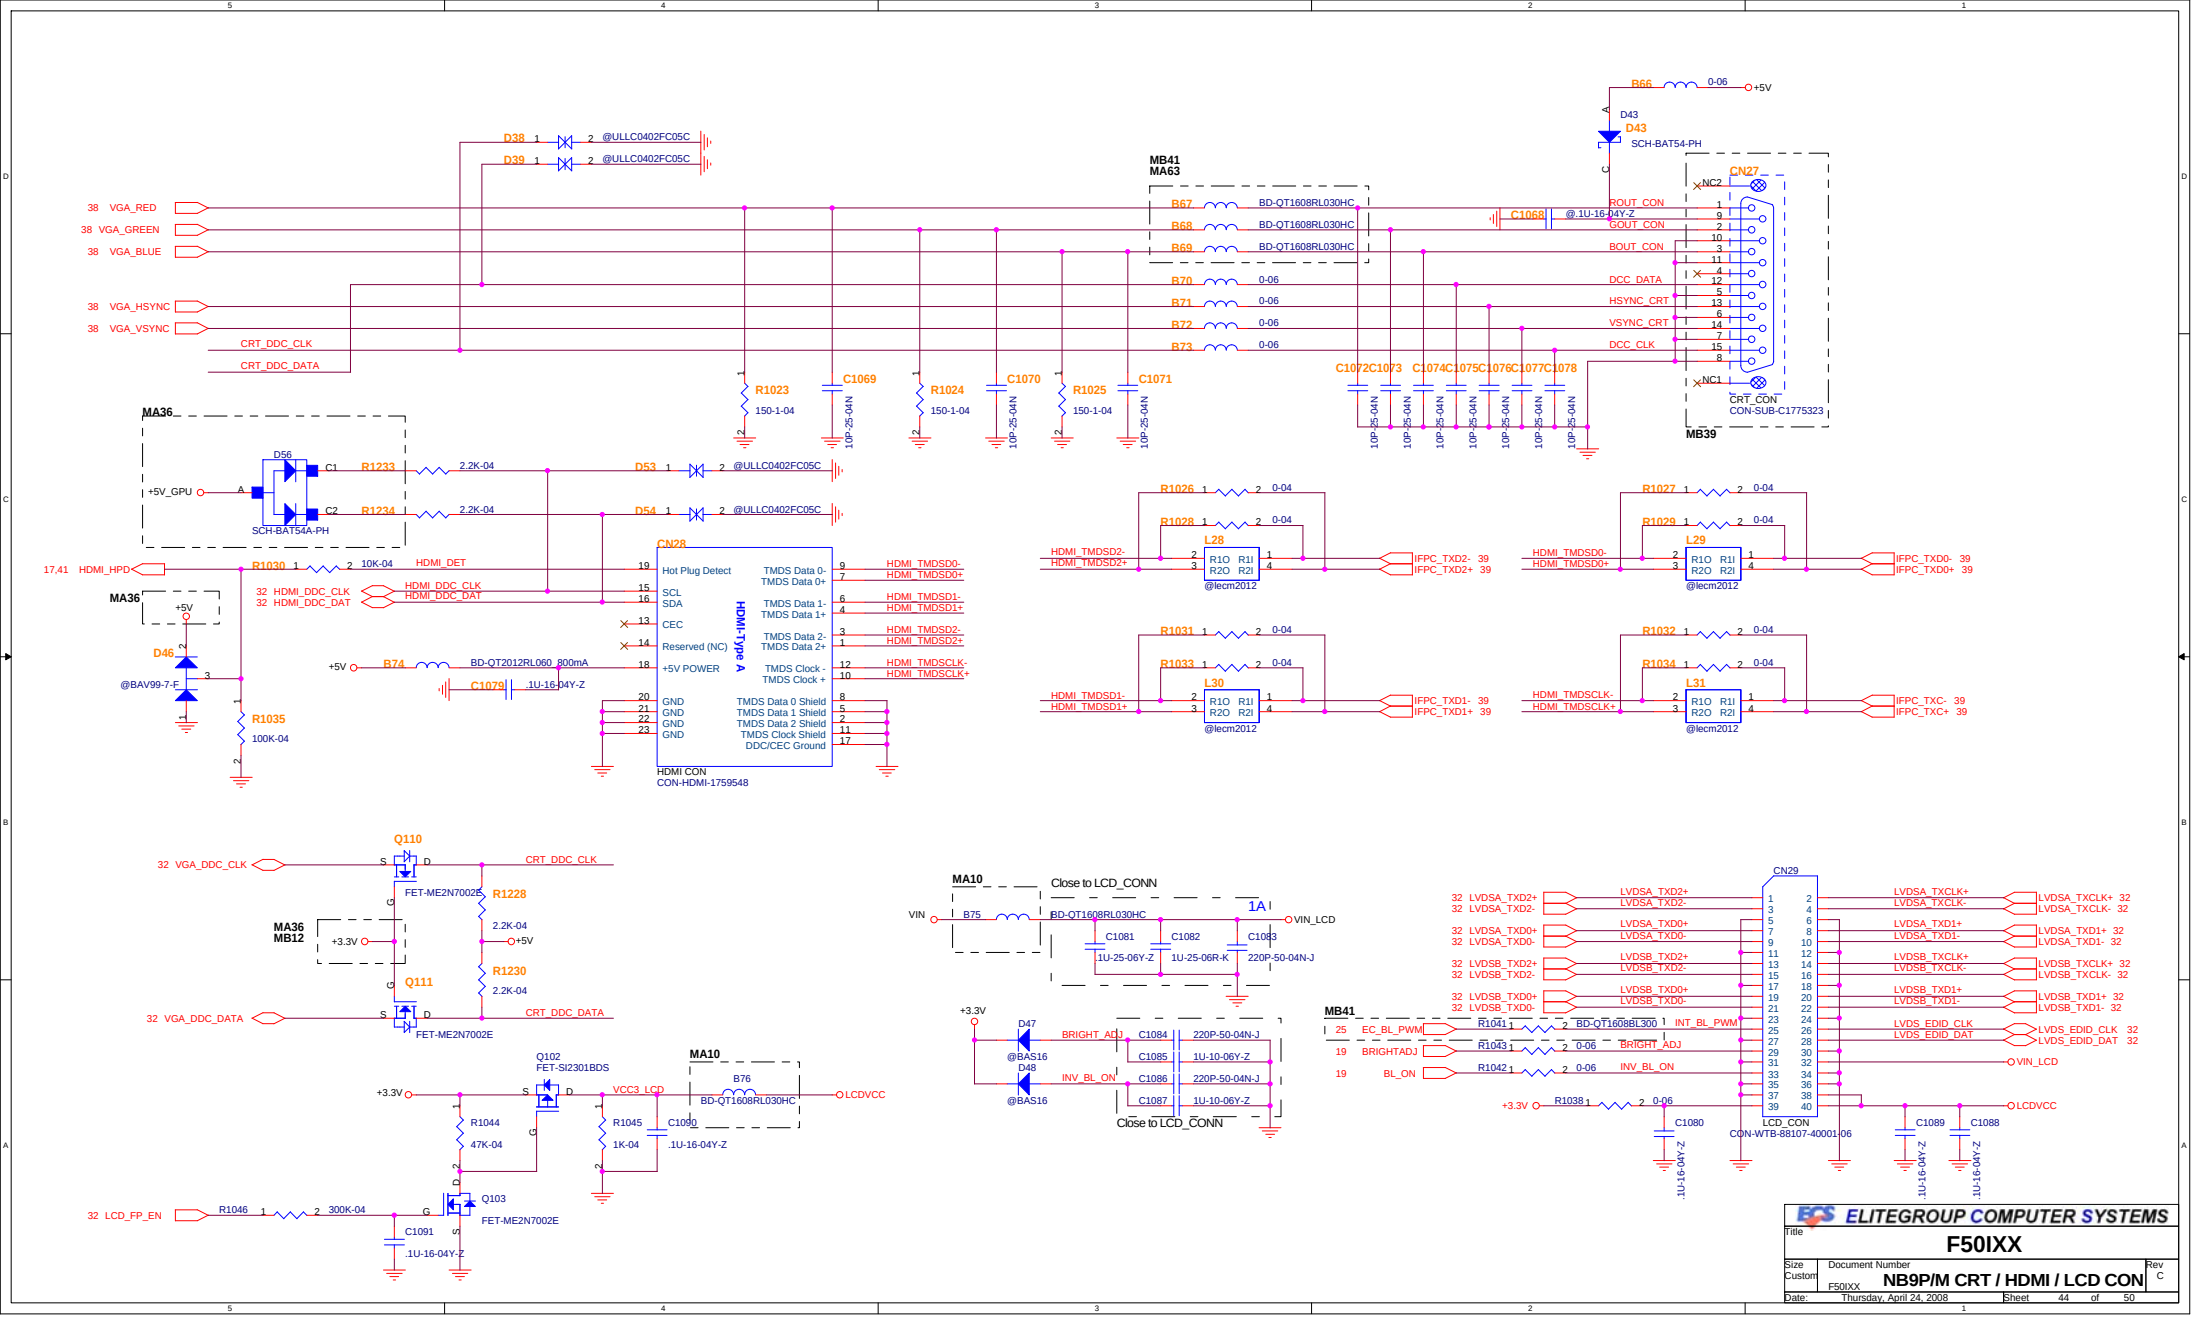
38 VGA_RED
38 VGA_GREEN
38 VGA_BLUE
38 VGA_HSYNC
38 VGA_VSYNC
CRT_DDC_CLK
CRT_DDC_DATA
D38 @ULLC0402FC05C
D39 @ULLC0402FC05C
MB41
MA63
R67 BD-QT1608RL030HC
R68 BD-QT1608RL030HC
R69 BD-QT1608RL030HC
R70 0-06
R71 0-06
R72 0-06
R73 0-06
C1068 @.1U-16-04Y-Z
ROUT_CON
GOUT_CON
BOUT_CON
DCC_DATA
HSYNC_CRT
VSYNC_CRT
DCC_CLK
B66 0-06 +5V
D43
SCH-BAT54-PH
CN27
CRT_CON
CON-SUB-C1775323
MB39
R1023 150-1-04
R1024 150-1-04
R1025 150-1-04
C1069 10P-25-04N
C1070 10P-25-04N
C1071 10P-25-04N
C1072 C1073 C1074 C1075 C1076 C1077 C1078 10P-25-04N
MA36
D56
+5V_GPU
C1 C2
R1233 2.2K-04
R1234 2.2K-04
SCH-BAT54A-PH
D53 @ULLC0402FC05C
D54 @ULLC0402FC05C
17,41 HDMI_HPD
R1030 10K-04
HDMI_DET
32 HDMI_DDC_CLK
32 HDMI_DDC_DAT
HDMI_DDC_CLK
HDMI_DDC_DAT
CN28
Hot Plug Detect
SCL
SDA
CEC
Reserved (NC)
+5V POWER
GND
GND
GND
GND
HDMI-Type A
TMDS Data 0-
TMDS Data 0+
TMDS Data 1-
TMDS Data 1+
TMDS Data 2-
TMDS Data 2+
TMDS Clock -
TMDS Clock +
TMDS Data 0 Shield
TMDS Data 1 Shield
TMDS Data 2 Shield
TMDS Clock Shield
DDC/CEC Ground
HDMI_TMDSD0-
HDMI_TMDSD0+
HDMI_TMDSD1-
HDMI_TMDSD1+
HDMI_TMDSD2-
HDMI_TMDSD2+
HDMI_TMDSCLK-
HDMI_TMDSCLK+
HDMI CON
CON-HDMI-1759548
MA36
+5V
D46
@BAV99-7-F
R1035 100K-04
+5V B74 BD-QT2012RL060 800mA
C1079 .1U-16-04Y-Z
R1026 0-04
R1028 0-04
L28
@lecm2012
HDMI_TMDSD2-
HDMI_TMDSD2+
IFPC_TXD2- 39
IFPC_TXD2+ 39
R1027 0-04
R1029 0-04
L29
@lecm2012
HDMI_TMDSD0-
HDMI_TMDSD0+
IFPC_TXD0- 39
IFPC_TXD0+ 39
R1031 0-04
R1033 0-04
L30
@lecm2012
HDMI_TMDSD1-
HDMI_TMDSD1+
IFPC_TXD1- 39
IFPC_TXD1+ 39
R1032 0-04
R1034 0-04
L31
@lecm2012
HDMI_TMDSCLK-
HDMI_TMDSCLK+
IFPC_TXC- 39
IFPC_TXC+ 39
Q110
32 VGA_DDC_CLK
FET-ME2N7002E
CRT_DDC_CLK
R1228 2.2K-04
MA36
MB12
+3.3V
+5V
R1230 2.2K-04
Q111
32 VGA_DDC_DATA
FET-ME2N7002E
CRT_DDC_DATA
Q102
FET-SI2301BDS
MA10
B76
BD-QT1608RL030HC
+3.3V
VCC3_LCD
LCDVCC
R1044 47K-04
R1045 1K-04
C1090 .1U-16-04Y-Z
32 LCD_FP_EN
R1046 300K-04
Q103
FET-ME2N7002E
C1091 .1U-16-04Y-Z
MA10
Close to LCD_CONN
VIN
B75
BD-QT1608RL030HC
1A
VIN_LCD
C1081 1U-25-06Y-Z
C1082 1U-25-06R-K
C1083 220P-50-04N-J
+3.3V
D47
D48
@BAS16
BRIGHT_ADJ
INV_BL_ON
C1084 220P-50-04N-J
C1085 1U-10-06Y-Z
C1086 220P-50-04N-J
C1087 1U-10-06Y-Z
Close to LCD_CONN
MB41
25 EC_BL_PWM
19 BRIGHTADJ
19 BL_ON
R1041 BD-QT1608BL300
INT_BL_PWM
R1043 0-06
BRIGHT_ADJ
R1042 0-06
INV_BL_ON
CN29
32 LVDSA_TXD2+
32 LVDSA_TXD2-
LVDSA_TXD2+
LVDSA_TXD2-
LVDSA_TXD0+
LVDSA_TXD0-
LVDSB_TXD2+
LVDSB_TXD2-
LVDSB_TXD0+
LVDSB_TXD0-
LVDSA_TXCLK+
LVDSA_TXCLK-
LVDSA_TXD1+
LVDSA_TXD1-
LVDSB_TXCLK+
LVDSB_TXCLK-
LVDSB_TXD1+
LVDSB_TXD1-
LVDS_EDID_CLK
LVDS_EDID_DAT
VIN_LCD
+3.3V
R1038 0-06
LCDVCC
C1080 .1U-16-04Y-Z
C1089 .1U-16-04Y-Z
C1088 .1U-16-04Y-Z
LCD_CON
CON-WTB-88107-40001-06
ELITEGROUP COMPUTER SYSTEMS
Title
F50IXX
Size Custom
Document Number
F50IXX
NB9P/M CRT / HDMI / LCD CON
Rev C
Date: Thursday, April 24, 2008
Sheet 44 of 50

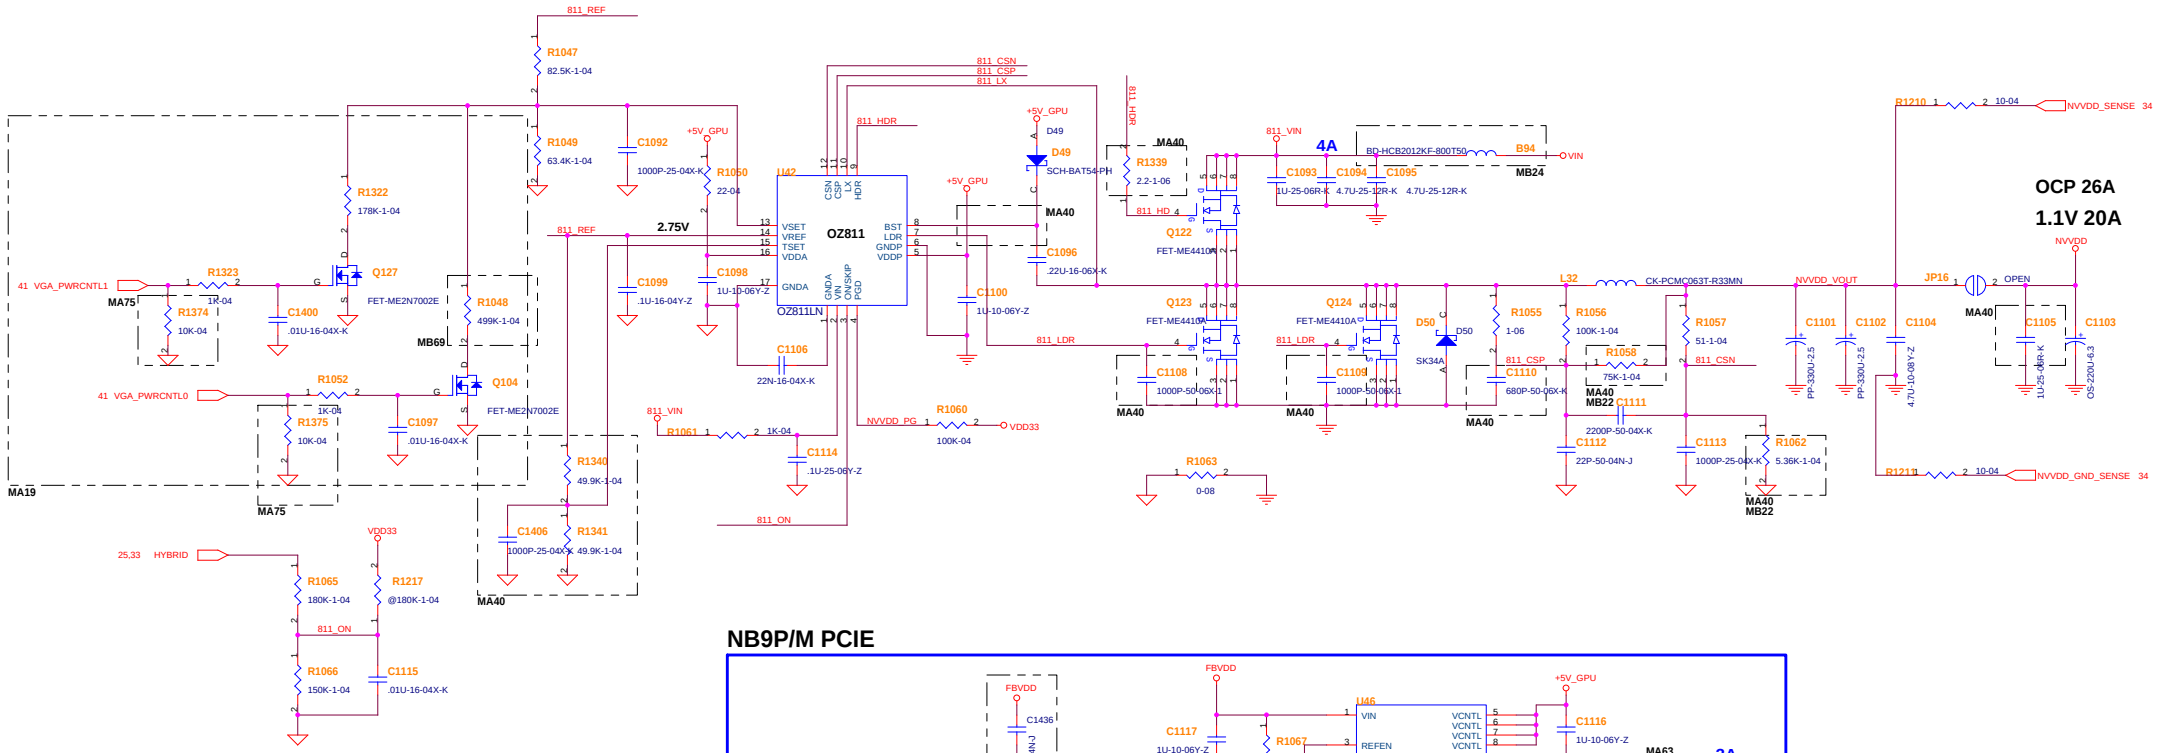

NB9P/M PCIE

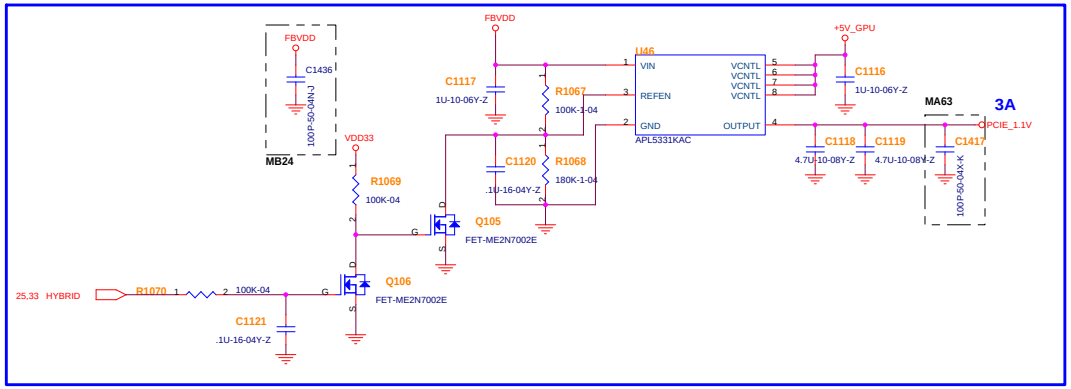

ITEM		NB9M-GS			NB9P-GS		
POWER SETTING		Performance	Balance	Max Bat	Performance	Balance	Max Bat
VGA_PWRCNTL0		L	L	L	H	H	H
VGA_PWRCNTL1		L	L	H	L	L	H
VOLTAGE		1.17V	1.17V	0.95V	1.05V	1.05V	0.9V
E/M CLOCK (With Loading)	AC	580/700	580/700	275/300	500/800	500/800	275/300
	DC	580/700	580/700	275/300	400/300	400/300	275/300
E/M CLOCK (Idle)	AC/DC	169/100					

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size: Custom | Document Number: F50IXX | NB9P/M NVVDD / PCIE1.1V | Rev: C

Date: Thursday, April 24, 2008 | Sheet 45 of 50

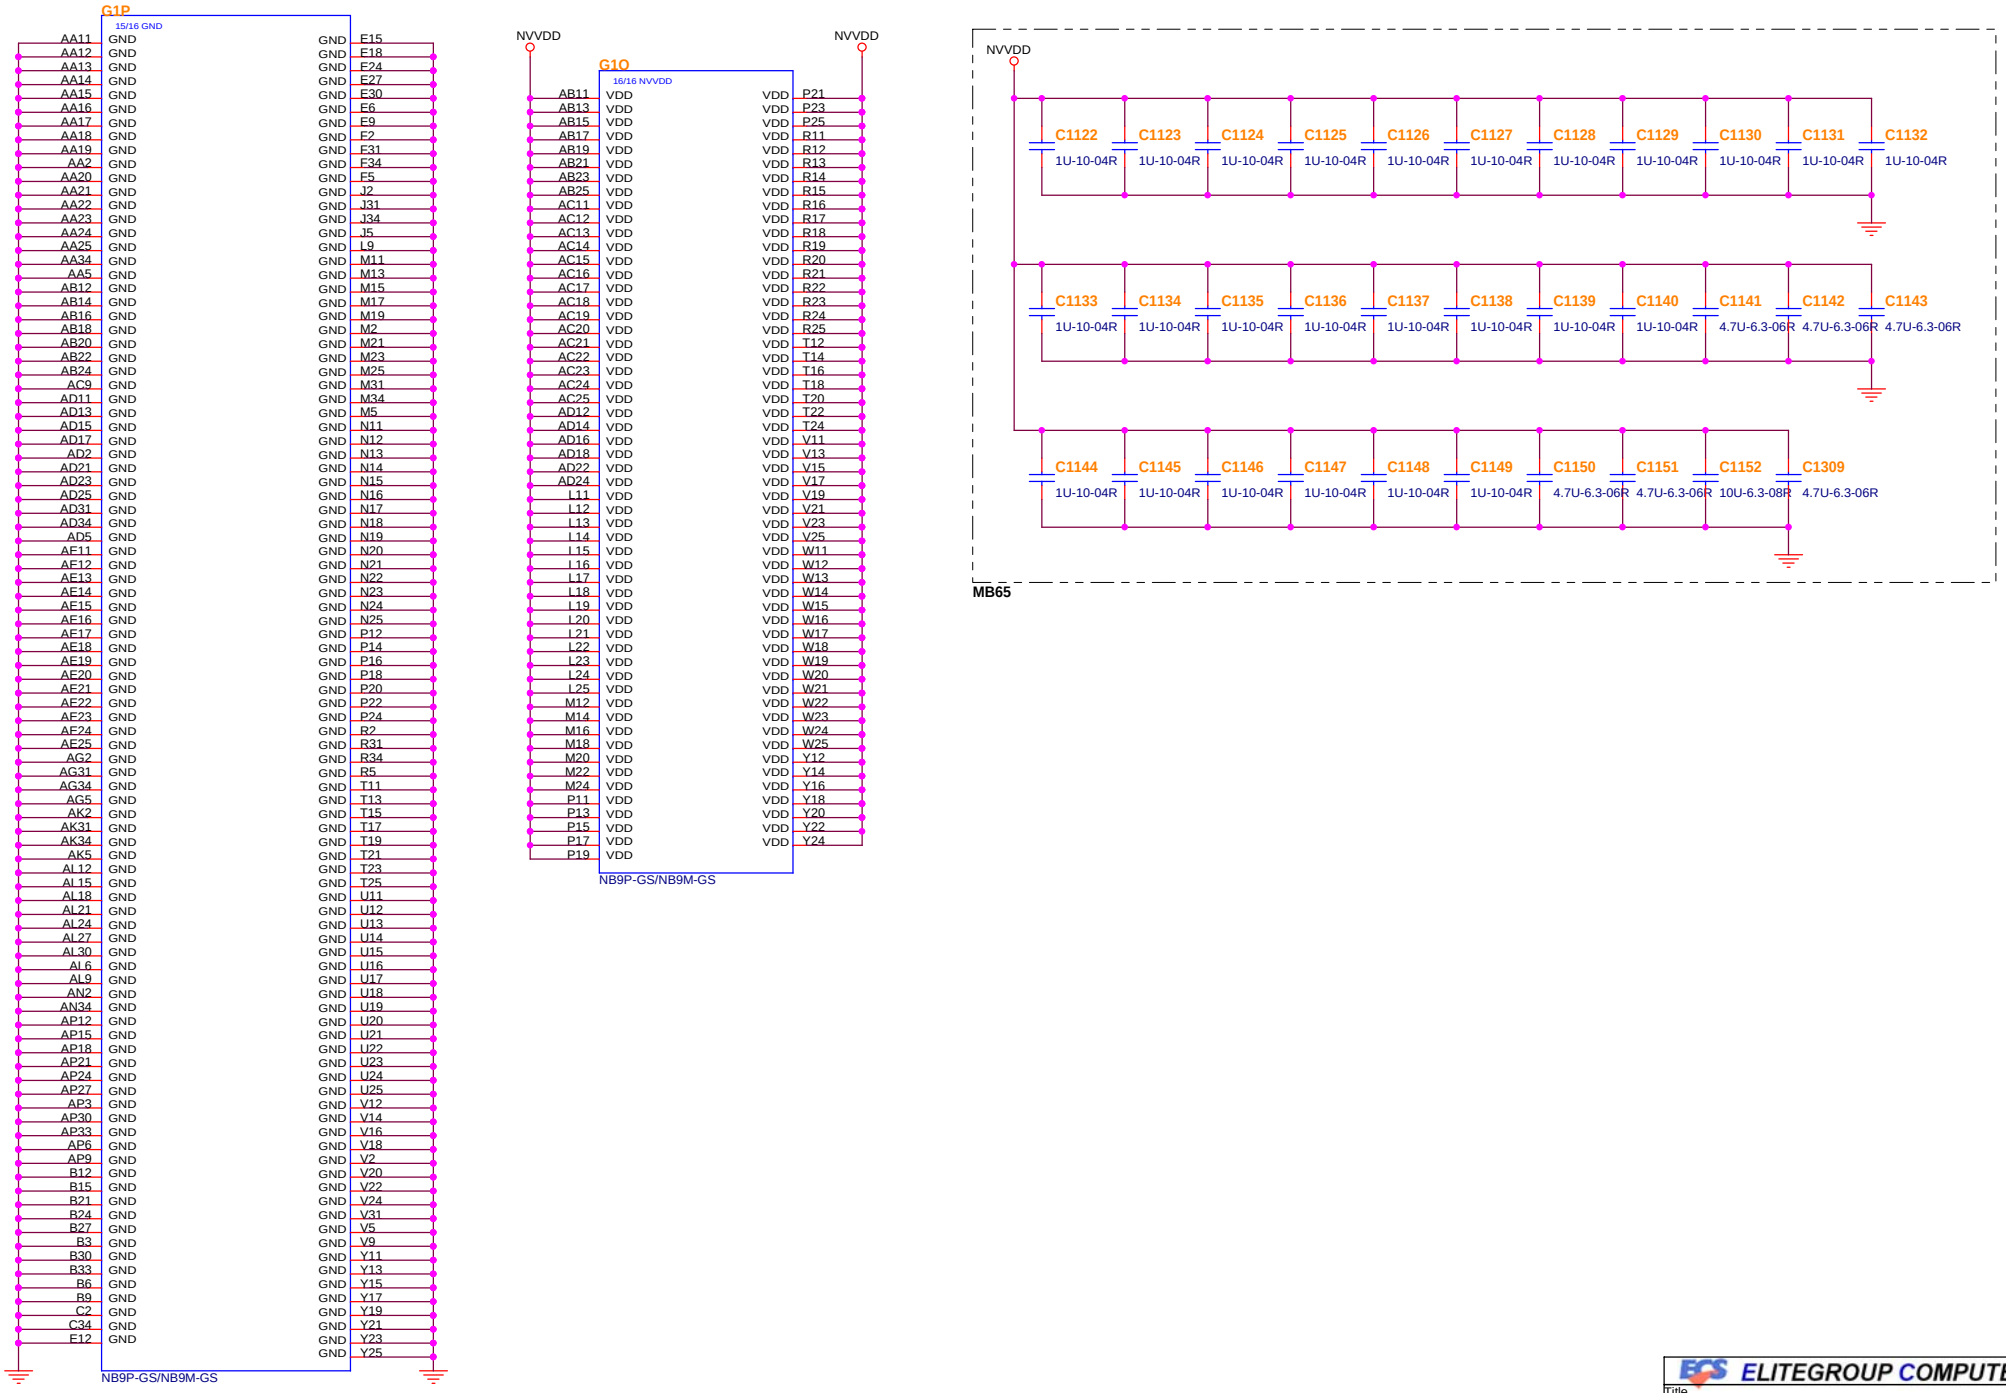

ELITEGROUP COMPUTER SYSTEMS

Title: F50IXX

Size	Document Number	Rev
Custom	NB9P/M NVVDD/DECOUPLING CAP	C
	F50IXX	

Date: Tuesday, April 22, 2008 Sheet 46 of 50

Close to pin 32,44

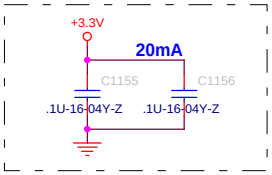

Close to pin 16

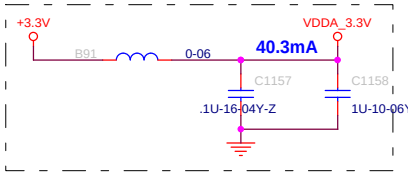

Close to pin 1,33,41

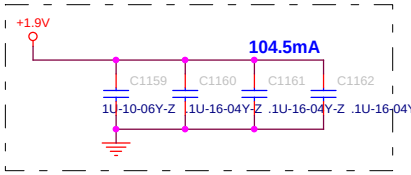

Close to pin 9,21,27

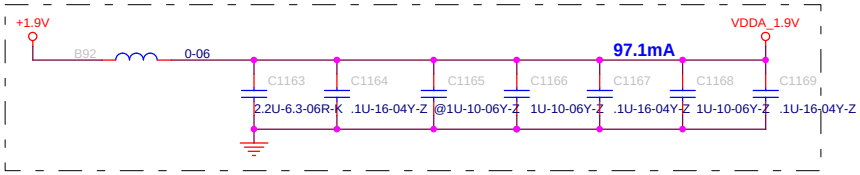


```
GPIO0    clock type of PCI Express
0: 25MHz oscillator
1: 100MHz differential clock from
PCI Express Finger*
GPIO1    clock source of SATA II
0: from internal clock source
1: from ASXIN & ASXOUT*

GPIO2   control interface to access internal debug registers
0: SMBus I/F *
1: Reserved for debugging

GPIO3   select SMBus ID address
0: 8'h44*
1: 8'h4A
```

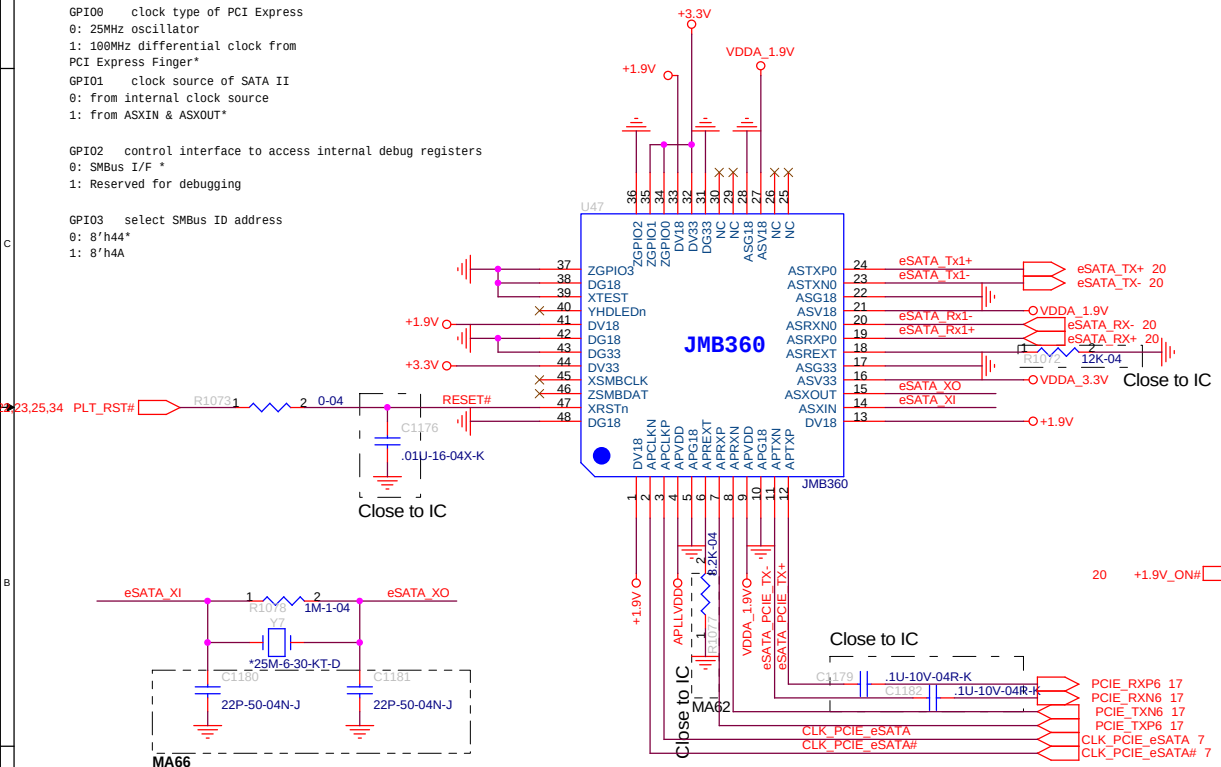

Close to pin 4

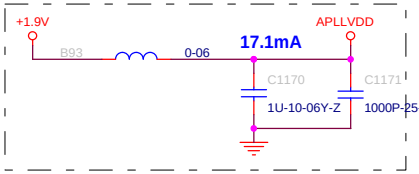

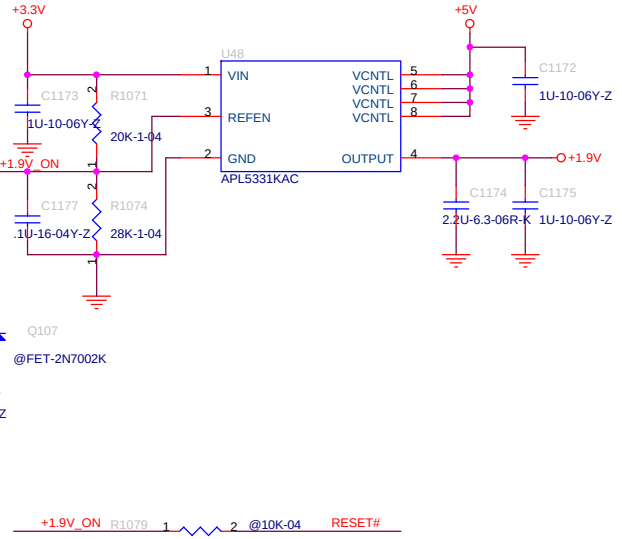

ELITEGROUP COMPUTER SYSTEMS			
Title: F50IXX			
Size: Custom	Document Number: e-SATA		Rev: C
	F50IXX		
Date: Thursday, April 24, 2008		Sheet 47 of 50	

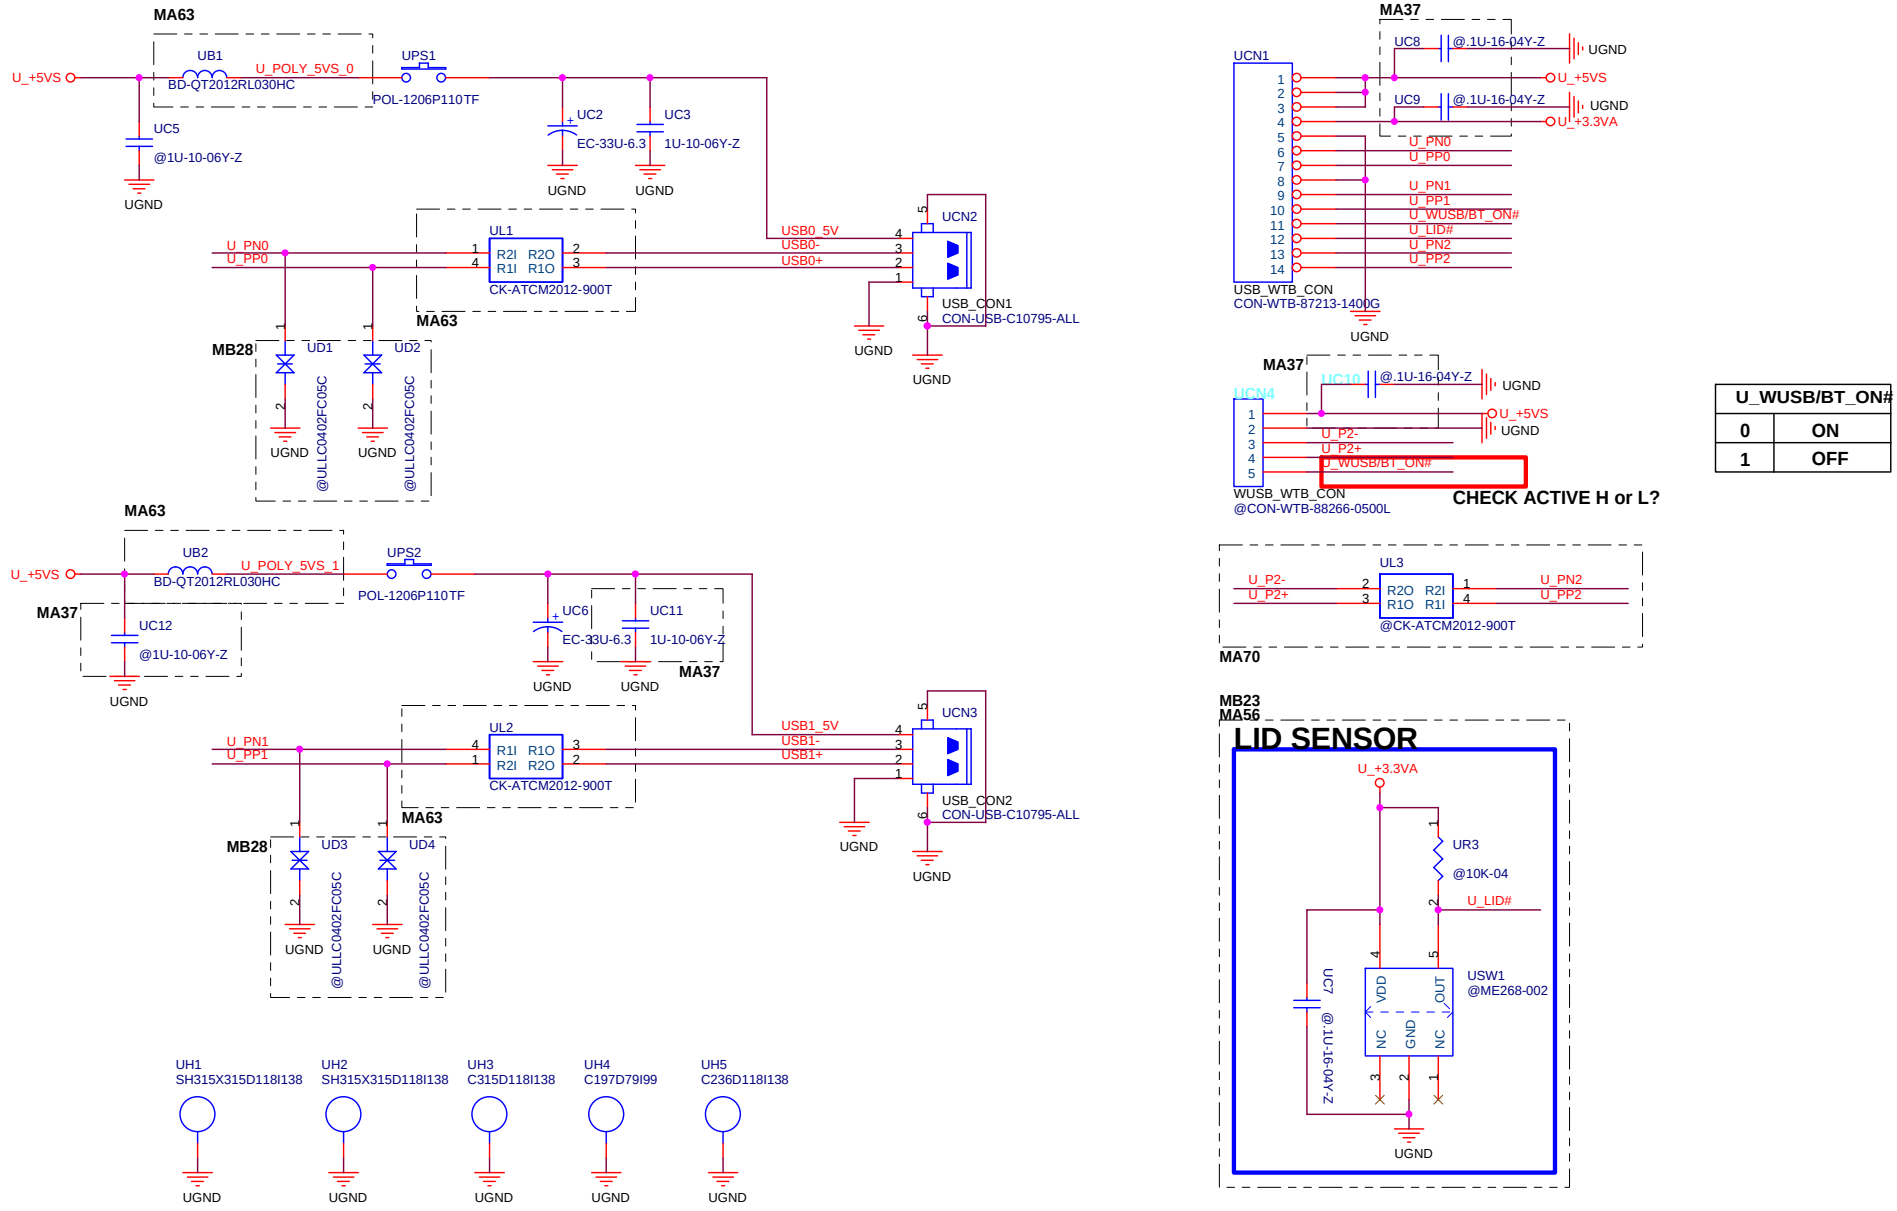

U_WUSB/BT_ON#	
0	ON
1	OFF

PCB P/N : 35GEF5000-C0

PCBA P/N : 80GEF5000-C0

ELITEGROUP COMPUTER SYSTEMS

Title	F50IXX	
Size B	Document Number F50IXX — USB BD	Rev C
Date: Tuesday, April 22, 2008	Sheet 48 of 50	

RA to RB Modify list:

Symbol	Modify Item	Modify Reason	Page	Note
MA1	S1 correct footprint to 1206 package	Footprint error	20	
MA2	CN15 correct layout library	Library error	20	
MA3	C783,C1242 change footprint to 0402 package	To avoid interfere with system memory	29	
MA4	C276,C277 correct footprint to 0402 packag e	Footprint error	12	
MA5	Change net name from TBD# to BROWSER#	FSC spec confirm BROWSER#	19,25	
MA6	ADD R1307,R1308,R1309,R1310 Add R1311	Reserved for disable TV/CRT function when use Hybrid function	9,11	
MA7	Change R490 from 100K-1-04 t o 1K-1-04	Fan can' work due to bom error	24	
MA8	Change C1060 from @2200P-50-04X-K to 220 0P-50-04X-K	Reduce thermal sensor noice	41	
MA9	Change R918 from @1K-1-04 to 1K-1-04	For NB9P/M HDMI function	39	
MA10	Change B75,B76 from BD-QT2012RL030H C_3A to BD-QT1608RL030HC	Bom error	44	
MA11	Change C806,C807 to 0805 package	Footprint error	29	
MA12	NB_CRT_R and NB_CRT_B swap	Net error	15	
MA13	Change R189 from 20K-1-04 to 43 .2K-1-04 Change R214 from 10k-04 to 1 0K-1-04	For DDC_EN input Level	14,15	
MA14	Change R203,R206,R209,R210 to 68-1-04 Change C342,C343,C344,C345 from 0-04 to 1P-50V-04N-C	For CH7318 DVI function	14	
MA15	CLK_ICH_SATA and CLK_ICH_SATA# swap	Net error	16	
MA16	Add R1312,R1313 10K-04 pull up	Follow Intel comments for ICH9M USB OCP	17	
MA17	Add U53,U57,Q130,R1314,R1315,R1316,R1317,R131 8R1343,R1344,R1345,C1399,C1407,C1048	For LVDS Hybrid DDC/Control signal	32,47	
MA18	Change U40 to I2CROM Add R1319,R1320,R1321 Change R944 from 10K-04 to @10K-0 ; R1207 from @1 0K-04 to 10K-04	1.For NV change HDCP ROM from Crypto ROM to I2C ROM 2.Colayout Crypto ROM and I2C ROM	40	
MA19	Add VGA_PWRCNTL1 Add Q127,R1322,R1323 R1049 change from 56-1-04 to 63.4K-1-04 ,R1048 change from 210K-1 -04 to 470K-1-04	Follow NV GPU core spec	41,45	
MA20	Change C838 from .47U-25-06Y-Z to .22U-16-06X-K	For sourcer request to solve shortage issue	31	
MA21	Change R377,R378 from 100K-04 to 4 .7K-04	For SMBUS pull high level	19	
MA22	Change R707 from 90.9K-1-04 to 97 .6K-1-04	Solve F50IN0 3D MArk'6 can't run due to 1.8V voltage level too low for GPU	29	
MA23	Change R686 to from 54.9K-1-04 to 62K-1-04	System sometimes will blue screen due to 1.05V voltage level too low for NB	29	
MA24	Change R1247,R1270 from 2.1K-1-04 to 1.15K-1-04 Change R1255,R1272 from 4.02K-1-04 t o 649-1-04 Change R1303,R1304 from 4.02K-1-04 to 0-04	System abnormal shutdown due to Vcore OCP setting too low	27	
MA25	Add U54,R1324,R1325,R1328,C1401	For CRT Hybrid function support	32	
MA26	Add KEY_OUT1/KEY_OUT17	Reserved for 17" keyboard number pad	25	
MA27	Reserved R1329,C1402 for ITE8 512-JX	ITE8512IX will phase out	25	
MA28	R789,R1143,R124,R125,R408 change package from M-R0402 to M-R0603 Change R1111 from 0-08 to 0 -06	For layout require	9,30 13	
MA29	R124,R125 change from option to mount for all project	For CRT Hybrid DDC detect	9	
MA30	Change C358,C362 from 1U-10-06Y-Z to @1U-10-06Y-Z ;cha nge C359,C363 from 1U-10-06Y-Z to .22U-16-06X-K	For RTC_RST# Rising time	16	
MA31	Change U49 footprint from M-SOP8B to M-SO8	Footprint error	17	
MA32	Change CN26 footprint from con_bat-m7_btj-07ro4g-sd001_oct to C1 44F3-X07XX-X	For M1 request	31	
MA33	Change R273 from 0-04 to @0-0 4	Schematic error , for Keep CPU clock output when system entry C3	17	
MA34	Remove R1099 and del net VL	Doesn't need for U18	28	
MA35	Change C1214,C1209 from .1U-16-04Y-Z to .01U-16-04X-K	Reduce +3.3VA_ON/+5VA_ON noise	28	
MA36	Add Q128,Q129,Q134,Q135,Q137,D55,D56,R1326,R1327,R137 0,R1371,R1384,R1385,R1390, R1393,R1394,R1386,R1387,R1388,R1389 and d el R1227,R1229 Reserved R1334 and change R205 setting	For HDMI Hybrid DDC detect For HDMI Hybrid HPD detect	9,32,41	
MA37	Change C1305,C1306,C1307,C1185,C1186 to U C9,UC10,UC8,UC11,UC12	Correct location name error	48	
MA38	Add R1335,R1336,C1403 and del R1102, R1104 Change C1220,C1237 from @3300P-50-06X-K to 3300P-50-06X-K Change R1096,R1109 from @2.2-06 to 1 -06 Change C1221,C1236 from @2200P-50-06X to 560 P-50-06X-K Change C1234 from @470P-50-06N-K to .01U-50V-06Y-Z and C1235 f rom 470P-50-06N-K to .01U-50V-06Y-Z Change R1100 from 40.2K-1-04 to 147K-1-04 and R1112 from 40. 2K-1-04 to 100K-1-04	Improve 3/5V power quality	28	
MA39	Add R1337,R1338,C1404 and del R697,R 699 Change C773,C774 from @3300P-50-06X-K to 3 300P-50-06X-K Change C794,C795 from @3300P-50-06X-K to 22 00P-50-06X Change R692,R704 from @2.2-06 to 1-0 6 Change C775,C796 from @2200P-50-06X to 560P-50-06X-K and 10 00P-50-06X-1 Change R695,R708,C776,C797 to option Change C776,C797 from 6800P-50-04X-K to 8.2N-25-04X-K	Improve 1.05/1.8V power quality	29	
MA40	Add R1340,R1341,C1406,R1339 and del R1051 Change C1108,C1109 from @2200P-50-06X to 1000 P-50-06X-1 Change C1110 from @3300P-50-06X-K to 68 0P-50-06X-K Change R1058 from 100K-1-04 to @100K-1-04 Change R1062 from 5.6K-1-04 to 11 .5K-1-04	Improve GPU 1.1V power quality	45	
MA41	Change R347 from 22.6-1-04 to 2 0-1-04	Improve USB signal quality	17	
MA42	Add C1405 Change R752 package from M-R0402 to M-0603	To protect battery when AC IN To enhance current rating for net "ICHP"	31	
MA43	Add net "AUX_PWR_EN"	correct Aux power enable function under AC mode	26,28	
MA44	Add R1346,R1347 Shift net from PIN32~PIN40	For EMI request	17	
MA45	Add R1348	To disable iTPM	25,32	
MA46	Change R356,R357 from 0-06 to @0 -06 Change C1320,C1321 from .1U-10V-04R-K to @.1U-10V-04R-K	VCCSUS1_05 and VCCSUS1_5 power are internal output don't need external power supply	18	
MA47	Change R330,R301,R262,R263 from 10K-04 to @10K-04	Follow Intel schematic	17	
MA48	Correct power plane from +3V to +3VS	Net error	17	
MA49	Reserved R1349	For ODD detect	20	
MA50	Change LAN_PHYPC from GPIO8 to GPIO12	Net error	17	
MA51	Del Q83,R820,R830,C1391 Reserved R1355,R1356,R1357,R135 8,R1359,R1360 Add R1350,R1351,R1352,R1353	Change Hybrid SW control signal from EC to SB	17,25,32	
MA52	Change R41 from @10K-04 to 10 0K-04 Change +3.3V to VDD_7421	Reserved pull high for NS For thermal IC power sequence	5	
MA53	Change R52 from 10K-04 to 1.5M-0 4 Add C1408,R1363	improve clkgen intial time	7	
MA54	Add C1409,C1419 and del C833	Reduce charger power noise	31	
MA55	Reserved PS1,JP26	For safety request	31	
MA56	Change R1299 from 0-04 to @0-0 4 Change C470 from .1U-16-04Y- Z to 0-04 Change UR3 from 10K-04 to @10 K-04 Change UC7 from .1U-16-04Y-Z t o @.1U-16-04Y-Z Change USW1 from MLX90248 to @MLX90248 Change R537 from @4.7K-04 to 4.7K -04	Disconnect LID# path on USB BD	19,25,48	
MA57	Change R255 from 24.9-1-04 to 22. 6-1-04	Improve SATA signal quality	16	
MA58	Change R482 from 10K-1-04 to 8 .2K-1-04 Del R479,R480 Change R477,R478 from 10K-04 to 4 .7K-04 Change R473 from 10K-04 to @39 0K-04 Add R1364,R1365,R1366	Follow Jmicro comments for 1394 only	23	
MA59	Del R143 and change net "PEG_RXPP3" to "PEG_RXP3"	Reduce PCIE signal branch	9	
MA60	Del R64	Use Crystal 12MHz to replace clockgen 48MHz For cardreader to improve EMI	7	
MA61	Change C1350 from @1000P-25-04X-K to 100 0P-25-04X-K Change R298 from @100K-04 to 1 00K-04 Changr R1244,R1271 from 0-06 to 2.2-1-06 Changr C1348,C1357 from @1000P-25-04X-K t o 3300P-50-06X-K	Improve Vcore power quality	17,27	
MA62	Change R1077 from 10K-1-04 to 8. 2K-1-04	Value error	47	

MA63	Add C1410
	Change B29,B30,B31 from 0-06 to BD- QT1608RL060
	Change B42 from 0-08 to BD-QT2012RL030HC; del R405,R406
	Del C1380,C1387,C1388 and change C1379 C1381,C1382,C1393 from .1U-25V-04Y-Z to @100P-50-04X-K
	Add B102,B103,B104 and remove JP9
	Add C1412,C1413
	Add C1414
	Add C1415,C1416 for all project
	Change B67,B68,B69 from 0-06 to BD- QT1608RL060
	Add C1417
	Change UB1,UB2 from 0-08 to BD- QT2012RL030HC
	Del UR1,UR2,UR4,UR5
	Add C1421,C1422,C1423
	Del net "CLK_CARD48"
	Change R1297,R1298 from 0-06 to B D-QT1005RL030
	Change B11,B13,B15,B21 from 0-06 to B D-QT1608RL030HC
	Add B80 to option table
	Add B105 and change B57 from BD-4532KF-800T80 t o BD-HCB2012KF-800T50
		For EMi request	13
			15
			20
			24
			29
			30
			33
			34
			44
			45
			48
			24
			19
			15
			11
			22
			26	

MA64	Add Q133,R1367,R1368,R1369 Add net "PWR_LED"	Improve power on LED light speed	19,25	
MA65	Correct VGA thermal sensor and dHDMI pull high power plane	Net error	25	
MA66	Change C102 from 20P-50-04N-J to 33P-50-04N-J Change C608,C609 from 20P-50-04N-J t o 22P-50-04N-J Change C1050 from 18P-50-04N-J to 22P-50-04N-J and C1051 f rom 18P-50-04N-J to 27P-50-04N-J Change C1180,C1181 from 10P-25-04N t o 22P-50-04N-J	Fine turn crystal accurate	7 23 40 47	
MA67	Change C1249,C1250,C1251,C1254,C1255,C1258,C1259,C 867,C868,C869 from .1U-16-04Y-Z to .1U-25V-04Y-Z	Bom error	30	
MA68	Change R1301 from @0-04 to 0-04 and R1302 from 10K-04 t o @10K-04	For LVDS B channel power supply	39	
MA69	Change Q99 from FET-2N7002 to @ FET-2N7002 Change R928 from @0-06 to 0-0 6 Change R929 from 0-04 to @0-0 4 Change C1045 from .1U-16-04Y-Z t o @.1U-16-04Y-Z	Change TMDS pull down path	39	
MA70	Del C75 Del UR6,UR7	For M1 requirement	7	
MA71	Change C466,C467 from @.1U-16-04Y- Z to .1U-16-04Y-Z	Reduce power noise	19	
MA72	Change R549 from 1K-04 to @1K-04 and update platform ID table	update plateform ID table	25	
MA73	Change R590 from 120K-1-04 to @120-1-04 and change R1306 from @0-04 to 0-04 Change R1284 from @0-04 to 0-0 4 Change R584 from 0-04 to @0-04 and change Q42 from FET-2N7002 to @FET -2N7002	Change ADAP_IN path to OZ8602	26 31	
MA74	Add Q136	For Hybrid audio	40	
MA75	Add R1374,R1375,R137 6,R1377,R1378	For GPU GPIO pull down	41,45	
MA76	Add C1424,C1425	Reserved for ESD	16,17	

RB to RC Modify list:

Symbol	Modify Item	Modify Reason	Page	Note
MB1	Change R52 from @1.5M-04 to @1.5M-1-04	Change path to SB for ICH9M control CLK_PWGD timing change	7	
	Change C1408 from .1U-16-04Y-Z to @.1U-10-04X-K			
	Change R1363 from .@0-04 to 0-04			
MB2	Change power plane from +5VA to +5VS	Solve power LED double flash issue when Press power button to power on	19	
MB3	Del NB_R,NB_G,NB_B net name	Net error	15	
MB4	Correct power plane from +3VS to +3V	Follow Intel schematic	17	
MB5	L7 correct footprint to DFDH2012T package	Footprint error	20	
MB6	Add R1397 and change L35 to F50IN5 only	For M1 request	22	
	Del JP26,JP15		31	
MB7	Change U9 to F50IN5 only	For 8102E feature	22	
MB8	Change C1348,C1357 from 3300P-50-06X-K to 3300P-50-04X-K	Bom error	27	
MB9	Change C1405 from 22N-16-04X-K to .022U-50V-04Y-Z	Bom error	31	
MB10	Change R1315.R1316,R1317,R1318,R1324,R1325,R1326,R1327	For F50IN0 function	32	
	Add RN17,RN18,RN19,RN20			
	Add R1400		34	
	Add R1401		40	
MB11	Change R1301 from 0-04 to @0-04 and R1302 from @10K-04 to 10K-04	Disable LVDS B channel power supply	39	
MB12	Change R124,R125 from 2.2K-06 to @2.2K-06 and for F50IN5 only	For F50IN5 Hybrid function	9	
	Change Q128,Q129,R1388,R1389 for F50IN5 only			
	Change +5V to +5VA		32	
	Change U33,U35,U53,U54,U57,Q128,Q129,R1388,R1389,R1328,C1401,C860,C1399,R1314, C1407,R1343 for F50IN5 only			
	Change U33 footprint			
	Change Q84,Q85,C1361,C869,R850,C865,R848,C867 for F50IN5 only		33	
	Change U52,R1361,R1362,C1397 for F50IN5 only		34	
	Change +3VA to +3V		44	
	Change Q136 for F50IN5 only		40	
	Del U35 and C862		31	
MB13	Change R1307,R1308,R1309,R1310 for F50IN0 only	For F50IN0/IN5 disable NB CRT	9	
	Change R1309,R1310 from @0-04 to 0-04			
	Change R121,R122,R123 to option table			
	Change R207,R111,R112 for F50II0/IN5			
	Change C148,C158,C197,C210 to option table		11	
	Change B6,R169,C147,C159,R1311,R174 for F50II0 only			
MB14	Change swap SATA port 1 and port4	Solve ODD can't enable AHCI for new bios code	16	
	Change C365,C366 from 0-04 to .01U-16-04X-K			
	Change C493,C496 from .01U-16-04X-K to 0-04		20	
MB15	Change RN1 from 56-8P4R-04 to 56-8P4R-04-1	Bom eror	17	
	Change RN5,RN6,RN8,RN9,RN10,RN11,RN12,RN13,RN14,RN15,RN16 from 56-8P4R-04 to 56-8P4R-04-1		26	
MB16	Colayout with CH7318B	For CH7318A update IC version to CH7318B	14	
	Add R1402			
	Change R208 from 100K-04 to @100K-04			
	Change Q6 from FET-2N7002 to @FET-2N7002			
	Change R191 from @4.7K-04 to 4.7K-04			
	Change R194,R195,R199 from 10K-04 to @10K-04			
MB17	Change Q64 from @FET-P2003BVG to FET-P2003BVG	For S3 leakage current and power sequence	30	
MB18	Change CN24 pin define	For M2 and ME request	25	
MB19	Change R1198,R1199 from 4.7K-04 to 3.6K-04	Follow Realtek FAE comments	22	
	Change R1199 from @4.7K-04 to @3.6K-04			
MB20	Change R1329 from 0-04 to .1U-16-04Y-Z	For sourcer request	25	
	Change C1402 from @1U-10-04Y-Z to 1U-10-04Y-Z			
MB21	Change R1092,R1103 from 150K-1-04 to 0-04	Improve power off leakage current	28	
	Change C1209,C1214 from .01U-16-04X-K to 10P-25-04N			
MB22	Change R1062 from 11.5K-1-04 to 5.36K-1-04	Correct NVVDD OCP	45	
	Change R1058 from @100K-1-04 to 75K-1-04			
MB23	Change USW1 from @MLX90248 to @BU52026G	For sourcer request	48	
MB24	Change CN15 from CON-USB-1909574-1 to CON-USB-1759582-1	For EMI request	20	
	Change C1421 from @.1U-16-04Y-Z to 100P-50-04N-J		24	
	Change C1379,C1381,C1382 from @100P-50-04X-K to 100P-50-04N-J			
	Change C1414 from 10P-25-04N to 100P-50-04N-J and add C1437		33	
	Add C1431,C1433		30	
	Add C1432,C1434,C1435		29	
	Change C88,C89,C91,C95,C96 from @10P-25-04N to 100P-50-04N-J		7	
	Change C1246 from @.1U-25V-04Y-Z to 100P-50-04N-J		30	
	Add C1436 for all project		45	
	Change B58 from @BD-QT4532KL080HC to BD-QT4532KL080HC and add B107 ; del JP4		28	
	Change L2,L4 from @CK-ATCM2012-900T to CK-ATCM2012-900T		19	
	Del R370,R371,R383,R386			
	Change L8 from @CK-ATCM2012-900T to CK-ATCM2012-900T		27	
	Del R436,R437			
	Change C1393,C1379 net		24	
	Change C1379 from 100P-50-04N-J to @100P-50-04N-J			
	Change B59 type from BD-4516KF-600T60 to BD-QT2012KL120HC-5 and add B108 ; del JP7		29	
	Del B82		27	
	Change B94 type from BD-4516KF-600T60 to BD-HCB2012KF-800T50		45	
	Change B62 type from BD-4532KF-800T80 to BD-QT2012KL120HC-5 and add B109		31	
	Add C1438,C1439			
	Add C1440		13	
	Add C1441,C1442		20	
MB25	Change C735,C1403,C755 from 4.7U-10-08Y-Z to @4.7U-10-08Y-Z	Improve 3/5V power quality	28	
	Change C1219 from 470P-50-06N-K to 6.8N-16-04X-K			
	Add C1430			
	Del C1403			
MB26	Add H24,H25	Improve PCB strength on NB and GPU	31	
	Change H22,H23 footprint from holetc197bc79d79i99 to HOLEC79D79N to be NPTH HOLE	For ME request		
MB27	Change R1178 from 1K-04 to @1K-04	Change Lan power path	22	
	Change R1166 from @0-06 to 0-06			
	Change R1171 from 100K-04 to @100K-04			
	Change Q108 from FET-SI2301BDS to @FET-SI2301BDS			
	Change Q109 from FET-2N7002 to @FET-2N7002			
MB28	Add D57,D58	Reserved ESD solution for USB port	20	
	Add UD1,UD2,UD3,UD4		48	
MB29	Change C1342 from .1U-16-04Y-Z to 4.7U-6.3-06R	For new Card +1.5V_PCIE drop issue	21	
	Change C552 from .1U-16-04Y-Z to 1U-10-04Y-Z			
MB30	Add R1403	Add VL current sink path	28	
MB31	Change CN7 DMic pin define	For ME request	19	
MB32	Change Q137,R1390,R1275,R1350,R1351,R1352,R1353,R1274 for F50IN5 only	For F50IN5 Hybrid	17	
MB33	Change R1370,R1371from 0-04 to @0-04	Option for CRT EDID	32	
MB34	Add R1404,R1405,R1406,R1407,R1408	Colayout Mini PCI 1.1/1.2 power plane	21	
MB35	Change power plane from VDD33 to +5V_GPU	Solve HDMI noise when HP Jack plug in	40	
MB36	Change C1042 footprint from M-C0603 to M-C0402	Footprint error	39	
MB37	Change L16 for F50II0 only	For CRT ripple issue	28	
	Add L36			
MB38	Change R255 from 22.6-1-04 to 19.6-1-04	Improve SATA signal quality	16	
MB39	Change H18 footprint	For M1 request	31	
	Change JP22 footprint		26	
	Change RAD1 package			
	Change RCH1 package			
	Del R709 and add JP26		29	
	Change CN27 footprint		44	
MB40	Change C1219 footprint from M-C0603 to M-C0402	Footprint error	28	
MB41	Change R1041 from 0-06 to BD-QT1608BL300	For EMI request	44	
	Change B67,B68,B69 from BD-QT1608RL060 to BD-QT1608RL030HC			
	Change R1297,R1298 from BD-QT1005RL030 to BD-QT1608BL040		15	
	Change B29,B30,B31 from BD-QT1608RL060 to BD-QT1608RL030HC			
	Change L11 from CK-223LC0801T2.2 to CK-ARI223LC0801TA		23	
	Change L33,L34 from CK-223LC0801T2.2 to CK-ARI223LC0801TA		22	
	Add R1409,R1410		19	
	Change C1379 from @100P-50-04N-J to 100P-50-04N-J		24	
	Add C1443,C1444			
MB42	Change L34 for F50IN5 only	For F50IN5 only	22	
MB43	Change R1112 to option table	For different choke type change OCP setting	28	
MB44	Change R205 table for F50IN0/IN5	Table error	6	
MB45	Change R207 for F50II0 only	For F50II0 only	6	
MB46	Change R1307,R1308,R1309,R1310 for F50IN0/IN5	For F50IN0/IN5 disable NB CRT	9	
MB47	Change C147 from .1U-16-04Y-Z to .01U-16-04X-K	For Bom control easy	11	
	Change C148 from .01U-16-04X-K to .1U-16-04Y-Z			
MB48	Change C1303 and R1195,R1198,R1199 for F50IN5 only	For 8111C only	22	
MB49	Change R1156 from @1K-04 to 1K-04	For +3.3VA current sink path	30	
	Change C1260 from @.1U-16-04Y-Z to .1U-16-04Y-Z			
	Change R519 from @0-04 to 0-04			
MB50	Change C655 from @.1U-16-04Y-Z to @.1U-25-06Y-Z	Footprint error	25	
MB51	Change R1207,R942 from 10K-04 to 2.2K-04	For NV request to improve HDCP CLK/DAT rise time	40	
MB52	Change R937 for F50IN5 only and change value from @3.4K-1-04 to 36K-1-04	For NV request to solve HDMI Audio pop noise for NB9P	40	
MB53	Change C1052 to option table	For NV request to solve HDMI Audio pop noise for NB9P/M	40	
MB54	Change C1402 from 1U-10-04Y-Z to @1U-10-04Y-Z and update option table	To fix ITE8512-JX 3.3V leakage current	25	
MB55	Add C1445,C1446,C1447,C1449	For EMI request	22	
	Change C1271,C1272 for all project			
MB56	Add R1411	For NV request	39	
MB57	Del TP4,TP8,TP31,TP38	For M1 request	9	
	Del TP24		34	
	Del TP14,TP15,TP18,TP19,TP37		17	
MB58	Change C88,C89,C91,C95,C96 from 100P-50-04N-J to @10P-25-04N	For ITE8512-JX code can't run issue	7	
MB59	Change R1257 from 3.48K-1-04 to 3K-1-04	For CPU load line	27	
MB60	Change H19 package from C315D157I177 to C236D157I177-1	For ME request	31	
MB61	Change C8,C9,C14,C15,C1310,C1311,C1324,C1325,C1329,C1326,C1327,C1328 from 4.7U-10-08Y-Z to 10U-6.3-08R	Improve CPU power ripple	6	
	Change C1335 from @PP-330U-2.5 to SC-220U-2		27	
MB62	Change R1255,R1272 from 649-1-04 to 576-1-04	Change Vcore OCP to 47A	27	
MB63	Change R707 from 97.6K-1-04 to 100K-1-04	Increase Vram power level	29	
MB64	Change C552 from 1U-10-04Y-Z to 1U-10-04R	For bom easy control	21	
	Change C1242 from 1U-10-04Y-Z to 1U-10-04R		29	
	Change C1047,C1337,C1338 from 1U-10-04Y-Z to 1U-10-04R		40	
MB65	Change C1122~C1140,C1144~C1149 from .1U-16-04Y-Z to 1U-10-04R	Improve GPU power quality	46	
	Change C1141,C1142,C1143,C1150,C1151,C1309 from 1U-10-06Y-Z to 4.7U-6.3-06R			
MB66	Change R937 from 36K-1-04 to @36K-1-04	Solve HDMI Audio no function issue	40	
MB67	Change C229,C247 from .1U-16-04Y-Z to 1U-10-04R for all project	Improve +1.8V power quality for P memory test fail issue for all project	12	
	Change C228,C246 from 1U-10-06Y-Z to 4.7U-6.3-06R for all project			
MB68	Change Q99 from @FET-2N7002 to FET-2N7002	Change TMDS pull down path for F50IN0/IN5	39	
	Change R928 from 0-06 to @0-06			
	Change R929 from @0-04 to 0-04			
	Change C1045 from @.1U-16-04Y-Z to .1U-16-04Y-Z			
MB69	Change R1048 from 470K-1-04 to 499K-1-04	Increase GPU power level for NB9P	45	
MB70	Change Q64 from FET-P2003BVG to @FET-P2003BVG	For 1.05V power drop to solve F50II0 CPU silent hang up and system doesn't stable	30	
MB71	Change R185,R198 from @4.7K-04 to 4.7K-04	Solve DVI sometimes detect fail issue	14	
	Change R186 from 0-04 to @0-04			
	Change R189 from 43.2K-1-04 to @56K-1-04			
	Change R196 from 4.7K-04 to @4.7K-04			
	Change Q5 from FET-ME2N7002E to @FET-ME2N7002E			
	Change R214 from 10K-1-04 to 36K-1-04		15	
	Change R217 from @100K-1-04 to 1U-10-04R			
MB72	Change R1198 for all project	Schematic error	22	
MB73	Change R1143 from 0-06 to 33K-1-06	Solve USB can't work issue	30	